

# भारत का राजपत्र The Gazette of India

असाधारण

EXTRAORDINARY

भाग II—खण्ड 3—उप-खण्ड (II)

PART II—Section 3—Sub-section (II)

प्राधिकार से प्रकाशित

PUBLISHED BY AUTHORITY

सं. 2667]

नई दिल्ली, मंगलवार, अगस्त 13, 2019/श्रावण 22, 1941

No. 2667]

NEW DELHI, TUESDAY, AUGUST 13, 2019/SHRAVANA 22, 1941

श्रम और रोजगार मंत्रालय

अधिसूचना

नई दिल्ली, 13 अगस्त, 2019

का.आ. 2927(अ).—29 दिसंबर, 2018 को झारखंड राज्य के जिला गोड्डा में, मेसर्स ईस्टर्न कोल्ड फील्ड्स लिमिटेड की राजमहल की खुली खदानों में एक दुर्घटना घटित हुई थी;

और, 2017 की रिट याचिका संख्या 66 (मोहम्मद सर्फराज बनाम झारखंड राज्य और अन्य) में रांची स्थित माननीय झारखंड उच्च न्यायालय ने तारीख 5 अप्रैल, 2019 के आदेश द्वारा मामले का निपटान करते हुए यह अधिनिर्धारित किया कि "तथापि, दुर्घटना के कारणों और परिस्थितियों की जांच के लिए जांच न्यायालय की परिधि बहुत व्यापक है और यदि अतिरिक्त सुरक्षा संबंधी कार्रवाई या उपचारी उपायों का किया जाना अपेक्षित है तो इस संबंध में जांच न्यायालय सिफारिश कर सकता है। ऐसी परिस्थितियों में केंद्रीय सरकार को खान अधिनियम, 1952 की धारा 24 में यथा अनुध्यात पूर्वोक्त प्रयोजन के लिए जांच न्यायालय की नियुक्ति पर विचार करना चाहिए";

और, केंद्रीय सरकार की यह राय है कि दुर्घटना के कारणों और परिस्थितियों की किए जाने वाले अपेक्षित अतिरिक्त सुरक्षा संबंधी कार्रवाई या उपचारी उपायों के लिए सिफारिशें, यदि कोई हों, करने की औपचारिक जांच की जानी चाहिए;

अब, केंद्रीय सरकार खान अधिनियम, 1952 (1952 का 35) की धारा 24 की उपधारा (1) द्वारा प्रदत्त शक्तियों का प्रयोग करते हुए श्रीमती रश्मी वर्मा, पूर्व सचिव, भारत सरकार को जांच करने के लिए और तीन मास के भीतर रिपोर्ट प्रस्तुत करने के लिए नियुक्त करती है। केंद्रीय सरकार निम्नलिखित व्यक्तियों को जांच करने में एसेसर के रूप में नियुक्त करती है, अर्थात् :-

- (i) श्री अख्तर जावेद उस्मानी, हिन्द मजदूर सभा का प्रतिनिधि;
- (ii) श्री गविन्द्र शर्मा, पूर्व मुख्य खान निरीक्षक और डी. जी. एस. एस।

[फा. सं. एन-11012/3/2016-आईएसएच. II]

कल्पना राजसिंहोत, संयुक्त सचिव



75

MINISTRY OF LABOUR AND EMPLOYMENT

NOTIFICATION

New Delhi, the 13th August, 2019

S.O. 2927(E).—Whereas an accident has occurred in the Rajmahal Opencast Mines of M/s. Eastern Coal Fields Limited, in District Godda of Jharkhand State on 29<sup>th</sup> December, 2016 causing loss of lives;

And whereas the Hon'ble High Court of Jharkhand at Ranchi in Writ Petition No. 66 of 2017 [Md. Sarfaraj Vs. State of Jharkhand and other], while disposing of the case vide its order dated 5<sup>th</sup> April, 2019 held that "However, scope for a Court of inquiry to examine the causes and circumstances attending the accident is much wider and if any further safety steps or remedial measures are required to be taken, the Court of inquiry can make the recommendation in that regard. In such circumstances, Central Government should consider appointing a Court of inquiry for the purpose aforesaid as contemplated in section 24 of the Mines Act, 1952";

And whereas the Central Government is of the opinion that a formal inquiry into the causes and the circumstances attending the accident and to make recommendations, if any, for further safety steps or remedial measures required to be taken, ought to be held;

Now, therefore, in exercise of the powers conferred by sub-section (1) of section 24 of the Mines Act, 1952 (35 of 1952), the Central Government hereby appoints Smt. Rashmi Verma, Former Secretary to the Government of India to hold such inquiry and present a report within a period of three months. The Central Government also appoints the following persons as assessors in holding of the inquiry, namely: —

- (i) Shri Akhter Javed Usmanee, representative of Hind Mazdoor Sabha;
- (ii) Shri Rabindra Sharma, Ex-Chief Inspector of Mines and DGMS.

[F. No. N-11012/3/2016-ISH.II]

KALPANA RAJSINGHOT, Jt. Secy.






12

Bharat Senkar  
Government of India  
Ministry of Labour  
Khan Suraksha Mahanideshalaya  
Directorate-General of Mines Safety  
84/03/26/006 Sitarampur Region No. IV.

ANNEXURE-3

76

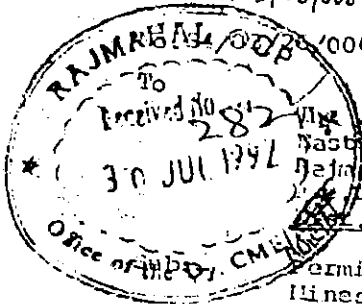

006/II-B/87/ 1/82 /Sitarampur, the 8th April '87.

Agent,  
Eastern Coal fields Ltd.,  
Rajmahal Opencast Project,  
Lalmatia Colliery,  
Gadda, Bihar.

Permission under Regulation 98(1) & 98(3) of Coal Mines Regulations 1957 for working the quarry with deep-hole blasting and heavy earth moving machineries and also under Regulation 100(1) of Coal Mines Regulations 1957 for extraction of pillars in No. II Seam Bottom (Top Section) by Opencast Method in Rajmahal Opencast Project.

Dear Sir,

Please refer to your letter No. EEL/RML/AG-NT/OCT/31(3)140 dated 9.8.96 and letter No. EEL/RML/AG-NT/OCT:31(3)/964 dated 6.2.87 and Plan No. ALL/RML/CGI/P/DRG No. 89 dated 7.2.87 and No. EEL/RML/AGI/DRG No. 99 dated 7.2.87 enclosed therewith on the above subject.

The matter has been considered in light of what has been stated in your application under reference and also on the accompanying plan. By virtue of the powers conferred on me under Regulations-98(1) and 100(1) of the Coal Mines Regulations, 1957 and powers conferred on the Chief Inspector of Mines (now designated as Director-General of Mines Safety) under Regulation 98(3) of the Coal Mines Regulations 1957 and by virtue of the authorisation granted to me by the Chief Inspector of Mines (now designated as Director-General of Mines Safety) under Section 6(1) of the Mines Act, 1952, I hereby permit you to extract standing pillars in No. II seam bottom (top section) under Regulation 100(1) and grant you relaxation for using heavy earth moving machineries under Regulation 98(1) & 98(3) of the Coal Mines Regulations 1957, in respect of height and width of benches in overburden subject to the following conditions :-

- hL 31(3)
- 1.0 All the conditions as given in the enclosed annexure shall be strictly followed.
  - ✓ 2.0 No heavy earth moving machinery shall be permitted to ply over the benches unless the parting is more than 5m above the developed workings of No. II seam bottom (top section). Whenever the parting is less than 5m, gallery shall be solidly packed by blasting and consolidated by dozing.
  - ✓ 3.0 No person shall work over the benches unless there is a solid parting of 5m above the developed workings of No. II seam (Top Section). Whenever the parting is less than 5m the galleries and junctions shall be solidly packed by blasting and the strata is consolidated by dozing. The position of galleries and junctions shall be shown over the surface and also showing the above shall be given to the Agent and Assistant Managers for strict compliance.

4.0 The water level in the developed workings of No. II seam bottom (top section) and the roof of No. II seam top

(Contd. ....)

( 2 )

shall be kept 60m away from the edge of the benches.

✓ 5.0 The opencast workings shall not be extended within 45m of the Simra-Banjore P.W.D. road.

✓ 6.0 When houses, dwellings and other structures are situated within the danger zone and the quarry, precautions stipulated under Regulation 170(1A) and 170(1B) of Coal Mines Regulations 1957 shall be strictly complied with during blasting unless otherwise exempted in writing.

✓ 7.0 The conditions of D.G.M.S. Technical Circulars No. 11 of 1979, 3 of 1980, 4 of 1980, 3 of 1981 and 4 of 1983 shall be strictly complied with.

✓ 8.0 Except where otherwise provided for the condition given in the enclosed annexure, all provisions of the Coal Mines Regulations 1957, relating to the opencast workings, use of explosives and machinery shall be strictly complied with.

9.0 This conditional permission is subject to the amendment or withdrawal at any time.

10.0 If at any time any one of the conditions subject to which this permission has been granted is violated or not complied with, this permission shall be deemed to have been revoked with immediate effect.

Yours faithfully,

*For Director*

( S. K. Saranta )

By Director of Mines Safety,  
Sitarampur Region-IV.

78

Instructions for relaxation under Regulation 98 of the Coal Mines Regulations 1957 for working the opencast mine with Heavy Earth Moving Machinery and/or adopting a system of Deep Hole Blasting at Mechanised Opencast Project.

Rajmahal Opencast Colliery. (E.C.L.)

I. GENERAL

1.0.1 Except where otherwise provided for in this conditional permission, all provisions of the Coal Mines Regulations 1957, relating to opencast workings, use of explosives and machinery etc. shall be strictly complied with.

1.0.2 It may be amended, modified or withdrawn at any time should it be considered necessary in the interest of Safety.

II. OPENCAST WORKING

2.0 Height & width of Benches :-

2.1 The height of the benches in overburden and coal shall not be more than the digging height of the machine used for digging, excavation or removal.

2.2 The width of any bench shall not be less than :-

2.2.1 The width of the widest machine plying on the bench plus two metres, or

2.2.2 If dumpers ply on the bench, three times the width of the dumpers, or

2.2.3 The height of the bench, whichever is more.

3.0 GENERAL

3.1 Quarrying operations shall be conducted from top to downwards.

3.2 The provisions of Sub-Regulations (4) and (5) of the Regulations 98 shall be complied with.

3.3 When persons are employed within 5m of the working face, adequate precautions shall be taken to ensure their safety by dressing the sides of the benches.

3.4 Special care shall be taken when any slip or other planes of weakness or other geological disturbances exist, so as to prevent danger to the work-persons.

3.5 No persons shall be engaged or work or allowed to travel close to high sides/benches, from which he will be likely to fall more than 1.0m vertically down, unless he is provided with and uses a safety belt or rope.

3.6 The sides in overburden & coal shall be kept sloped to prevent danger from fall of sides.

(Contd. .... 2/-)

73

-- 2 --

#### 4.0 Fencing around opencast workings :

4.1 The top edge of the opencast working shall be kept fenced with wire rope strands or barbed wire, supported by (movable) posts of timber, iron or concrete. The gap between the adjacent rope strands or wires shall not be more than 0.30m. Bottom most rope, strand or wire shall not be more than 0.25m and the top most rope, strand or wire shall not be less than 1.0m from the ground level.

4.2 At the finishing stage, opencast workings shall be fenced with a masonry wall using lime mortar not less than 0.40m thick and not less than 1.2m high, with a parapet top.

#### 5.0 Spoil Banks :

5.1.1 The slope of a spoil bank face shall be determined by the natural angle of repose of the material being deposited, but shall in no case exceed 37 $\frac{1}{2}$  degrees from the horizontal. The spoil-bank face shall not be rectified by artificial means at an angle in excess of its natural angle of repose.

5.1.2 Any spoil-bank exceeding 30m in height shall be benched so that no bench exceeds 30m in height and the general slope does not exceed 1 vertical to 1.5 horizontal.

5.2.1 The top of a spoil-bank face shall not be permitted to approach a railway or other public works, public road or building or other permanent structure not belonging to the owner of the mine closer than a distance equal to the vertical height of its face.

5.2.2 A suitable fence shall be erected between any railway or public works or road or building or structure and the top of an active spoil-bank so as to prevent unauthorised persons from approaching the spoil-bank.

5.3 No person shall or shall be permitted to approach the top of an active spoil-bank where he may be endangered from material rolling down the face.

#### 6.0 Roads for trucks and dumpers etc.

6.1 All roads for trucks, dumpers or other mobile machinery shall be maintained in good condition.

6.2 Where practicable, all roads from the opencast working shall be arranged to provide one way traffic. Where this is not practicable, no road shall be of a width less than three times the width of the largest vehicle plying on the road unless, definite turnouts and waiting points are designed.

6.3 All corners and bends in roads shall be made in such a way that the operators and drivers of vehicles have a clear view for a distance of not less than 30m, along the road.

Wherever it is not possible to ensure a visibility of a distance of 30m, there shall be provided two roads for the up and down traffic.

( Contd..... )

6.4  
1 in  
street  
6.5  
area  
mark  
dett  
7.0

be  
cr  
re  
ve

0

2)

6.4 Ordinarily, no road shall have a gradient steeper than 1 in 15 at any place provided that in case of lanes over small stretches a gradient upto 1 in 10 may be permitted.

6.5 Where any road exists above the level of the surrounding area, it shall be provided with strong parapet walls or embankments not less than 1m in height to prevent any vehicle from getting off the road.

7.0 Precautions against dust :

Adequate arrangements, to ally dry dust by wetting shall be made if, during any operation of drilling, loading, unloading crushing, dressing etc. dust is likely to be produced in such quantity as may be injurious to health of persons, as also, on roads and benches where trucks and dumpers operate. The directives contained in D.G's Tech.Circular No.16 of 1975 should be complied with.

8.0 General Lighting :

Where natural lighting is insufficient, adequate general lighting as per the standards laid down in Notification No.GSR. 204 dated 10.6.75 published in the Gazette of India dated 20.6.75, Part III Section 3(1) (reproduced in D.G's Legislation Circular No.1 of 1976), issued under Regulation 154(2) shall be provided during working hours, in the opencast workings and along roads, etc. For inspection of the high sides and benches of the opencast workings at night, suitable search lights shall be provided. The individual workers should also be provided with electric cap lamps to be used when they have to go in poorly illuminated places.

9.0 Supervision :

9.1 During every production shift the opencast workings shall be placed under the charge of atleast an Assistant Manager and during maintenance shift the workings shall be placed under the charge of an overman, who shall be responsible to see that all the regulations and the orders made thereunder are strictly complied with.

9.2 He shall in particular -

9.2.1 make frequent inspections for evidence of slides or of material that may slide or roll from the high walls (including the face and sides) or spoil banks.

9.2.2 not allow any person to work under overhanging ledges or where there is evidence of slides, until such danger has been removed.

9.2.3 ensure that every person engaged in dressing operations, on high walls is provided with, and uses, a safety belt of a type approved by the Chief Inspector of Mines.

9.2.4 ensure that all loose material is removed from high walls before drillers are engaged there, and

9.2.5 ensure that parapet walls along truck-roads are properly maintained.

(Contd.....4/-)

(81)

10.0 Protective equipment :

Every person working in the underground shall be provided with and shall use, protective footwears and hard hat of a type approved by the Chief Inspector of Mines, and such other protective equipment as may be prescribed by the Regional Inspector or the Chief Inspector in accordance with the provisions of Regulations 191, 191A and 191B respectively.

11.0 Precautions while drilling :

11.1 The position of every deep hole to be drilled shall be distinctly marked by the overman so as to be readily seen by the drillers.

11.2.1 No drilling shall be commenced in an area where shots have been fired, until the shotfirer has made a thorough examination at all places, including remaining butts of old deep holes, for unexploded charges that the drill may strike.

11.2.2 No drill or bore rod or pick shall be inserted in butts of old deep holes even if an examination under clause 11.2.1 has failed to reveal presence of explosives.

12.0 Bulk transport of explosives :

Where explosives are transported in bulk for deep hole blasting the precautions laid down in Regulation 154(4) of the Coal Mines Regulations (Amendment) 1971 (vide Notification No. GSR. 568 dated 17.4.71) shall be strictly complied with.

13.0 Precautions during shot-firing :

13.1.1 Shots shall not be fired except during the hours of day light or until adequate artificial light is provided. All holes charged on any one day shall be fired on the same day.

13.1.2 Shots if fired beyond day light hours should be muffled so that, flying fragments from blasting cannot project beyond a distance of 10m from the place of firing. In this connection directives of D.G.(TECH) Circular No. 9 of 1975 should be complied with.

13.1.3 As far as practicable the shotfiring shall be carried out either between shifts or during the rest interval, or at the end of work for the day.

13.2 During the approach and progress of an electric storm, the following precautions shall be taken :-

13.2.1 No explosive, particularly detonators shall be handled.

13.2.2 If charging operations have begun, the work shall be discontinued until the storm has passed.

13.2.3 If the blast is to be fired electrically, all exposed wires shall be coiled up and if possible placed in the mouth of the holes, or kept covered by something other than a metal plate.

82

13.2.4 All wires shall be removed from contact with the steel rails of a haulage track in order to prevent the charge being exploded prematurely by a local strike of the lightning.

13.3.1 Precautions with regards to taking shelter etc. as laid down in Regulation 170 of C.M.R. (Third Amendment) Regulations 1974 (vide Notification No. G.S.R. 1992 dated 20.9.74) shall be complied with.

13.3.2 Notwithstanding ~~that~~ what is contained in Coal Mines Regulations 170 no person other than shot-firers and his assistants, if any, shall be permitted to remain within a radius of 20m or within 60m on the same bench where charging of holes with explosives is being carried out.

13.4 Notwithstanding anything contained in the Coal Mines Regulations 1957 the preparation of charges and charging and stemming of the holes shall be carried out under the personal supervision of an overman who shall fire the shots in deep holes himself.

#### 14.0 Design, maintenance and operation of machinery and vehicles :

14.1 Every piece of drilling and earth moving machinery or equipment (hereinafter called machine) and every truck, dumpers etc. (hereinafter called vehicle) shall be maintained in good and safe working condition.

14.2.1 Every machinery or vehicle shall be provided with efficient warning devices, adequate front & rear lights and efficient brakes.

14.2.2 Every shovel or dragline shall be so designed as to afford the operator clear and uninterrupted vision all around and shall be provided with portable lamp for emergency, suitable portable fire extinguishers and retracting ladder.

14.3.1 Provision of Regulation 196 shall be complied with -

14.3.2 The code of instructions furnished by the manufacturers in the matter of maintenance of various machinery and vehicle and preventive maintenance schedules for each type of machinery and vehicle shall be strictly followed.

14.3.3 Every machine and vehicle shall ~~not~~ be allocated at least one day in every week for maintenance. Before the machine or vehicle is sent out for work after maintenance, it shall be thoroughly inspected by the Engineer, Mechanical Foreman or other competent person appointed by the Manager in writing who shall satisfy himself that the machine or vehicle is mechanically sound and in efficient working order.

14.3.4 A report of every inspection made under clause 14.3.3 shall be recorded in a bound page book kept for the purpose, and shall be signed & dated by the person making the inspection.

14.3.5 Every machine in use shall be thoroughly inspected once at least in every 24 hours by a competent person. Any damaged or worn out cable shall be replaced immediately.

(Contd....6/1)

(23)

-: 6 :

14.3.6 A report of every inspection made under clause 14.3.5 shall be recorded in a bound page book kept for the purpose and shall be signed and dated by person making the inspection.

14.4 If the Engineer, Mechanical Foreman or other competent person making an inspection notices any defect in any machinery or vehicle, the said machinery or vehicle shall not be used until the defect has been remedied.

14.5 Any defect in a machinery or vehicle reported by its operator shall be properly attended to.

14.6 Any machine or vehicle found to be in an unsafe operating condition shall be tagged at the operator's position "OUT OF SERVICE DO NOT USE" and its use shall be prohibited until the unsafe condition has been corrected.

14.7 Any repairs to a machinery or vehicle shall be done at location which will provide a safe place for the persons engaged in repairs.

14.8 Except for testing trial or adjustment which must necessarily be done while the machine or vehicle is in motion, every machine or vehicle shall be shut down and positive means taken to prevent its operation while any repair or manual lubrication is being done.

14.9 Any machinery, equipment or part thereof which is suspended or held apart by use of slings, hoists or jacks shall be substantially blocked or cribbed before men are permitted to work underneath or between such machinery, equipments or part thereof.

14.10 Power shall be disconnected when repairs are made.

14.11 Daily examination of machinery and vehicle :

14.11.1 At the commencement of every shift, the engineer, mechanical foreman or other authorised competent person shall personally inspect and test every machine and vehicle paying special attention to the following details :-

- i) If the brakes and the horn or other warning devices are in working order.
- ii) If the vehicle or machine is required to work after day-light hours, that the lights are in working order.

He shall not permit the vehicle or machine to be taken out for work nor shall he drive the vehicle unless he is satisfied that it is mechanically sound and in efficient working order.

14.11.2 He shall also maintain a record of every inspection in a bound page book kept for the purpose. Every entry in the book shall be signed and dated by the person making the inspection.

(Cont).



## Operation of Machinery :

15.0 No person other than the operator or his helper if any the manager or any person so authorised in writing by the manager shall ride on a shovel (or dragline).

15.1.2 No person shall be permitted to ride in the bucket of a shovel.

15.1.3 No shovel (or dragline) shall be operated in a position where any part of the machine, suspended roads or lines are brought closer than 3m to exposed high voltage lines, unless the current has been cut off and the line de-energized.

A notice of this requirement shall be posted at the operator's position.

15.1.4 Electrical cables, if any, shall be laid in such a manner that they are not endangered either by falling rocks or a mobile equipment.

15.2 The shovel bucket shall be pulled out of the bank as soon as it is full.

15.3 When not in operation the buckets shall be kept resting on stable ground and shall not be left hanging.

15.4 When being operated in soft or unstable ground every shovel (and dragline) shall be supported by heavy planks or poles so as to distribute the load of the machine over larger area and to prevent any danger of the shovel (or dragline) over-turning.

When not in use, the shovel or dragline shall be moved to and stored on stable ground.

15.5 If more than one stripping machine is in use in any area, either on the same bench or on different benches the machines shall be so spaced that there is no danger of accident from flying or falling objects etc. from one machine to the other.

## Duties of Machinery Operators :

16.1.1 Every shovel (and dragline) shall be under the charge of a competent person authorised in writing by the manager herein called the 'Operator'.

16.1.2 At the commencement of every shift, the operator shall also personally inspect and test the machine, paying special attention to the following details :-

i) That brakes and every warning device are in working order, and

ii) if the machine is required to work after day-light hours, that lights are in working order.

He shall not take out the machine for work nor shall he work the machine unless he is satisfied that it is mechanically sound and in efficient working order.

(Contd.....8/-)

85

16.2.1 The operator shall not operate the machine when persons are in such proximity as to be endangered.

16.2.2 He shall not swing the bucket of a shovel over passing haulage units. While trucks/dumpers are being loaded, he shall swing over the body of the truck/dumper and not over the cab, unless the cab is protected by a substantially strong cover.

16.3 The operator shall not allow any unauthorised person to ride on the machine.

17.0 Operator of trucks, dumpers and other vehicles :

17.1 No person shall be permitted to ride on the running board of a truck or dumper.

17.2.1 As far as possible loaded trucks or dumpers shall not be reversed on gradient.

17.2.2 Sufficient stop blocks shall be provided at every tipping point and these shall be used on every occasion material is dumped from the truck/dumper or other such vehicle.

17.2.3 Standard traffic rules shall be adopted and followed during movement of all trucks and dumpers. They shall be prominently displayed at the relevant places in the opencast workings and truck/dumper roads.

17.3 When not in use every truck or dumper shall be moved to and stood on proper parking places.

17.4 No person shall be permitted to work on the chassis of a truck or dumper with the body in a raised position until after the truck or dumper body has been securely blocked in position. The mechanical hoist mechanism alone shall not be depended upon to hold the body of truck or dumper in raised position.

17.5 No unauthorised person shall be permitted to enter or remain in any dumping yard or turning points.

18.0 Duties of Truck/Dumper Operators :

18.1 Before commencing work, the driver shall generally inspect and test the vehicle for its road-worthiness paying special attention to the tyre air-pressure, brakes, horns and lights. If he finds any defect which is likely to make the driving unsafe he shall report the matter to the competent person and shall not operate the vehicle till the defects are remedied.

18.2.1 He shall not drive too fast, shall avoid distractions and shall drive defensively. He shall not attempt to overtake another vehicle unless he can see clearly far enough ahead to be sure that he can pass it safely. He shall also sound the audible warning signal before overtaking.

18.2.2 When approaching a striking equipment the driver of the truck or dumper shall sound the audible warning signal and shall not attempt to pass the striking equipment until he has received a proper audible signal in reply.

(Contd....9/-)

86

18.2.3 Before crossing a road or railway line he shall reduce his speed, look in both directions along the road or line and shall proceed across the road or line only if it is safe to do so.

18.2.4 The driver shall sound the audible warning signal while approaching blind corners or any other points from where persons may walk in front unexpectedly.

18.2.5 The driver shall not operate the truck or dumper in reverse unless he has a clear view of the area behind the vehicle and/or he has the assistance of a 'brake' or 'pitman' duly authorised in writing for the purpose by the manager. He shall also give an audible warning signal before reversing a truck or dumper.

18.2.6 The driver shall be sure of clearance before driving through tunnels, archways, plant, structures etc.

18.3 The driver shall see that the vehicle is not overloaded and that the material is not loaded in a truck or dumper so as to project horizontally beyond the sides of its body and that any material projecting beyond the front or rear is indicated by a red flag during day and by red light after day-light hours.

18.4 The driver shall not allow any unauthorised persons to ride on the vehicle. He shall also not allow more than the authorised number of persons to ride on the vehicle.

#### 18.0 Protection of workers against Noise & Vibration in the mine environment:

Suitable steps should be taken by all appropriate persons to reduce the exposure of workers on any excessive noise and vibration. In this connection the requirements of D.G.'s Technical Circular No. 18 of 1975 shall be complied with.

24/11/37

Handwritten: 21/11/87  
Dy. Manager, Mines Safety



# ANNEXURE - 4

87



भारत सरकार  
GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय  
MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय  
DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वीअंचल, सीतारामपुर  
EASTERN ZONE, SITARAMPUR



सं० एस 3/010357/II-बी/98(1), (3) & 100(1)/\_\_\_\_ सीतारामपुर, दिनांक जुलाई 2012

प्रेषक,

खान सुरक्षा निदेशक(Director of Mines Safety)

सीतारामपुर क्षेत्र संख्या-III(Sitarampur Region No. III)

पोस्ट : सीतारामपुर, जिला : बर्दमान(Post : Sitarampur, Dist : Burdwan, WB)

सेवा में(To).

अभिकर्ता(The Agent).

राजमहल ओ सी पी (Rajmahal OCP).

मेसर्स : ई सी एल (M/s. E.C.Ltd).

पोस्ट : लालमाटिया(Post : Lalmatia), जिला : गोड्डा(Dist. : Godda).

झारखण्ड(Jharkhand)।

Sub: **Modification in permission letter No. S4/03/26/006/II-B(87)/1182 dated 08.04.1987 granted under Regulation 98(1), 98(3) and 100(1) of the Coal Mines Regulations, 1957 to keep high benches in overburden and coal by using Heavy Earth Moving Machinery for the extraction of developed pillar of coal and removal of overburden by Open Cast Method in Seam II Top of Lalmatia Hill Patch marked by A,B,C,D,E and F in leasehold area of Rajmahal Opencast Project of M/s. Eastern Coalfields Ltd.**

Dear Sir,

Please refer to your letter No.AGENT/RJML/1361 dated 10.11.2011& letter No. AGENT/RJML/1659 dated 03.01.2012 and enclosed plan No. ECL/RJML/OCP/UG Working Plan/11/114 dated 07.11.2011 (corrected on 16.02.2012) on the above subject.

The matter has since been considered in the light of what has been stated in your application under reference and shown on the enclosed plan.

In exercise of the powers conferred upon the Chief Inspector of Mines (also designated as Director-General of Mines Safety) under Regulation 98(1), 98(3) and 100(1) of the Coal Mines Regulations, 1957 and by virtue of the authorization granted to me by the Chief Inspector of Mines (also designated as Director-General of Mines Safety) under Section 6(1) of Mines Act, 1952, I, hereby modify the permission letter No. S4/03/26/006/II-B(87)/1182 dated 08.04.1987 granted under Regulation 98(1), 98(3) and 100(1) of the Coal Mines Regulations, 1957 and permit you to use Heavy Earth Moving Machinery to keep high benches in overburden and coal faces to extract coal pillars in Seam-II Top by opencast method in conjunction with deep hole blasting from Lalmatia patch OCP as marked as "A,B,C,D,E and F" in plan No. ECL/RJML/OCP/UG Working Plan/11/114 dated 07.11.2011 (corrected on 16.02.2012) subject to the following conditions in addition to all conditions stipulated in the original permission mentioned above being strictly complied with :-

Sr. Smt. H. N. Rao  
18/7/12

88

- 1.0 (a) Except where otherwise provided for in this conditional permission/exemption, all provisions of the Coal Mines Regulations, 1957 relating to opencast workings, use of explosive and machineries etc. shall be strictly complied with. This permission is being issued specially under the Regulation mentioned above and without prejudice to any other provisions of law including the provisions contained in the Mines and Minerals (Development and Regulation) Act, 1957 and the Mineral Concession Rules, 1960 which may be or may become applicable at any time.
- (b) This permission may be amended or withdrawn at any time, if considered necessary in the interest of safety and/ or conservation of coal.
- (c) If at any time any of the conditions subject to which this permission/exemption has been granted is violated or not complied with, this permission/exemption shall be deemed to have been revoked with immediate effect.
- (d) In the event of any change in the circumstances connected with this permission, which is likely to endanger the life of work person employed in the mine or endanger the mine, the mining operations for which this permission has been granted shall be stopped forthwith and intimation thereof sent to this Directorate. The said mining operations shall not be resumed unless an express and fresh permission in writing is obtained from this Directorate.
- (e) This Directorate shall be informed as soon as the mining operations are commenced in accordance with this permission and intimation about temporary discontinuance or completion of mining operations shall also be sent promptly and in any case not later than one month thereof. After the extraction of the coal, the area shall be back filled by the overburden soil up to the adjacent ground level.
- (f) Management shall indemnify the occupants/owners of the houses/dwellings/buildings or other structures of public authority concerned, if any, against the dangers to those properties or injury to them or other persons arising out of operations conducted under this permission.
- (g) Every person working in the opencast workings, workshops, other surface installations, yards and including contractor's workers shall be provided with and shall use protective footwear and helmets of a type approved by the Chief Inspector and such other protective equipments as may be prescribed from time to time by the Chief Inspector or the Regional Inspector in accordance with the provisions of Regulation 191, 191A and 191B, respectively.
- 2.0 **OPENCAST WORKINGS:**
- 2.1 All the conditions except working area and seams other than seam II Top stipulated in the permission letter bearing issue No. S4/03/26/006/II-B(87)/1182 dated 08.04.1987 under Regulation 98(1), 98(3) and 100(1) of the Coal Mines Regulations, 1957 shall remain unaltered and shall be strictly complied with.
- 2.2 Quarrying operations shall be conducted in seam II Top within the limit line shown as "A, B, C, D, E and F" in plan No. ECL/RJML/OCP/UG Working Plan/11/114 dated 07.11.2011 (corrected on 16.02.2012).
- 2.3 The height of benches in overburden and coal shall not exceed 10m or the digging height of the machine whichever is less at any time.
- 2.4 Unless and otherwise permitted by this Directorate by an order in writing, The width of the bench shall not be less than three times the width of the largest machine working on the bench or the bench height, whichever is more provided that where there is one-way traffic over the bench, the width of bench may be reduced to not less than twice the width of largest machine working on the bench.
- 2.5 No blasting operation shall be done within 300m of any structure in village/Bustees, buildings/surface structures and 45 m of public road in proposed seam II Top of Lalmatia Hill Patch of Rajmahal Opencast Project, M/s. E.C.Ltd without obtaining separate permission under Regulation 170(1A) (b) & (c) and 170(1B)(a).

89

- 2.6 The provisions of sub-regulations (4) & (5) of Regulation, 98 shall be complied with strictly.
- 2.7 OCP working in proposed patch shown as "A, B, C, D, E and F" or, the accompanying plan ~~and no working shall be extended~~ within 15m of the water tanks. The Nallah flowing in west part of the proposed patch from north to south shall be diverted beyond 60m of the proposed quarry and embankment of height not less than 3mts. Above HFL and width not less than 10m at top shall be made to guard the inrush of water towards to proposed patch.
- 2.8 OCP workings in proposed patch shown as "A, B, C, D, E and F" on the accompanying plan shall not be extended within 60m of the underground waterlogged workings of seam II top. The working shall be started from Rise side of the property. An arrangement for pumping from surface by putting boreholes at a distance not more than 30m by making a vertical Boreholes and installation of submersible pumps shall be done to keep water body atleast 60m away from the working of the quarry. A rigorous pumping shall be done to ensure the dewatering and keeping water logged area beyond 60m from the workings made by opencast method.
- 2.9 Special care shall be taken when any slip plane or other weakness or other geological disturbances exist, so as to prevent danger to the work-person.
- 2.10 No person shall be engaged on work or allowed to travel close to high sides/benches, from which he is likely to fall more than 1.8m vertically down unless he is provided with and uses a safety belt or a rope or life-line.
- 2.11 No person other than those required for operating the machinery shall be allowed to remain near the foot of the benches exceeding 3.0m in height. When persons are employed within 5.0m of the bench sides, adequate precautions shall be taken to ensure their safety by dressing or/ and supporting the sides of the benches.
- 2.12 As a final operation, in each cycle of operation, width of the benches may be reduced but in any case not less than 3.0m. During or after this operation no work shall be done at the bottom of the quarry or below such benches, until such time proper benches as required at Para 2.3 & 2.4 are formed by working from top downwards.
- 2.13 After the extraction of the coal, the area shall be back filled by the overburden soil up to the adjacent ground level.
- 2.14 No person shall be employed on coal benches within a radius of 50.0m of the overburden benches being worked with heavy earth moving machineries at any time.
- 3.0 FENCING AROUND OPENCAST WORKINGS:**
- 3.1 The top edge of the opencast working, whether moving, abandoned or otherwise, shall be kept fenced with wire rope strands or barbed wire, supported by (movable) posts of timber, iron or concrete. The gap between the adjacent rope strands or wires shall not be more than 0.30m and the bottom most member shall not be more than 0.25m and the top most member shall not be less than 1.0m from ground level.
- 3.2 At the finishing stage, opencast workings shall be fenced with masonry wall using cement not less than 0.40m thick and not less than 1.5m high, with a parapet top.
- 4.0 SPOIL BANKS AND STOCK YARD/PILES:**
- 4.1 The slope of a spoil bank's face shall be determined by the natural angle of repose of the material being deposited, but shall in no case exceed  $37^{\circ}$  from the horizontal. The spoil bank face shall not be retained by artificial means at an angle in excess of its natural angle of repose or  $37^{\circ}$ .
- 4.2 Any spoil bank exceeding 30m in height shall be benched so that no bench exceeds 30m in height and the general slope does not exceed 1 vertical to 1.5 horizontal.

90

- 4.3 The toe of a spoil bank face shall not be permitted to approach a railway or other public works, public road or building or other permanent structure not belonging to the owner of the mine, closer than a distance equal to the vertical height of its face.
- 4.4 No person shall remain or be permitted to approach the toe of an active spoil bank or stock yard/pile where he may be endangered from the material rolling down the face.
- 4.5 A suitable fence shall be erected between any railway or public works or road or building or structure and the toe of an active spoil bank so as to prevent unauthorized persons from approaching the spoil bank.
- 4.6 Wherever space permits, every mine shall establish a system whereby loading and unloading operations in the stock-yard are not done simultaneously for elimination of risk element in the operations. In case adequate space is not available, mine management shall organise suitable traffic regulation for eliminating risk element in the operations.
- 4.7 Extraction of mineral by reclamation from dump or stock pile/yard shall be treated as working of opencast benches with loose overburden and all the precautions in respect of working of opencast benches with loose overburden shall be taken.
- 4.8 A suitable "Code of Practice" approved by tripartite committee for prevention of injuries to persons engaged in tipping on stock piles, dumping of overburden at dump yards, at loading points etc. shall be framed and enforced.
- 4.9 The above "Code" shall be constantly and prominently displayed at every relevant places including in the open-cast workings, workshops, truck-dumper roads, spoil/coal-heaps, material yards, etc.
- 5.0 **ROADS FOR TRUCKS AND DUMPERS ETC.:**
- 5.1 The portion of surface haul road in mine premises where there is heavy traffic of persons and the machines/vehicles, there shall be provided a separate lane, properly fenced off from haul road for pedestrians and two wheelers.
- 5.2 All roads for trucks, dumpers or other mobile machinery shall be maintained in good condition.
- 5.3 Where practicable, all roads from the opencast workings shall be arranged to provide one-way traffic. Where this is not practicable, no road shall be of a width less than three times the width of the largest vehicle plying on that road unless, definite turn-outs and waiting points are designated.
- 5.4 All corners and bends in roads shall be made in such a way that the operators and drivers of vehicles have a clear view for a distance of not less than 60m along the road. Wherever it is not possible to ensure a visibility for a distance of 60m, there shall be provided separate roads for the up and down traffic.
- 5.5 Ordinarily, no road shall have a gradient steeper than 1 in 16 at any place. Provided that in case of ramps over small stretches a gradient upto 1 to 10 may be permitted.
- 5.6 Where any road exists above the level of surrounding area, it shall be provided with strong parapet wall or embankment of such width and not less than 1.8m in height to prevent any vehicle/machine from getting off the road.
- 5.7 A suitable "Code of Traffic Rule" approved by tripartite safety committee for regulating movement of heavy earth moving machinery (commensurate with the capacity/size type of machine used in the mechanized opencast mine) shall be framed and enforced.
- 5.8 The above "Code" shall be constantly and prominently displayed at every relevant place including in the open-cast workings, workshops, truck-dumper roads, spoil/coal-heaps, material yards, etc.



91

**6.0 PRECAUTIONS AGAINST DUST:**

Adequate arrangements to allay dry dust by wetting shall be made if during any operation of drilling, loading, unloading, crushing, dressing etc., dust is likely to be produced in such quantity (not more than 3mg/cu.m.) as may be injurious to the health of persons, as also on roads and benches where trucks and dumpers operate. Dust surveys shall be done as per the procedure laid down in Regulation 123.

**7.0 GENERAL LIGHTING:**

Where natural lighting is insufficient, adequate general lighting as per the standards laid down in notification No.G.S.R.804 dated 18.06.1975, published in the Gazette of India, dated 28.06.1975 Part - III section 3(1) (reproduced in D.G.M.S Legislation Circular No.1 of 1976) issued under Regulation 154(2) shall be provided during working hours. In the opencast workings along roads, etc., for proper inspection of the high sides and benches of the opencast at night, suitable search-lights shall be provided. Individual workers should also be provided with electric cap lamps to be of use when they have to go in poorly illuminated places.

**8.0 SUPERVISION:**

8.1 During every production shift, the opencast workings shall be placed under the charge of an Assistant Manager or Under-Manager and during maintenance shift also the workings shall be placed under the charge of an Asstt. Manager, who shall be responsible to see that all the Regulations and the orders made there under are strictly complied with.

8.2 The In-charge/ supervisor shall in particular

- a) Make frequent inspections for evidence of slides or of material that may slide or roll from the high walls (including the face and sides) or spoil bank.
- b) Not allow any person to work under overhanging ledges or where there is evidence of slides, until such danger has been removed.
- c) Ensure that every person engaged in dressing operations on high-wall is provided with and uses a safety belt of a type approved by the Chief Inspector.
- d) Ensure that all loose materials is removed from high-wall before drillers are engaged; and
- e) Ensure that parapet walls along haul roads are properly maintained.

**9.0 Following precautions shall be taken for extraction of developed pillars by Opencast method.**

9.1 No person shall walk over the benches unless there is a solid parting of 3.0m above the developed workings in any seam under extraction. The thickness of the parting shall be proved by drilling advance down-ward boreholes. Whenever the parting is less than 3.0m, the galleries and junctions of the underground workings shall be solidly packed by blasting and the strata shall be consolidated by dozing. The position of galleries and junctions of the underground workings shall be marked over the surface and plan showing the above shall be given to Asstt. Managers, Engineers and supervisory officials for strict compliance.

9.2 Removal of overburden by using Heavy Earth Moving Machineries and deep-hole blasting shall be done strictly in accordance with the Schedule of conditions appended therewith.

9.3 No heavy machinery or vehicles including the drilling machines shall be deployed unless the thickness of overburden above the underground galleries is more than 6.0m.

9.4 When the thickness of overburden above galleries of underground workings of any seam reduces to 6.0m, the position of the galleries shall be correctly marked on the ground and overburden over the same shall be blasted down and gallery shall be solidly packed and consolidated by dozing.

9.5 Each coal pillar shall be exposed completely by removing the overburden overlying the pillars and the adjoining galleries on all sides.

9.6 **DRILLING** : Precautions while drilling

- I. The position of every deep-hole to be drilled shall be distinctly marked by the blasting overman so as to be readily seen by the drillers.
- II. No drilling shall be commenced in an area where shots have been fired, until the shot-firer has made a thorough examination at all places, including remaining butts of old deep-holes for un-exploded charge, that the drill may strike.
- III. No drill or rod or pick shall be inserted in butts of old deep-holes even if an examination under Reg. 176 has failed to reveal presence of explosives.
- IV. Drilling and charging of deep-holes shall not be carried out in the same area at the same time.
- V. Holes shall be drilled slightly off vertical (about  $10^\circ$ ) and slanted towards the near vertical face. However, in the coal pillars, they shall be vertical.
- VI. Drilling operations shall not be carried on simultaneously at two benches, which are directly one above the other.

9.7 Following precautions against dangers of coal dust explosion, while extracting pillars by opencast method shall be strictly complied with:

- i. **Survey, cleaning and dusting:** Where the underground workings are accessible, the same shall be surveyed and cleaned off all coal dust, and thickly stone dusted before commencement of extraction of pillars.
- ii. **Withdrawal:** All persons from underground in every seam connected to the pillars being extracted by opencast method shall be withdrawn before commencement of blasting operations in the quarry, irrespective of the distance. No person shall be re-admitted into the said underground workings unless and until the same have been inspected by a under manager, duly authorised for this purpose by the manager and found to be free from any noxious gases and signs of fire, etc.
- iii. **Location of holes:** The spacing of holes in the bench lying immediately above the coal seam (referred to herein after as last OB bench) shall be so adjusted that the holes do not lie immediately above the galleries as far as possible in order to ensure that the blast holes do not directly fire into underground workings.
- iv. **Safe parting:** The depth of holes in the last OB bench shall be such as to leave atleast 3.0m thickness of OB above the coal seam and to ensure compliance with this requirement, a pilot hole shall be put for each round of blasting to determine the total thickness of OB over the coal seam.
- v. **Filling sand in holes:** Where there is any doubt and particularly where there are cracks and crevices the bottom 2m, length of hole shall be filled with sand.
- vi. **Delay detonators not to be used:** Unless otherwise permitted by DGM in writing and subject to such conditions as may be imposed, no delay action detonators shall be used in coal and the manner of extraction of pillars shall be by drilling and blasting holes in coal pillars only from top downwards.
- vii. **Workings developed in more than one section:** Where more than one section of the seam had been developed on pillars, the shot holes shall not be drilled to within 3m of a lower section, and care shall be taken that, as far as possible, the blast holes do not directly fire into any underground gallery.
- viii. **Use of water ampoules/moist sand:** All holes in the overburden bench shall be charged with water ampoules or with moist sand of at least 0.6m in length at the bottom of the hole.

- ix. **Shelter:** No person including shot-firer shall take shelter except in a zone beyond 100m of the quarry workings and such shelter shall be adequate to protect him from flying fragments.
- 9.8 The following procedures is recommended for treating the inaccessible workings underground with stonedust before extraction of developed pillars through Opencast method as enumerated in the DGMS (Tech.) Circular no.4 of 1983.
- 9.8.1 Ahead of the bottom bench in overburden, holes should be drilled 18mts apart in grid-pattern from top bench in overburden or surface to the underground galleries. The distance between the 1<sup>st</sup> row of holes and quarry face should be 6mts or less.
- 9.8.2 After holing through of the galleries in coal, the drill rod should be withdrawn and at least 2 tonnes of stone dust fed through the boreholes.
- 9.8.3 The drill rod should then be lowered through the borehole again so that it is well in the heap of stone dust dropped on the floor of the underground galleries.
- 9.8.4 Compressed air should then be blown at the rate of not less than 20cu.m per minute under pressure of at least 3.5kg cm<sup>2</sup> for a minimum 45 minutes. This time can be proportionately reduced if compressed air at higher pressure is available.
- 9.8.5 The steps 9.5.2, 9.5.3 and 9.5.4 shall be repeated with 2 tonnes or more of stone dust dropped in each hole.
- 9.8.6 If perimeter of galleries exceeds 14m, the quantity of stone dust dispersed should be proportionately increased by repeating the whole process a second time.
- 9.8.7 For greater effectiveness, the holes should be drilled in the junctions of the galleries as far as practicable.
- 9.8.8 For better dispersability, it is desirable to use pure limestone dust or dolomite dust with least possible silica content. The stone dust should preferably be water-proofed in humid and wet conditions.
- 10.0 **PRECAUTIONS DURING SHOT- FIRING :**
- 10.1 All lumpy sized rock/coäl shall be thoroughly removed from the site of blasting before charging the holes.
- 10.2 Only non-electric type shock tube detonators shall be used in the holes and surface trunk lines;
- 10.3 Moist sand/rock dust shall be used as stemming material and tamped hard by suitable stemming rod.
- 10.4 All ultra safe or similar type of blasting circuit tester shall be provided to shot-firing personnel for testing the continuity and resistance of detonators and of the blasting circuit.
- 10.5 The code of blasting signals approved by the Manager of the mine shall be strictly followed.
- 10.6 The Colliery Manager of Rajmahal OCP shall from time to time satisfy himself that all the above recommendations are strictly followed and the Asst. Colliery Manager responsible for blasting shall maintain detail record of every blasting on the pattern indicated and shall countersign every such report.
- 10.7 Explosives shall be delivered first to the hole furthest from the priming station, so as to avoid persons walking among piles of explosives and charged holes.
- 10.8 Not more than one hole shall be charged at any one face at any one time.
- 10.9 All charging, stemming and connecting-up shall be done while standing on solid, that is to say, on the side of holes away from the quarry face.

94

- 10.10 Burden and spacing shall be suitably adjusted to ensure proper fragmentation, effective utilisation of explosive energy and also such that throw of debris/coal do not exceed 10.0m.
- 10.11 Blasting parameters i.e. spacing, burden of holes, Charge/delay and charge/round shall be designed by the manager such a way so that PPV of induced blasting shall not exceed 10mm/sec. Blasting shall be done under the supervision of a person holding Overman's/manager's certificate of competency.
- 10.12 Shots shall not be fired except during the hours of day-light or until adequate artificial lighting is provided. All holes charged on any one day shall be fired on the same day.
- 10.13 Conditions as laid down in this Directorate's Tech. Circular No. 2 of 1985 regarding precautions to be taken, while blasting in fire area, if any, shall be strictly complied with.
- 10.14 As far as practicable shot-firing shall be carried out either between shifts or during the rest interval or at the end of work for the day.
- 10.15 A distance of 300m hereinafter referred to as " Danger Zone " in any direction, from the place of firing shall be distinctly demarcated by means of red flags properly arranged and supported at least 30 minutes before firing of holes is to commence.
- 10.16 Precautions against surface structure: Permission under Reg.170(1A) & (1B) shall be obtained if the blasting is done within danger zone where there exist any public structure.
- 10.17 Ten minutes before firing, a siren installed for the purpose, shall be blown three times for one minute each, at an intervals of one minute and no shot shall be fired unless the blasting overman with the assistance of sufficient number of persons appointed in writing by the manager for the purpose, has ensured that all persons have left the danger zone or had taken adequate shelter.
- 10.18 Length of stemming column at the mouth of blast-hole shall be more than the burden in the round.
- 10.19 Precautions with regards to taking shelter etc. as laid down in Regulation 170 of the Coal Mines Regulation, 1957 shall be complied with to ensure that there is no danger of life and property (whether or not belonging to the owner) due to this operation.
- 10.20 Notwithstanding what is contained in Regulation, 170, no person other than shot-firer and his assistants, if any, shall be permitted to remain within a radius of 20m in general or within 60m on the same bench while charging of holes with explosives is being carried out.
- 10.21 Triangular pattern of hole placement shall be done to ensure better fragmentation and effective utilisation of energy of blast.
- 10.22 During the approach and progress of an electric storm, the following precautions shall be taken.
- 10.23 (a) No explosive, particularly detonators shall be handled.  
(b) If charging operations have begun, the work shall be discontinued until the storm has passed.  
(c) If the blast is to be fired electrically, all exposed wires shall be coiled up and if possible, placed in the mouth of the holes or kept covered by something other than a metal plate.  
(d) All wires shall be removed from contact with the steel rails of a haulage tracks so as to prevent charge being exploded prematurely by a local strike of the lightning.  
(e) No mobile phone shall be used by the person engaged in charging & blasing operation.

- 10.24 Notwithstanding anything contained in the Coal Mines Regulations, 1957, the preparation of charges and the charging and stemming of holes shall be carried out under the personal supervision of an overman who shall fire the shots himself, in respect of deep-holes.
- 11.0 **MACHINERY:**
- 11.1 **DESIGN, MAINTENANCE AND USE OF MACHINES, MACHINERY AND VEHICLES:**
- (a) Every part of drilling and earth moving machinery or equipment (herein after called machine, which includes dragline) and every truck, dumper, etc. (herein after called vehicle) shall be maintained in good and safe working condition.
  - (b) Every machinery or vehicle shall be provided with efficient warning devices, adequate front and rear lights and efficient brakes.
  - (c) Every shovel shall be so designed as to afford the operator clear and uninterrupted vision all around and shall be provided with portable lamp for emergency, suitable automatic fire extinguishers and retracting ladder.
  - (d) Every dumper/truck shall be provided with audio-visual warning device such that the device gives automatic warning both audibly and visually while reversing the vehicle.
  - (e) Operator's cabin of every machine or machinery or vehicle shall be well designed and substantially built so as to ensure adequate protection to the operator against heat, dust, noise, etc. and at the same time a seat belt shall be provided for adequate safety to the operator in the event of overturning of heavy earth moving machinery.
- 11.2 (a) Provision of Regulation 186 relating to examination of machinery shall be strictly complied with.
- (b) The code of instructions furnished by the manufacturers in the matter of maintenance of various machinery, machines and vehicles and preventive maintenance schedules for each type of machinery, machine and vehicle shall be strictly followed.
  - (c) Every machine and vehicle shall be allocated at least one day in every week for maintenance. Before the machine or vehicle is sent out for work, after maintenance, it shall be thoroughly examined by the Engineer, Mechanical Foreman or other competent person, appointed by the Manager in writing. He shall satisfy himself that the machine or vehicle is mechanically sound and in efficient working order.
  - (d) A report of every examination made under clause (c) shall be recorded in a bound paged book kept for the purpose and shall be signed and dated by the person making the examination and countersign with date by the engineer.
  - (e) Every machine, machinery or vehicle in use shall be thoroughly examined once at least in every 24 hours by a competent person. Any damage or worn out cable shall be replaced immediately.
- 11.3 If the Engineer, Mechanical foreman or other competent person making an examination notices any defect in any machinery, machine or vehicle the said machinery, machine or vehicle shall not be used until the defect has been remedied.
- 11.4 Any defect in a machine, machinery or vehicle reported by its operator shall be promptly attended to.
- 11.5 Any machine, machinery or vehicle found to be in an unsafe operating condition shall be tagged at the operator's position "out of service, do not use" and its use shall be prohibited until the unsafe condition, has been corrected.

96

- 11.6 All repairs to a machinery or vehicle shall be done at a location, which will provide a safe place for the persons engaged on repairs.
- 11.7 Except for testing, trial or adjustment, which must necessarily be done while the machine, machinery or vehicle is in motion, every machine, machinery or vehicle shall be shut down and positive means taken to prevent its operation/movement while any repair or manual lubrication is being done.
- 11.8 Only such fitters or mechanics, who possess driving licence under Motor Vehicle Act and authorised by the manager for that purpose, shall be allowed to test-run the HEMM.
- 11.9 To prevent unauthorised driving, a system shall be evolved whereby the ignition key or cabin key shall always remain with the driver/operator or with specifically designated competent person(s).
- 11.10 Any machinery, equipment or part thereof which is suspended or held apart by use of slings, chains, hoists or jacks, etc. shall be substantially blocked or cribbed or cogged before men are permitted to work underneath or between such machinery, equipment or part thereof.
- 11.11 Power shall be disconnected when repairs are made to any electric machine or machinery.
- 11.12 The operator or driver shall not leave the machine, machinery or vehicle while it is running unless it is placed under the charge of a competent person.
- 11.13 (a) At the commencement of every shift, the Engineer, Mechanical Foreman or other authorised competent person shall personally examine and test every machine, machinery and vehicle paying special attention to the following details:
  - (i) That the brakes and horn or other warning devices are in working order.
  - (ii) If the vehicle or machine is required to work after day light hours that the lights are in working order.
  - (iii) He shall not permit the vehicle or machine or machinery to be taken out for work nor shall he drive the vehicle unless he is satisfied that it is mechanically sound and in efficient working order.(b) He shall also maintain a record of every examination in a bound paged book kept for the purpose. Every entry in the book shall be signed and dated by the person making the examination and countersigned and dated by the Engineer.
- 11.14 ~~Structural stability~~ of HEMM should be examined periodically by an independent team of experts. Such an examination may invariably be made after every major repair to HEMM.
- 11.15 Tractor-trailer combination shall not be allowed on haul-roads. Where it is inevitable, the trailer shall have separate brake of its own and the use of four wheeled trailer shall be preferred. The operator shall also be suitably trained on right selection of gear while travelling down-hill.
- 11.16 (a) Trucks and other heavy vehicles not belonging to the owner shall not be allowed to run in the mine premises without a valid pass issued by the competent authority appointed by the manager.
  - (b) Before the pass is issued, the engineer or other competent person shall examine the road-worthiness of such vehicle and driving licence of the driver.
  - (c) In order to check unauthorised vehicle in mine premises, properly manned check gate(s) shall be established at entrance(s), where record of examination, entry and exit of the vehicle shall be maintained.

- (d) Small vehicles not belonging to the owner shall not be allowed in the mine premises as far as possible. Where inevitable, they may be allowed with a valid pass issued by the competent authority appointed by the manager and a separate haul-road for them shall be provided and they shall carry on the top of them, a "Red Light" (beyond day light). The Red Flag or Light shall be fixed upto such height from where it is clearly visible to the dumper operator within 30m. (This shall be applicable to the small vehicles belonging to owner also.)
- 11.17 A "code of practice" shall be drawn up for dealing with fires at different locations in open cast mine including heavy earth moving machinery. Arrangement for fighting fire shall be provided on every heavy earth moving machinery. Such arrangement should, if possible, operate automatically on appearance of fire. The above "Code" shall be constantly and prominently displayed at every relevant place including in the open-cast workings, workshops, truck-dumper roads, spoil/coal-heaps, material yards, etc
- 12.0 **OPERATION OF MACHINERY:**
- 12.1 (a) Operators/drivers of each HEMM shall be selected from amongst persons possessing requisite qualifications. The selection process shall comprise a test to check driving/operating skill, aptitude, health and oral examination of the candidate by a competent selection committee.
- (b) No person other than the operator or his helper, if any, or the manager or any person so authorised in writing by the manager, shall ride on a shovel or dumper.
- (c) All operators of HEMM should undergo regular checks to test their driving/operating skill, knowledge and health once every five years.
- 12.2 (a) The operator shall maintain a record of every examination made in a bound pagged book kept for the purpose and shall sign with date every entry made therein.
- (b) The operator shall keep the cab window clean so as to ensure clear vision at all times.
- (c) Walk ways in or about the cab of any shovel shall be kept free of loose tools, grease or oil containers or other materials that might fall or pose a falling or tripping hazard.
- (d) No persons shall be permitted to ride in the bucket of shovel.
- 12.3 (a) No shovel or dumper or truck shall be operated in a position whereby any part of machine or vehicle is suspended or other loads or line are brought closer than as required under Rule 77(3) of Indian Electricity Rules, 1956 to expose high and medium voltage lines, unless the current has been switched off and the line de-energised.
- A notice of this requirement shall be posted at the operator's position.
- (b) Electrical cables, if any, shall be laid in such a manner that they are not endangered either by falling rocks or by a mobile equipments.
- 12.4 The shovel bucket shall be pulled out of the bank as soon as it is full.
- 12.5 When not in operation, the bucket shall be kept resting on stable ground and shall not be left hanging.
- 12.6 When being operated in soft or unstable ground, every shovel/dragline shall be supported by heavy planks or poles so as to distribute the load of the machine over larger area and to prevent any danger of the shovel or dragline over-turning.
- 12.7 When not in use, the shovel shall be moved to stand on stable ground. Before leaving the machine, the operator shall lower the bucket to the ground.

- (58)
- 12.8 If more than one stripping machine is in use in any area, either on the same bench or on different benches, the machines shall be so spaced that there is no danger of accident from flying or falling objects, etc. from one machine to the other or fouling from each other.

**13.0 DUTIES OF DRILL OPERATORS:**

- 13.1 At the beginning of the shift, the drill operator shall examine the drilling equipment and satisfy himself that:

- (a) Crown blocks are mounted securely.
- (b) Where compressed air drills are used, all hose connections are in order.
- (c) The drill equipment is in safe working condition.

- 13.2 The drill operator shall ensure that:

- (a) Persons keep clear of augur and drill stem while the drill is in motion.
- (b) Persons do not work or stand under suspended tools, when tools are removed from the holes, these shall be lowered on the platform.
- (c) All finished drill holes are properly plugged so as to avoid possible leg injuries to any one accidentally stepping into the holes.

**14.0 DUTIES OF MACHINE OR MACHINERY OPERATORS:**

- 14.1 (a) Every shovel shall be under the charge of a competent person authorised in writing by the Manager herein called as "operator".

- (b) At the commencement of every shift, the operator shall also personally examine and test the machine paying special attention to the following details:

- (i) That brakes and every warning devices are in working order, and
- (ii) if the machine is required to work after day light hours that light are in working order.

- (iii) He shall not take out the machine for work nor shall he work the machine unless he is satisfied that it is mechanically sound and in efficient working order.

- 14.2 (a) The operator shall not operate the machine when persons are in such proximity as to be endangered.

- (b) He shall not swing the bucket of the shovel over passing haulage units while trucks/dumpers are being loaded. He shall swing over the body of the truck/dumper and not over the cab, unless the cab, is protected by a substantially strong cover and permitted by the manager for the particular truck/dumper.

- (c) The operator shall not allow any unauthorised person to ride on the machine.

**15.0 OPERATION OF TRUCKS-DUMPERS AND OTHER VEHICLES:**

- 15.1 No person shall be permitted to ride on the running board of a truck/dumper.

- 15.2 (a) As far as possible, trucks/dumpers shall not be reversed on gradient.

- (b) The operator shall ensure that, sufficient stop blocks are provided at every tipping point and those shall be used on every occasion material is dumped from the truck/dumper or such other vehicle.

- (c) The operator shall follow the "Code of Traffic Rules" and other "Codes of Practice" as stipulated by the manager.

- (d) They shall be prominently displayed at the relevant places in the opencast workings and haul-roads.

- 16.0 When not in use every truck or dumper shall be moved to and parked on proper parking places.



99

- 16.1 No person shall be permitted to work on the chassis of a truck/dumper with the body in a raised position until the truck/dumper body has been securely blocked in position. The mechanical hoist mechanism alone shall not be depended upon to hold the body of the truck/dumper in raised position.
- 16.2 No unauthorised person shall be permitted to enter or remain in any dumping yard to turning points.

#### 17.0 DUTIES OF TRUCK/DUMPER OPERATORS:

- 17.1 Before commencing work, the driver shall personally examine and test the vehicle for its road-worthiness paying special attention to the tyre air pressure, brakes, horn, lights, audio-visual alarms and any other safety device provided by the manufacturer or by the management from time to time. If he finds any defect, which is likely to make the driving unsafe, he shall report the matter to the competent person and shall not operate the vehicle till the defects are remedied.
- 17.2 The driver shall record, of every examination made, in a bound paged book kept for the purpose with the engineer or other competent person and shall be signed and dated by him.
- 17.3 (a) He shall not drive too fast, shall avoid distractions, and shall drive defensively. He shall not attempt to overtake another vehicle unless he can see clearly far enough ahead to be sure that he can overtake it safely. He shall also sound the audible warning signal before overtaking.
- (b) When approaching a stripping equipment, the driver of the truck/dumper shall sound the audible warning signal and shall not attempt to pass the stripping equipment until he has received a proper audible warning signal in reply.
- (c) Before crossing a road or railway line, he shall reduce his speed, look in both directions along the road or line and shall proceed across the road or line only if it is safe to do so.
- (e) The driver shall sound the audible warning signal while approaching "blind" corners or any other points from where persons may walk in front unexpectedly.
- (f) The driver shall not operate the truck or dumper (Vehicle) in reverse unless he has a clear view of the area behind the vehicle and /or he has the assistance of a spotter or pit man duly authorised in writing for the purpose by the manager. He shall also give an audible warning signal before reversing a truck/dumper.
- (g) The driver shall be sure of clearance before driving through tunnels, archways, plants, structures etc.
- 17.4 The driver shall see that the vehicle is not overloaded and that material is not loaded so as to project horizontally beyond the sides of its body and that any material projecting beyond the front or rear is indicated by a red flag during day and by red light after day light hours.
- 17.5 The driver shall not allow any unauthorised persons to ride on the vehicle. He shall also not allow more than the authorised number of persons to ride on the vehicle.
- 17.6 The driver shall keep the cab window clean so as to ensure clear vision at all times.
- 17.7 The driver shall use parking brakes for parking the vehicle. He shall also engage the gear-shift lever in reverse while vehicle is on down-gradient or on level roads and low gear position while on up-gradient.
- 17.8 The driver shall handle the truck/dumper carefully and keep it under control at all times. He shall negotiate down-hill gradient in low gear so that minimum braking is required.
- 18.0 Proper protection to the workers against noise and vibration in the working environment shall be provided.

100

19.0 To minimise accidents to those engaged on surface operations, it shall be ensured that:

- a) All persons engaged through the contractors at any work within the mine premises have received relevant training and other job-related briefings. The drivers of vehicle belonging to contractors entering the mine premises shall additionally be explained the salient provisions of "Code of Traffic Rules". Appropriate training schedules for contractor's worker shall be drawn and implemented from time to time.
- b) Each and every operation, including the operation carried out through contractor's workers or by outside agency, is placed under the charge of a competent supervisor, duly appointed and authorised by the manager whose jurisdiction shall be clearly demarcated.

20.0 All the conditions mentioned in Tech. Circular No.9 of 2008 and Circular No. 5 of 2010 shall be strictly complied with.

भवदीय,

ह0

(एस. के. दत्ता)

खान सुरक्षा निदेशक,

पूर्वीअंचल, सीतारामपुर क्षेत्र संख्या 3 ।

ज्ञापन सं0 एस 3/010357/II-बी/98(1), (3) & 100(1)/163-सीतारामपुर, दिनांक 5/7/12

सूचनार्थ एवं-आवश्यक कार्यवाही हेतु-प्रेषित-


1. मनोनीत मालिक/ निदेशक(तकनीकी-ओपी), मेसर्स-ईस्टर्न कोलफील्ड्स लिमिटेड, सांक्तोरिया, पोस्ट : डिसेरगढ़, जिला- बर्धमान ।
2. मुख्य महाप्रबन्धक, राजमहल प्रोजेक्ट, मेसर्स-ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट-लालमाटिया, जिला-गोड्डा, झारखण्ड ।
3. प्रबन्धक, राजमहल ओसीपी, मेसर्स-ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट-लालमाटिया, जिला - गोड्डा, झारखण्ड ।

खान सुरक्षा निदेशक,

पूर्वी अंचल, सीतारामपुर क्षेत्र संख्या 3



ANNEXURE-5

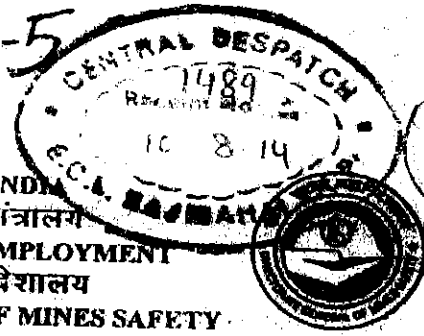

भारत सरकार  
GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय  
MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय  
DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर  
EASTERN ZONE, SITARAMPUR

संख्या एस/010375/II-B/170(1A) & 170(1B)(b)/2014/ 1672- सीतारामपुर, दिनांक 22/7/14

प्रेषक,

खान सुरक्षा निदेशक

खान सुरक्षा महानिदेशालय

सीतारामपुर क्षेत्र संख्या-3, पोस्ट : सीतारामपुर, जिला : बर्हमान।

सेवा मे,

अधिकारी,

राजमहल ओरसीओपी,

मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड,

पोस्ट : लाल गाटिया, जिला : बोझडा, आरखण्ड-814 165

**Sub: Permission under Regulation 170(1A) & 170(1B)(b) of the Coal Mines Regulations, 1957 to conduct controlled deep hole blasting within 300m but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature from the Villages (Lohandia bazaar, Lalghutua, Basdiha, Bhato Tola, Abhi Tola, Mem Tola, Mukhia Tola, Bathan Tola, Dahar Tola, Chota Bhorai, Paharpur etc.) at Opencast workings of Rajmahal OCP of M/s. Eastern Coalfields Ltd.**

Dear Sir,

Please refer to your letters Nos. ECL/RJML/GM (OP)/DGMD12/29 dated 15.04.2014 & GM(OP)/RJML/250 dated 22.06.2014, and plan bearing No. ECL/RJML/OCP/URV/83 dated 19.06.2014 enclosed therewith on the above subject.

The matter has since been examined in the light of the information submitted by you and in the report titled "Report on Controlled Blasting and Assessment of Blast induced ground Vibration at Opencast Workings of Rajmahal OCP" submitted by CMPDIL, Asansol, along with the application.

By virtue of powers conferred on Chief Inspector of Mines (also designated as Director-General of Mines Safety) under the provisions of Regulations 170(1A) & 170(1B)(b) of the Coal Mines Regulations 1957, and by virtue of the authorization granted to me by the Chief Inspector of Mines (also designated as Director-General of Mines Safety) under Section 6(1) of the Mines Act, 1952, I, hereby grant you relaxations from the above mentioned regulations, and permit you to conduct deep hole blasting at Rajmahal OCP of M/s Eastern Coalfields Ltd., within 300metres but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature not belonging to the owner

cc to:-  
Manager, BSC  
ASO  
BSC  
C.O.  
Sd/-  
Sd/-  
Sd/-

(102)

from the villages at Rajmahal OCP, subject to the following conditions being strictly complied with:-

1. All the conditions except working area of OCP stipulated in the permission letter bearing no. S4/03/26/006/II-B/87/1182 dated 08.04.1987 shall remain unaltered.
2. The drilling of holes and deep-hole blasting shall be carried out in close collaboration of experts from Blasting Cell, CMPDI, Asansol, who shall monitor the blast induced ground vibrations at dwellings/other structures not belonging to Rajmahal OCP of M/s Eastern Coalfields Ltd. for every blast.
3.
  - a. Drilling, charging, stemming, and blasting operations connected with this permission shall be placed under overall charge of a person holding First Class Manager's Certificate of competency granted under Coal Mines Regulations-1957, who shall abide by the guidelines and directives issued by the manager.
  - b. Shots shall be charged, stemmed and fired by a person holding at least Second class Manager's Certificate of Competency granted under Coal Mines Regulations-1957, and trained in controlled blasting techniques.
4. No blasting shall be done within 50m of any dwellings/structures of villages at Rajmahal OCP or other structures not belonging to the owner. The restricted zone from the nearest dwelling/structures, not belonging to the owner, shall be clearly demarcated on plans as well as on the ground by conducting actual survey.
5. When blasting is required to be done within 500m of the public road, no blasting shall be carried out unless two persons are posted one each in either direction at the two extreme points of such road which falls within the danger zone or two gates may be provided at the road at two extreme points so that the vehicle or passersby are warned and stopped while passing within danger zone. No working shall be extended within 45m of such road.

6. The parameter to be adopted for controlled deep hole blasting shall be as under:-

Sl. No	Nature of formation	Dia of holes (mm)	Pattern of holes			Top Stemming Column(m)
			Depth(m)	Burden(m)	Spacing(m)	
1	Overburden	60	6.0	1.0	5.0	5.0
		100	6.0	5.0	5.5	5.2
2	Coal					

7. Maximum charge per delay shall not exceed 20.0 kg/delay in coal and 24Kg/delay in overburden and total explosive per round shall not exceed 240kg in overburden benches and 200 kg in coal benches.
8. The Peak Particle Velocity (PPV) of blast induced ground vibrations, measured at a distance of 60m from the place of firing shall not exceed 10mm/sec to limit the PPV to the threshold limit and to obviate damage to structures due to blast induced ground vibrations, the diameter of the deep holes shall not exceed 160mm and depth shall not exceed 6m.
9. To control flying fragments resulting out of blasting from projecting beyond a distance of 10meters from the place of blast, following precautions shall be taken:-

103

- a. No shot hole shall be fired in crushed, broken or fractured ground/strata
  - b. Blasting shall be done against a free face only. Blasted material shall be cleared off before commencement of drilling operation for succeeding round.
  - c. Top stemming column shall not be less than the burden.
  - d. Only such stemming material that is free from pebbles and stone chips shall be used. Moist sand shall be used for stemming of deep holes.
  - e. Only NONEL initiation system shall be used during blasting operation.
  - f. All the blasting operation shall be conducted with muffling arrangement strictly. Muffling of holes should be done with conveyor belt or wire netting pieces (1.8m x 1.2m) overlain by 3 to 4 sand bags each 35.0-40.0kg by weight.
  - g. Variation in inclination of holes shall be within 5 degrees to avoid variation in crest and toe burden.
  - h. In an undercut bench face, the quantity of explosives to be charged within undercut portion shall be suitably reduced.
  - i. In case water is encountered in any shot-hole, either the shot-hole shall be dewatered by blowing compressed air into the hole or the explosive column shall be gently pushed down by wooden rod and sufficient time given for the explosive column to sink to the desired depth before the round is fired.
  - j. Shot holes shall be adequately muffled by laying wire net, tyre rubber mats or old conveyor belting over the entire blasting area and by placing 50-60Kgs sand bags at the collar of each shot hole, so that no flying fragment is projected beyond 10m in any blast.
- 10.
- a. Monitoring of PPV and of the dominant frequency shall be done with each round of deep-hole shots fired.
  - b. A proper record of blast parameters like spacing and burden of holes, hole depth, number of holes fired in the round, charge per hole and charge per round, length of explosive column(s) and stemming column length(s), initiation pattern (with proper sketches wherever called for), manner of muffling, results of ground vibration observed (PPV, frequency and air over pressure) and distance up to which flying fragments resulting out of blasting projected, shall also be kept maintained in a bound paged book with each round of deep-hole shots fired. The records shall be duly signed by the Blasting Officer and countersigned by the Manager of the mine.
  - c. In case, with any of the deep-hole rounds fired, the PPV of ground vibrations resulting out of blasting is observed to be more than 10mm/sec at a distance of 60m from the site of blast or the flying fragments project to a distance beyond 10m from the place of firing/blasting, operations shall be discontinued and this Directorate shall be informed immediately and blasting operations connected with this permission shall not be resumed unless express permission in writing is accorded by this Directorate.
- 11.
- a. The manager shall fix the time of blasting and same shall be circulated to all concerned including to habitants of structures and dwellings, not belonging to M/s ECL. The timings shall also be conspicuously posted on the notice board at prominent places.
  - b. Code of practice for blasting shall be framed by the Manager, which shall strictly be followed.
  - c. Blasting shall be done only during daylight hours.
  - d. No blasting shall be done in crushed, broken or sliced or fractured ground.

- (104)
- e. The surface over the area to be blasted and upto 10m around the hole shall be cleaned of any loose material or stones etc. The area falling within a distance of 60 cm from the collar of each blast hole shall be cleaned of loose stone, drill cuttings, debris and other loose material.
  - f. Two way communication by wireless/walkie-talkie sets shall be provided to the Assistant Manager in-charge of blasting, the shot-firer and to the assistants of the shot-firer. The set, including mobile phones in possession of blasting personal, if any, shall remain switched off during handling and charging of explosives.
  - g. Before shots are charged, stemmed and fired, sufficient warning by siren or other suitable means shall be given to warn persons within a radius of 500m, including to the inhabitants of structures and dwellings, not belonging to M/s ECL.
  - h. It shall be ensured that no person remains in the dwellings/structures of any of the villages falling within a radial distance of 500m of the place of firing at the time of blasting. Guards shall be posted for the purpose to ensure that no person inadvertently enters the danger zone, and that all persons within the danger zone have taken proper shelter.
  - i. Guards shall be posted at either end/extreme points of the village road falling within danger zone, who shall by different signals, including creation of a traffic to the shot-firer and also warn passerby and vehicles.
  - j. Suitable emulsion explosives shall be used, if high water penetration is observed in the drilled holes.
  - k. If fire/smoke is found, suitable explosives, which are capable of withstanding high temperature up to 80°C shall be used. No hole shall be charged and blasted if temperature in the hole is more than 80°C.
  - l. During storms and thundering, all metals and metallic pieces shall be solidly earthed during flashing and all leads shall be separated and earthed to prevent accidental connection with any metal body.
12. Owners of structures and dwellings, not belonging to M/s ECL, and inhabitants/occupants of such dwellings/buildings shall be indemnified against damage to property/injury to person, if any, arising out of blasting operations.
  13. In the event of any change in the circumstances, likely to affect the safety of persons or damage to structures not belonging to the M/s ECL, this permission shall be deemed to have been withdrawn.
  14. If any of the conditions subject to which this permission has been granted is violated or not complied with, this permission shall be deemed to have been revoked with immediate effect.
  15. The above permission may be amended or withdrawn at any time, if considered necessary in the interest of safety.
  16. This permission is being issued without prejudice to any other provision of statute, which may be or may become applicable, at any time.
  17. This permission shall remain valid for a period of one year from the date of issue of this letter.

H. B. Bhat  
 23/5/14  
 (Signature)  
 Chief Executive Officer,  
 M/s. ECL, Bangalore  
 Bangalore - 560 001

CENTRAL DESPATCH

Rajmahal Area, ECL



Sl. No. 1404

Date 25/07/15

भारत सरकार

GOVERNMENT OF INDIA

ग्राम एवं रोजगार मंत्रालय

MINISTRY OF LABOUR & EMPLOYMENT

खान सुरक्षा महानिदेशालय

DIRECTORATE GENERAL OF MINES SAFETY

पूर्वी अंचल, सीतारामपुर

EASTERN ZONE, SITARAMPUR

Secretariat Central

Dispatch Office Rajmahal OCP

Sl. No. 1642

Date 31.7.15



105

संख्या एस /010375/II-B/170(1A) & 170(1B)(b)/2015/ सीतारामपुर, दिनांक \_\_\_\_\_

प्रेषक,

खान सुरक्षा निदेशक

खान सुरक्षा महानिदेशालय

सीतारामपुर क्षेत्र संख्या-3, पोस्ट : सीतारामपुर, जिला : बर्धमान।

सेवा मे,

अभिकर्ता,

राजमहल ओएससीपी,

मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड,

पोस्ट : लाल माटिया, जिला : गोड्डा, झारखण्ड-814 165।

ANNEXURE-6

Sub: Permission under Regulation 170(1A) & 170(1B)(b) of the Coal Mines Regulations, 1957 to conduct controlled deep hole blasting within 300m but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature from the Villages( Lohandia bazaar, Lalghutua, Basdiha, Bhato Tola, Abhi Tola, Mem Tola, Mukhia Tola, Bathan Tola, Dahar Tola, Chota Bhorai, Paharpur etc.) at Opencast workings of Rajmahal OCP of M/s. Eastern Coalfields Limited - Extension thereof.

Dear Sir,

Please refer to your letters no. RJML: GM(OP):12:219 dated 10.06.2015 and plan bearing No. ECL/RJML/OCP/SURV/141 dated 07.06.2015 enclosed therewith on the above subject.

The matter has since been examined in the light of the information submitted by you along with the application.

By virtue of powers conferred on Chief Inspector of Mines (also designated as Director-General of Mines Safety) under the provisions of Regulations 170(1A) & 170(1B)(b) of the Coal Mines Regulations 1957, and by virtue of the authorization granted to me by the Chief Inspector of Mines (also designated as Director-General of Mines Safety) under Section 6(1) of the Mines Act, 1952, I, hereby grant you relaxations from the above mentioned regulations, and permit you to conduct deep hole blasting at Rajmahal OCP of M/s. Eastern Coalfields Ltd., within 300metres but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature not belonging to the owner from the villages at Rajmahal OCP, subject to the following conditions being strictly complied with:-

- Wm (OP), Deep  
- Manager, OCP  
- TS/ISO, Room  
AT

106

1. All the conditions of the Permission granted under Reg. 170(1B) & 170 (1A) of the CM, 1957 for conduct of controlled deep hole blasting within 300m beyond 60m of private houses, dwellings/hutments and other structures of permanent nature from the Villages( Lohandia bazaar, Lalghutua, Basdiha, Bhato Tola, Abhi Tola, Mem Tola, Mukhia Tola, Bathan Tola, Dahar Tola, Chota Bhorai, Paharpur etc.) at Opencast workings of Rajmahal OCP of M/s. Eastern Coalfields Limited vide letter no. S3/010375/II-B/170(1A)&170(1B)/2014/1672 dated 23.07.2014 shall remain unaltered except condition no. 17 of the said permission.
2. It shall be ensured that no person remains in the dwellings/structures of any of the villages falling within a radial distance of 500m of the place of firing at the time of blasting. Guards shall be posted for the purpose to ensure that no person inadvertently enters the danger zone, and that all persons within the danger zone have taken proper shelter.
3. Owners of structures and dwellings, not belonging to M/s ECL, and habitants/occupants of such dwellings/buildings shall be indemnified against damages to property/injury to person, if any, arising out of blasting operations.
4. In the event of any change in the circumstances, likely to affect the safety of persons or damage to structures not belonging to the M/s ECL, this permission shall be deemed to have been withdrawn.
5. The above permission may be amended or withdrawn at any time, if considered necessary in the interest of safety.
6. This permission is being issued without prejudice to any other provision of statute, which may be or may become applicable, at any time.
7. This permission shall remain valid for a period of one year from the date of issue of this letter.

भवदीय,

₹0/-

(मुरलीधर मिश्रा)

खान सुरक्षा उपनिदेशक,  
कृते खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-III.




107

संख्या एस /010375/II-B/170(IA) & 170(1B)(b)/ 2015/ 1037 सीतारामपुर, दिनांक 22-6-15

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है.

1. प्रबन्धक, राजमहल ओ सी पी, मेसर्स -ई सी एल, पोस्ट- लालमाटिया, जिला - गोड्डा, झारखण्ड ।
2. महाप्रबन्धक, राजमहल ग्रुप ऑफ माइन्स, मेसर्स -ई सी एल, पोस्ट- लालमाटिया, जिला - गोड्डा, झारखण्ड ।
3. निदेशक, (तकनीकी)संचालन/ मनोनित मालिक, ईस्टर्न कोलफील्डस लिमिटेड, साकतोड़िया, पो0 डिसेरगढ़, जि0 बर्द्धमान ।

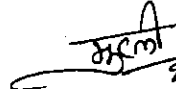  
22/6/15  
खान सुरक्षा उपनिदेशक,  
कृषि खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-III.



# ANNEXURE - 7



भारत सरकार  
GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय  
MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय  
DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर  
EASTERN ZONE, SITARAMPUR

Secretary Central  
Dispatch Office Rajmahal OCP

Sl. No. 1302  
Date 12.7.16



108

संख्या एस /010375/II-B/170(1A) & 170(1B)(b)/ 2016/ 963 सीतारामपुर, दिनांक 29.6.16

प्रेषक,

खान सुरक्षा निदेशक

खान सुरक्षा महानिदेशालय

सीतारामपुर क्षेत्र संख्या-3, पोस्ट : सीतारामपुर, जिला : बर्दमान।

सेवा मे,

अभिकर्ता,

राजमहल ओसीओपी,

मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड,

पोस्ट : लालमाटिया, जिला : गोड्डा, झारखण्ड-814 165।

**Sub: Permission under Regulation 170(1A) & 170(1B)(b) of the Coal Mines Regulations, 1957 to conduct controlled deep hole blasting within 300m but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature from the Villages (Lohandia bazaar, Laighutua, Basdiha, Bhato Tola, Chota Bhorai, Paharpur etc.) at Opencast workings of Rajmahal OCP of M/s. Eastern Coalfields Limited - Extension thereof.**

प्रिय महोदय,

Please refer to your letters no. ECL/RJML/OCP/162 dated 12.06.2016 and plan bearing No. ECL/RJML/OCP/SURV/Blasting Permission Plan/215 dated 12.06.2016 enclosed therewith on the above subject.

The matter has since been examined in the light of the information submitted by you along with the application.

By virtue of powers conferred on Chief Inspector of Mines (also designated as Director-General of Mines Safety) under the provisions of Regulations 170(1A) & 170(1B)(b) of the Coal Mines Regulations 1957, and by virtue of the authorization granted to me by the Chief Inspector of Mines (also designated as Director-General of Mines Safety) under Section 6(1) of the Mines Act, 1952, I, hereby grant you relaxations from the above mentioned regulations, and permit you to conduct deep hole blasting at Rajmahal OCP of M/s. Eastern Coalfields Ltd., within 300metres but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature not belonging to the owner from the villages at Rajmahal OCP, subject to the following conditions being strictly complied with:-

① map & Safety  
② Blast plan  
③ DGMS file  
17/7/16

(109)

1. All the conditions of the Permission granted under Regulation 170(1A) & 170(1B)(b) of the Coal Mines Regulations, 1957 to conduct controlled deep hole blasting within 300m but beyond 60m of private houses, dwellings/hutments and other structures of permanent nature from the Villages( Lohandia bazaar, Lalghutua, Basdiha, Bhato Tola, Abhi Tola, Mem Tola, Mukhia Tola, Bathan Tola, Dahar Tola, Chota Bhorai, Paharpur etc.) at Opencast workings of Rajmahal OCP of M/s. Eastern Coalfields Limited - Extension thereof vide letter no. S3/010375/II-B/170(1A)&170(1B)/2015/1035 dated 22.06.2015 shall remain unaltered except condition no. 07 of the said permission.

This permission shall remain valid for a further period of one year i.e. up to 22.06.2017.

भवदीय,

४ श्री निमाजी २५/०६/२०१६  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-३.

# ANNEXURE - 8

110)

## Ministry of Labour

Noti. No S.O. 2063, dated June 21, 1988 published in 1989

CCL-III-12

In Exercise of the powers conferred by subsection(1) of Section 10 of the Contract Labour (Regulation and Abolition) Act, 1970 (37 of 1970) and in supersession of the notification of the Government of India in the Ministry of Labour, Noti No. S.O. 488 dated the 1st February, 1975 published in the Gazette of India, Part II, Section 3, sub-section(ii), dated the 15th February, 1975, the Central Government, after consultation with the Central Board hereby prohibits the employment of Contract Labour in the works specified in the Schedule annexed hereto in all coal mines in the Country.

### THE SCHEDULE

1. Raising or raising-cum-selling of coal
2. Coal loading and unloading
3. Over-burden removal and earth cutting
4. Iron-ore manufacturing
5. Drawing of stone drifts and miscellaneous stone cutting underground

Provided that this notification shall not apply to the following categories:-

- (a) Quarries in the North-East Coal Field which can only be worked for a few months every year due to heavy rainfall in the area;
- (b) Quarries located by the side of the river in punch valley and similar other patch deposits which can only be worked when the level of the river has gone down and during non-rainy seasons;
- (c) loading coal where there is mechanical failure, failure of power or irregular supply of wagons by the Railways; and
- (d) cutting stone drifts/faults which cannot be detected in advance and are of short duration say up to six month

# ANNEXURE-9

## MINISTRY OF LABOUR AND EMPLOYMENT NOTIFICATION


New Delhi, the 7th December, 2015

S.O. 3284(E).—In exercise of the powers conferred by section 31 of the Contract Labour (Regulation and Abolition) Act, 1970, the Central Government, after consultation with the Central Advisory Contract Labour Board, hereby, exempts various Coal Companies under the aegis of Coal India Limited namely the Eastern Coalfields Limited, Sanctoria; the Central Coalfields Limited, Ranchi; the Bharat Coking Coal Limited, Dhanbad; the Western Coalfields Limited, Nagpur; the South Eastern Coalfields Limited, Bilaspur; the Northern Coalfields Limited, Singhanurahi and the Mahanadi Coalfields Limited, Sambalpur from the applicability of notification of the Government of India in the Ministry of Labour, number S.O. 2063 dated the 21st June, 1988, published in the Gazette of India, Part-II, section 3, sub-section (ii), in respect of employment of contract labour in the works specified in the Schedule to the notification, at serial numbers 1 to 3, for a period of five years with effect from the date of publication of this notification in the Official Gazette subject to the conditions that—

- the interest of the workmen engaged in the above mentioned jobs be protected;
- such workmen be paid wages and other benefits as per the recommendations of the high powered committee appointed by the Coal India Limited, Ministry of Coal, Government of India and the rates notified by the Coal India Limited on the 13<sup>th</sup> February, 2013; and
- the Central Advisory Contract Labour Board will have the right to inspect the establishment to ensure and check whether such wages and benefits are given to such workers in Coal India Limited and its subsidiary concerned.

[F. No. U-23013/15/2014-L.W.]

BIPIN MALLICK, Jr. Secy.

	<p><b>EASTERN COALFIELDS LIMITED</b> (A subsidiary of Coal India Limited) Office of the Chairman-cum-Managing Director, Sanctoria, P.O.-Dishergarh, Dist.-Burdwan, West Bengal-713333 CIN-U10101WB1975GO1030295 Website-www.easterncoal.gov.in Telefax: 0341-2523586 E-Mail: eclpersonneldept@gmail.com</p>	<p><b>ईस्टर्न कोलफील्ड्स लिमिटेड</b> (ए सब्सिडियरी ऑफ कोल इंडिया लिमिटेड) कार्यालय अध्यक्ष-सह-प्रबंध निदेशक सांक्टोरिया, पो-आ-दिशेरगढ़, जिला-बर्दवान, पश्चिम बंगाल-713333 सी.आई.एल.-U10101WB1975GO1030295 वेबसाइट- www.easterncoal.gov.in Telefax: 0341-2523586 E-Mail: eclpersonneldept@gmail.com</p>
---	---	--

Ref. ECL/CMD/C-6D/IL/151CL/1516

Dated 25.12.2015

To,

All CGM/GM,

All Areas/All Workshops/J.K.Ropeways/HRD/MRS./HOD, ECL Sales Office, Kolkata.

Sub: Notification bearing SO No.3284 (E) dated 07.12.2015 issued by Joint Secy.Ministry of Labour & Employment, GOI granting exemption from the applicability of Notification bearing SO No.2063 dated 21.06.1988 in respect of Employment of Contract Labour.

Dear Sir(s),

The above notification dated 07.12.2015 together with the earlier notification bearing SO No.2063 dated 21.06.1988 is forwarded for kind information.

Yours faithfully,

*R. Paul*  
25/12/15  
General Manager(P&IR), ECL

c.c.:-

- Director(P), ECL.
- GM(CMC), ECL/GM(Civil), ECL/ Dy.GM(TA), ECL/Dy.GM(Admn.), ECL
- CMO(I/C), CH, Kalla/Sanctoria Hospital.
- APMs of All Areas/Establishments/All W/Shops/JK Ropes/ECL Sales Office, Kolkata/HRD/Mines Rescue Station.

Annexure - 10

112

Details of deceased employees of M/s. MIPL-NKAS(JV)

Sl No.	Name of deceased	Designation	Father's name	Body recovery date	Address
1	Hari Kishore Yadav	Excavator Opt.	Dadan Yadav	30.12.2016	Vill+Po- Jalalpur, Thana- Daranda, Dist- Siwan(Bihar)
2	Javed Akhtar	Excavator Opt.	Jasnuddin Ansari	30.12.2016	Vill- Parthara, Post- Nildan, Thana+Dist- Garwa(Jharkhand)
3	Rajendra Yadav alias Bona	Excavator Opt.	Ram Nares Yadvav	30.12.2016	Vill- Patdi, Post- Maharajganj, Dist- Siwan(Bihar)
4	Brijesh Yadav	Excavator Opt.	Kamaldeo Yadav	30.12.2016	Vill- Chitoura, Post+ Thana- Saharwar, Dist Balia (U.P.)
5	Sanjay Kr.Sahi	Tipper Driver	Sujit Sahi	30.12.2016	Vill. Deoria, Dist. Lohardagga, Jharkhand
6	Md. Nurul	Tipper Driver	Md. Raftique	30.12.2016	Vill - Thuriya, PO- Pahari, Thana- Sahapur, Tahsil- Bhouganj, Dist. Riwa(MP)
7	Jai Prakash Rai	Tipper Driver	Tola Rai	30.12.2016	Vill. Lalhapra, Dist. Muzaffarpur (Bihar)
8	Nageshwar Paswan	Tipper Driver	Sakhichand Paswan	30.12.2016	Vill. Barun, Thana- Paru, Dist. Mazaffarpur(Bihar)
9	Ajit Patel	Excavator Opt.	Dinesh Prasad Patel	30.12.2016	Vill. Liina, P.O. Banuji, Thana- Amliya, Dist. Siddhi, M.P.
10	Sakil Khan	Tipper Driver	Yunush Khan	30.12.2016	Vill - Mander, Dist- Ranchi, Jharkhand
11	Vikash Patel	Tipper Driver	K P Patel	30.12.2016	Vill - Sadjir, Post - Sombarsha, Siddhi, M.P.
12	Sunil Bhengra	Tipper Driver	Laxman Bhengra	31.12.2016	Vill + Post - Koira, District - Odisha
13	Ajay Kumar Kushwaha	Dozer Opt.	Baleswar Mahlo	31.12.2016	Vill - Goriyakarna, Post -Barhi, District - Hazaribag, Jharkhand
14	Md.JulfiKar	Tipper Driver	Safii Mahommad	31.12.2016	Vill - Baldhi, PS - Chitarangi, District - Singrauli, M.P.
15	Md.Jamir	Tipper Driver	Lal Mohammad	31.12.2016	Vill - Kunjhun, Post - Naglhar, Dist - Siddhi, M.P.
16	Raj Kamal Goswami	Tipper Driver	Sudama Goswami	31.12.2016	Vill - Bathaya, Post - Chitoria P.S- Amelia, Dist. - Siddhi, M.P.
17	Sanjit Viswakarma	Tipper Driver	Ram Patik Viswakarma	01.01.2017	Vill - Kodhar, Post - Sombarsha, District - Siddhi, M.P.
18	Laddu Yadav	Excavator Opt	Yogeshwar Yadav	01.01.2017	Vill - Bisanda, Thana - Chandi, District - Nalanda, Bihar

19	Lalu Khan	Incharge	Sattar Khan		Vill - Liliker, Post- Basuri, Thana - Ayit, Dist- Siddi, M.P.
20	Madhur Shyam Patel	Supervisor	Karamelli Patel		Vill - Mayapur, Thana - Nakhtrana, Dist - Bhoj, Gujrat
21	Gagan Singh	Supervisor	Ashish Singh		Vill - Dimgach, Post- Tadrasht, Thana - Sanbaura, Dist - Bhagalpur, Bihar
22	Parvez Alan	Driver	Samsuddin		Vill - Hehal, Post - Chasigada, P.S. Patrai, Dist - Raigarh (Jharkhand)
23	Bheem Ram	Driver	Anu Ram		Vill + Post - Bhiashibag, Thana - Karamchak, Di - Kaimur (Bihar)






# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2)]

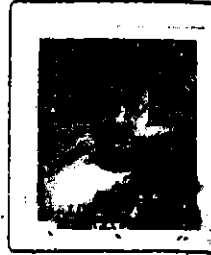

1.	Serial No./ Unique Man No.	189
2.	Name & Surname of the employee	Hari Kishor Gaur
3.	Father's or Husband's name	Gagan Gaur
4.	Age and Sex	01/01/1990 / Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee	Emt - opnt
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise)	open cast
	(c) Whether employment is permanent or temporary or casual	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District Railway Station	Vill - Barma gari, Talalpur, Taluka - Dhamuda, (Siwani)
8.	Date of commencement of employment	
9.	Date of first appointment, with the present owner	03/09/2015
10.	Date of termination or leaving of employment	
11.	In case of adolescent reference to certificate of fitness grounded under section 40	
12.	Mark of Identification on the body	Burn Mark on Leg
13.	Name, address, relationship of person to be informed in case of accident/ emergency	Person to Informant, Mobile no - 9931788661
14.	Token number and other particulars by which the employee may be identified	189
15.	Passport size photograph of the person employed	
16.	Signature or Thumb impression of the employee	Hari Kishor Gaur
17.	Remarks	

Signature of Register Keeper


Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2)]

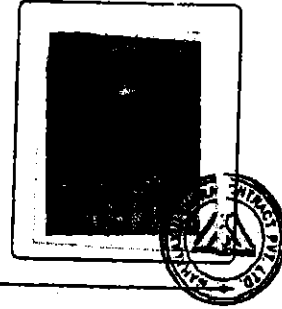

1. Serial No./ Unique Man No. : 196.

2. Name & Surname of the employee : Javed Akhtar.

3. Father's or Husband's name : Asama Bibi (mother)

4. Age and Sex : male - 20.04.1996

5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965

6. (a) Designation of the employee : Ex. operator

(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : O . C . P

(c) Whether employment is permanent or temporary or casual : Temporary

7. Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station : At - parihar, po - Tildag. P.S - Gadwa. (JH) Pin - 822114

8. Date of commencement of employment :

9. Date of first appointment, with the present owner : 14.08.16

10. Date of termination or leaving of employment :

11. In case of adolescent reference to certificate of fitness granted under section 40 : N/A

12. Mark of identification on the body : A mole mark on the face.

13. Name, address, relationship of person to be informed in case of accident/emergency : Smt. Asama. devi (Mother) address - Same as above.

14. Token number and other particulars by which the employee may be identified : 196

15. Passport size photograph of the person employed :

16. Signature or Thumb Impression of the employee : Javed Akhtar

17. Remarks :

Signature of Manager

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2) ]



1. Serial No./ Unique Man No. :	187
2. Name & Surname of the employee :	Rajendra Yadav
3. Father's or Husband's name :	Ramareesh Yadav
4. Age and Sex :	01/01/1988 Male
5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6. (a) Designation of the employee :	Labourer
(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open cast
(c) Whether employment is permanent or temporary or casual :	Temporary
7. Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	Paterhi, Paterhi, Siwan, Paterhi, Bihar - 841242
8. Date of commencement of employment :	
9. Date of first appointment, with the present owner :	4.05.14
10. Date of termination or leaving of employment :	
11. In case of adolescent reference to certificate of fitness grounded under section 40 :	
12. Mark of identification on the body :	Burn mark on leg
13. Name, address, relationship of person to be informed in case of accident/ emergency :	
14. Token number and other particulars by which the employee may be identified :	187
15. Passport size photograph of the person employed :	
16. Signature or Thumb impression of the employee :	
17. Remarks :	

Signature of Register Keeper

Signature of Manager



1176  
"FORM-B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]

1.	Serial No./ Unique Man No.	199.
2.	Name & Surname of the employee	Brigesh yadav.
3.	Father's or Husband's name	Kamaldar yadav.
4.	Age and Sex	01/01/1993 And Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee	Event - opet
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise)	Open cast
	(c) Whether employment is permanent or temporary or casual	Temporary.
7.	Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station	Vill - chitora, P.O - Sahrawan, P.S - Sahrawan Dist - Balia (U.P.)
8.	Date of commencement of employment	
9.	Date of first appointment, with the present owner	02.11.2016
10.	Date of termination or leaving of employment	
11.	In case of adolescent reference to certificate of fitness ground under section 40	N/A
12.	Mark of identification on the body	cut Mark on Head.
13.	Name, address, relationship of person to be informed in case of accident/ emergency	Mr. Kamaldar yadav (Father) address - Same as above.
14.	Token number and other particulars by which the employee may be identified	199
15.	Passport size photograph of the person employed	
16.	Signature or Thumb Impression of the employee	ब्रिजेश यादव
17.	Remarks	

Signature of Register Keeper

Signature of Manager





(117)

# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]

1.	Serial No./ Unique Man No.	208.
2.	Name & Surname of the employee	Sanjay. kumar Sahu
3.	Father's or Husband's name	Sujit Sahu
4.	Age and Sex	male. 7.05.1980
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee : volvo. Driver.	
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : O. C. P.	
	(c) Whether employment is permanent or temporary or casual : Temporary.	
7.	Home Address of the employee, giving Village, Post Office, Thana and District Railway Station : At :- Deodharlya, po :- Richugutta, pl :- jobang. Dis - Lohardaga. Pin :- 835305	
8.	Date of commencement of employment	
9.	Date of first appointment, with the present owner : 2.03.15	
10.	Date of termination or leaving of employment	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 : N/A	
12.	Mark of identification on the body : A cut mark in right leg.	
13.	Name, address, relationship of person to be informed in case of accident/emergency : Mr. Sujit Sahu (father), address same as above.	
14.	Token number and other particulars by which the employee may be identified : 203.	
15.	Passport size photograph of the person employed	
16.	Signature or Thumb impression of the employee : Sanjay kumar Sahu	
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM-B"

[ See Rules 48 (3) 51 77 and 77 A (2)]



1.	Serial No./ Unique Man No. : 1934.
2.	Name & Surname of the employee : Mohd Noorul
3.	Father's or Husband's name : Mohd Rafeeq
4.	Age and Sex : 16.11.1990 And Male.
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965
6.	(a) Designation of the employee : Volvo - Driver
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : open cast.
	(c) Whether employment is permanent or temporary or casual : Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station : Vill-Thumriha, P.O.-Pahadi Rewa (M.P)
8.	Date of commencement of employment.
9.	Date of first appointment with the present owner : 02.07.2016
10.	Date of termination or leaving of employment.
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :
12.	Mark of Identification on the body : A cut Mark on Right Leg.
13.	Name, address, relationship of person to be informed in case of accident and emergency :
14.	Token number and other particulars by which the employee may be identified : 1934
15.	Passport size photograph of the person employed :
16.	Signature or Thumb impression of the employee :
17.	Remarks :

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRACONTRACT LTD.

"FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2) ]



1.	Serial No./ Unique Man No. :	05
2.	Name & Surname of the employee :	Raj Prakash Rai
3.	Father's or Husband's name :	Lupa Rai
4.	Age and Sex :	17.12.1978 Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	Volvo - Driver
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open cast
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station :	At - Laluchapra, Mithabampur (Bihar)
8.	Date of commencement of employment :	20th July 2012
9.	Date of first appointment, with the present owner :	
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Cut Mark on head
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Person to be informed - wife Mobile no - 07739038916
14.	Token number and other particulars by which the employee may be identified :	05
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	Raj Prakash Rai
17.	Remarks :	

Signature of Register Keeper

Signature of Manager




# MAHALAXMI INFRA CONTRACT LTD.

120

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77 A (2) ]

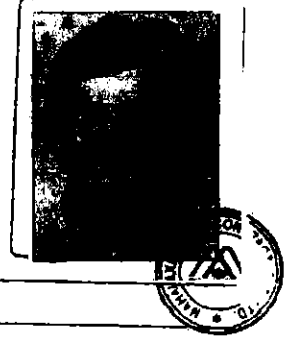

1.	Serial No./ Unique Man No. :	200
2.	Name & Surname of the employee :	Nagerhwar paswan
3.	Father's or Husband's name :	Hari - Ram.
4.	Age and Sex :	male And 05/09/1987
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	volvo Driver
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	O. C. P.
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	At + PO: Barun, Dis- Aurangabad. state - Bihar
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	25.11.16
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	N/A
12.	Mark of identification on the body :	A mole mark in left hand
13.	Name, address, relationship of person to be informed in case of accident/emergency :	Mr. Hari - Ram. ( Father ) address same as above.
14.	Token number and other particulars by which the employee may be identified :	200
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	
17.	Remarks :	

Signature of Register Keeper

Signature of Manager





# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2) ]



1.	Serial No./ Unique Man No. :	184.
2.	Name & Surname of the employee :	Ajeet Patel.
3.	Father's or Husband's name :	Dinesh Patel.
4.	Age and Sex :	11/11/1989 And Male.
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	Exert - opof.
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	open cast
	(c) Whether employment is permanent or temporary or casual :	Temporary.
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	Matam No - 137, Tahasil Sihawal, Gram Lilwar, Bamuni, Kothari, Bamuni, Sidhi, Madhya Pradesh, 486661.
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	07.09.15
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness granted under section 40 :	
12.	Mark of identification on the body :	A cut Mark on Hand.
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Person to be Informant - Father. Mob. NO - 7746894265-
14.	Token number and other particulars by which the employee may be identified :	184
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	अजीत पटेल
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM-B"

( See Rules 48 (3) 51 77 and 77 A (2) )

22



1.	Serial No./ Unique Man No. :	191.
2.	Name & Surname of the employee :	Shakil Khan.
3.	Father's or Husband's name :	Yousuf Khan.
4.	Age and Sex :	10.09.1990 - Male.
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	Valve Driver.
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open Cast.
	(c) Whether employment is permanent or temporary or casual :	Temporary.
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	AT- Mandan, PO - Mandan, PS - Mandan. Ramchi - Jharkhand.
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	03.10.2015
10.	Date of termination or leaving of employment :	23.10.2015
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Black mole on Face.
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Told. 28 a Father Same 28 09336699351
14.	Token number and other particulars by which the employee may be identified :	191
15.	Passport size photograph of the person employed	
16.	Signature or Thumb impression of the employee :	Shakil Khan
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRACONTRACT LTD.

## "FORM-B"

[ See Rules 48 (3), 51, 77 and 77 A (2) ]



1. Serial No./ Unique Man No. : 190

2. Name & Surname of the employee : Vikash Patel.

3. Father's or Husband's name : Sri K. R. Patel.

4. Age and Sex : 01/07/1987 And Male.

5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965

6. (a) Designation of the employee : Dumper - Driver -

(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : open cast.

(c) Whether employment is permanent or temporary or casual : Temporary.

7. Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station : Vill. Sahji, P.O. Sonvansha, Dist. - Sidhi, State - (M.P.)

8. Date of commencement of employment :

9. Date of first appointment, with the present owner : 10/06/2015

10. Date of termination or leaving of employment :

11. In case of adolescent reference to certificate of fitness grounded under section 40 :

12. Mark of Identification on the body : Cut Mark on chest.

13. Name, address, relationship of person to be informed in case of accident/ emergency :

14. Token number and other particulars by which the employee may be identified : 199

15. Passport size photograph of the person employed :

16. Signature or Thumb impression of the employee :

17. Remarks :

Signature of Register Keeper

Signature of Manager



(129)  
**MAHALAXMI INFRACONTRACT LTD.**

**"FORM-B"**

[ See Rules 48 (3) 51 77 and 77 A (2) ]

1.	Serial No./ Unique Man No. : 155
2.	Name & Surname of the employee : <u>Sunil Bhangra</u>
3.	Father's or Husband's name : <u>Laxman Bhangra</u>
4.	Age and Sex : <u>07/10/1984</u>
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965
6.	(a) Designation of the employee : <u>Volvo-Driver</u> (b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : <u>Open cast</u> (c) Whether employment is permanent or temporary or casual : <u>Temporary</u>
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station : <u>Village. Harsikhandpur G.P./Town. Kojra P.S. - Kojra Dist. - Sundergarh</u>
8.	Date of commencement of employment : <u>17/05/15</u>
9.	Date of first appointment, with the present owner : <u>17/05/15</u>
10.	Date of termination or leaving of employment :
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :
12.	Mark of Identification on the body : <u>cut marks on head</u>
13.	Name, address, relationship of person to be informed in case of accident/ emergency : <u>Person to be informed wife Mob. No - 08763090294</u>
14.	Token number and other particulars by which the employee may be identified : <u>155</u>
15.	Passport size photograph of the person employed :
16.	Signature or Thumb impression of the employee : <u>Sunil Bhangra</u>
17.	Remarks :

[Signature]  
Signature of Register Keeper

[Signature]  
Signature of Manager





# MAHALAXMI INFRACONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3) 51, 77 and 77 A (2) ]



1.	Serial No./ Unique Man No. :	188
2.	Name & Surname of the employee :	Kulshwar Kumar
3.	Father's or Husband's name :	Balshwar Mahato
4.	Age and Sex :	01/01/1996
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1955	
6.	(a) Designation of the employee :	Dogger - open
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	open cast
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	Vill - Gousiyakamp, Po - Gousiyakamp, Ps - Borki, Borki, Hazaribagh Jharkhand-825405
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	9.11.13
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Male mark on neck
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	
14.	Token number and other particulars by which the employee may be identified :	187
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb Impression of the employee :	Kulshwar Kumar
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3) 51. 77 and 77 A (2)]



1. Serial No./ Unique Man No. : 186
2. Name & Surname of the employee : Jufker Mohammad
3. Father's or Husband's name : Safi Mohammad
4. Age and Sex : 10/07/1991 Age Male
5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965
6. (a) Designation of the employee : Volvo - Driver.  
(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : open cast  
(c) Whether employment is permanent or temporary or casual : Temporary.
7. Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station : Baram - Bardi, Pail - Bardi, Singrauli, Bardi, Madhya Pradesh, 486882.
8. Date of commencement of employment :
9. Date of first appointment, with the present owner : 02.05.2015
10. Date of termination or leaving of employment :
11. In case of adolescent reference to certificate of fitness grounded under section 40 :
12. Mark of identification on the body : Cut Mark on chest.
13. Name, address, relationship of person to be informed in case of accident/ emergency :
14. Token number and other particulars by which the employee may be identified : 186
15. Passport size photograph of the person employed :
16. Signature or Thumb impression of the employee : Jufker Mohammad
17. Remarks :

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

"FORM- B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]



1. Serial No./ Unique Man No. :	193.
2. Name & Surname of the employee :	Jameer Mohammed.
3. Father's or Husband's name :	Lal Mohammad.
4. Age and Sex :	22.07.1986 Male
5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6. (a) Designation of the employee :	Volvo-Dalva.
(b) Nature of employment (whether above or below ground. if any above ground whether in Open cast working or otherwise) :	open cast.
(c) Whether employment is permanent or temporary or casual :	Temporary.
7. Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	Vill - Kumbhum, P.S - Naktham. Dist - Siddhi, state - (M.P)
8. Date of commencement of employment	
9. Date of first appointment, with the present owner :	04.06.06
10. Date of termination or leaving of employment :	
11. In case of adolescent reference to certificate of fitness grounded under section 40 :	
12. Mark of identification on the body :	A black Mark on Right hand.
13. Name, address, relationship of person to be informed in case of accident/ emergency :	
14. Token number and other particulars by which the employee may be identified :	193
15. Passport size photograph of the person employed	
16. Signature or Thumb Impression of the employee :	<i>[Signature]</i>
17. Remarks :	

Signature of Register Keeper

Signature of Manager

Sign



# MAHALAXMI INFRACONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2)]

128



1.	Serial No./ Unique Man No. :	139
2.	Name & Surname of the employee :	Rajkumar Goswami
3.	Father's or Husband's name :	Sudama Goswami
4.	Age and Sex :	24, Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	Volvo - Driver
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open Cast
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District Railway Station :	Village - Balhoga, Chitwariya No. 3, Chitwariya, Po - Siddhi, Dist - Siddi, M.P. - 486670
8.	Date of commencement of employment :	10/04/15
9.	Date of first appointment, with the present owner :	10/04/15
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Cut marks on forehead
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Person to be informed - Father MB - 7509711476
14.	Token number and other particulars by which the employee may be identified :	139
15.	Passport size photograph of the person employed	
16.	Signature or Thumb Impression of the employee :	राजकुमार
17.	Remarks :	

  
Signature of Register Keeper

  
Signature of Manager





# MAHALAXMI INFRA CONTRACT LTD.

## "FORM-B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]

129

1.	Serial No./ Unique Man No. :	202.
2.	Name & Surname of the employee :	Sanjeet Vishwakarma.
3.	Father's or Husband's name :	Rampati Vishwakarma.
4.	Age and Sex :	Male 5.01.1991
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
5.	(a) Designation of the employee :	Volvo Driver.
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	O. C. P.
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	At - Kadiyar, po. Teekar, Dist - Sidhi (M.P)
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	3.03.15
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	N/A
12.	Mark of identification on the body :	A cut mark on his left eyebrow.
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Mr. Rampati Vishwakarma (father) Address, same as above.
14.	Token number and other particulars by which the employee may be identified :	202
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	Sanjeet Vishwakarma
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

"FORM- B"

[ See Rules 48 (3) 51, 77 and 77 A (2) ]



1.	Serial No./ Unique Man No.	17
2.	Name & Surname of the employee :	Laddu Kumar Prasad
3.	Father's or Husband's name :	Jogeshwar Yadav
4.	Age and Sex :	17/12/1986 Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	Machine Operator
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open Cast
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station :	Athill - Nansanda, P.O. - Nansanda, Dist - Nansanda, (Bihar) Nalanda.
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	09/04/15
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Cut mark on face
13.	Name, address, relationship of person to be informed in case of accident/ emergency :	Person to be informed Mb. No - 09661293783
14.	Token number and other particulars by which the employee may be identified :	17
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	Laddu Prasad
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3), 51, 77 and 77. A (2) ]



1. Serial No./ Unique Man No. :	176
2. Name & Surname of the employee :	Shi Mani madhushyam. Kar
3. Father's or Husband's name :	Shi Mani Karmshikha
4. Age and Sex :	29/09/1977 - Male
5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6. (a) Designation of the employee :	Supervisor
(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open cast
(c) Whether employment is permanent or temporary or casual :	Temporary
7. Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station :	14, Asha Apartment, OPP Jubilee Ground, Bankend, Godaumy Shri City, Shri Kachh Ghat, 370001
8. Date of commencement of employment :	
9. Date of first appointment, with the present owner :	5/06/15
10. Date of termination or leaving of employment :	
11. In case of adolescent reference to certificate of fitness grounded under section 40 :	
12. Mark of identification on the body :	
13. Name, address, relationship of person to be informed in case of accident/ emergency :	Person to be informed Brother M.N. 0909992620
14. Token number and other particulars by which the employee may be identified :	
15. Passport size photograph of the person employed :	
16. Signature or Thumb impression of the employee :	
17. Remarks :	

Signature of Register Keeper

Signature of Manager




132  
MAHALAXMI INFRA CONTRACT LTD  
"FORM- B"

[ See Rules 48 (3) 51. 77 and 77. A (2)]



1.	Serial No./ Unique Man No.	19
2.	Name & Surname of the employee.	Gagan Kumar Singh
3.	Father's or Husband's name	Alish Singh
4.	Age and Sex :	18th of July 1989 Male
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee	Supervisor
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	Open cast.
	(c) Whether employment is permanent or temporary or casual :	Temporary
7.	Home Address of the employee, giving Village, Post Office, Thana and District Railway Station :	At- Doga chipo, PS- Sonahwa Dist- Bhagalpur, Bihar
8.	Date of commencement of employment	
9.	Date of first appointment, with the present owner :	7.08.13.
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	
12.	Mark of identification on the body :	Cut mark on forehead
13.	Name, address, relationship of person to be informed in case of accident/emergency :	Person to be informed - Brother Po - Doga chipo, P.S - Sonahwa Dist - Bhagalpur, Bihar
14.	Token number and other particulars by which the employee may be identified :	19
15.	Passport size photograph of the person employed	
16.	Signature or Thumb impression of the employee :	
17.	Remarks :	गगन कुमार सिंह

  
Signature of Register Keeper

  
Signature of Manager





# MAHALAXMI INFRACONTRACT LTD.

"FORM-B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]



1. Serial No./ Unique Man No. : 192.
2. Name & Surname of the employee : Lally Khem.
3. Father's or Husband's name : Sathar Khem.
4. Age and Sex : 01-01-1980 - Male.
5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965 : Open Cast.
6. (a) Designation of the employee : S4 Porvi Bag.  
(b) Nature of employment (whether above or below ground. If any above ground whether in Open cast working or otherwise) : Open Cast  
(c) Whether employment is permanent or temporary or casual : Term Based.
7. Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station : Vill - Lilwar, P.O - Lilwar, P.S - Amliya, Dist - Bidki, State - M.P.
8. Date of commencement of employment :
9. Date of first appointment, with the present owner : 05.03.2015
10. Date of termination or leaving of employment :
11. In case of adolescent reference to certificate of fitness grounded under section 40 :
12. Mark of Identification on the body : Cut mark on Right leg.
13. Name, address, relationship of person to be informed in case of accident/emergency :
14. Token number and other particulars by which the employee may be identified : 192
15. Passport size photograph of the person employed :
16. Signature or Thumb impression of the employee :
17. Remarks : Noted

Signature of Register Keeper

Signature of Manager



# MAHARAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]

134

1. Serial No./ Unique Man No. : 201

2. Name & Surname of the employee : Bhim. Ram.

3. Father's or Husband's name : Antu. Ram.

4. Age and Sex : male. (15.08.1990)

5. No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965

6. (a) Designation of the employee : Volvo Driver.

(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) : O. C. P.

(c) Whether employment is permanent or temporary or casual : Temporary

7. Home Address of the employee, giving Village, Post Office, Thana and District. Railway Station : Att PO - Guitari Bandh. P/S - Karan Chat Sabar, Dis - Rohtas (Bihar)

8. Date of commencement of employment :

9. Date of first appointment, with the present owner : 4.05.15

10. Date of termination or leaving of employment :

11. In case of adolescent reference to certificate of fitness grounded under section 40 : N/A

12. Mark of identification on the body : A mole. mark on the palm.

13. Name, address, relationship of person to be informed in case of accident/ emergency : Mr. Antu. Ram (Father) address same as above.

14. Token number and other particulars by which the employee may be identified : 201

15. Passport size photograph of the person employed

16. Signature or Thumb impression of the employee : [Signature]

17. Remarks :

Signature of Register Keeper


Signature of Manager



# MAHALAXMI INFRA CONTRACT LTD.

## "FORM- B"

[ See Rules 48 (3) 51 77 and 77 A (2) ]

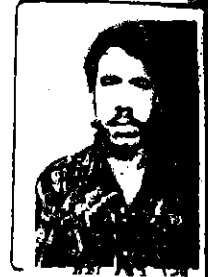

1.	Serial No./ Unique Man No. :	105
2.	Name & Surname of the employee :	Parvej Alam.
3.	Father's or Husband's name :	Samsud deha.
4.	Age and Sex :	male ( 1.01.1988 )
5.	No & date of the certificate if any, held under the Mines Vocational Training Rules, 1965	
6.	(a) Designation of the employee :	valve Driver.
	(b) Nature of employment (whether above or below ground, if any above ground whether in Open cast working or otherwise) :	O. C. P.
	(c) Whether employment is permanent or temporary or casual :	Temporary.
7.	Home Address of the employee, giving Village, Post Office, Thana and District, Railway Station :	At - Hinal, post-chainingada, p/s - patratu, Dis. Ramgarh (JH) Pin - 829103
8.	Date of commencement of employment :	
9.	Date of first appointment, with the present owner :	12.08.18
10.	Date of termination or leaving of employment :	
11.	In case of adolescent reference to certificate of fitness grounded under section 40 :	N/A
12.	Mark of identification on the body :	A cut mark in right foot.
13.	Name, address, relationship of person to be informed in case of accident/emergency :	Mr. Samsud deha (Father) address same as above.
14.	Token number and other particulars by which the employee may be identified :	105
15.	Passport size photograph of the person employed :	
16.	Signature or Thumb impression of the employee :	परवेज आलम
17.	Remarks :	

Signature of Register Keeper

Signature of Manager



महानगर काउंसिल ऑफ चियर मजदूरों के कोड

द. 1667/2016

10/03/12 17/03/12 17/03/12

ANNEXURE 11

स्टरैस बहा लैमी कन्स्ट्रक्शन लिड कार्पोरेशन  
एफसीएन एनए

17 प्रपत्र सं. 118

व सं. 26 (नियम 143)

प्राथमिकी (F.I.R.)

(दं. प्र. सं. की धारा 154 के अधीन)

संख्या JH  
17/03/12

092329

136

ला. 10/03/12 \*अनुमंडल (S. Div.) महागाम (P.S.) \*थाना ललमिया (Yr.) \*वर्ष 2016 \*प्राथमिकी सं. 104/16 तिथि 30-12-16 (F.I.R. No.) (Date)

\*अधिनियम (Act) भा. द. वि. \*धारण (Sections) 287/337/338/304A/31

\*अधिनियम (Act) \*धारण (Sections) 467/468/471/304

\*अधिनियम (Act) \*धारण (Sections) 302/303/304

\*अन्य अधिनियम एवं धारण (Other Acts and Sections) 86/92(5) mine Health and Safety Act - खनन कार्य के नियमों की अपेक्षा 1996

\*अपराध की घटना (Date of offence) 29-12-16 \*दिनांक (Day) 29-12-16 \*तिथि से (Date from) 29-12-16 \*तिथि तक (Date to)

आवधि (पहर) (Time period) 19-30 बजे \*बजे तक (Time to)

थाना से प्राप्त सूचना तिथि 30-12-2016 समय 13.45 बजे

प्राथमिकी दर्ज करने की तिथि 30-12-2016 समय 13.45 बजे

थाना दैनिकी संदर्भ-प्रविष्टि सं. समय

का प्रकार (Type of information) \*लिखित/मौखिक (Written/Oral) लिखित

स्थल- (क) थाना से दिशा एवं दूरी 6 कि.मी. दक्षिण पुरान गस्त सं.

\*पता (Address) ललमिया स्थित E.C.L. OPEN CAST खान जोड़म-भरण रोला  
CHP Coal Handling Plant के पास

थाना की सीमा से बाहर होने की दशा में थाना का नाम जिला- जोड़म जिला

दी/सूचना दाता :

नाम राजीव कुमार प्रखंड विकास पदाधिकारी  
पिता/पति का नाम

निर्गम तिथि (घ) राष्ट्रीयता भारतीय

निर्गम स्थान


जोड़म

प्रखंड विकास पदाधिकारी को भारीजेट, जोड़म







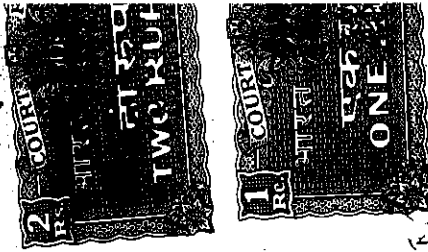

137

अनुसूची 47, प्रपत्र सं० 118

7. ज्ञात/संदिग्ध/अज्ञात अभियुक्त का विवरण (यदि आवश्यक हो तो अलग से पन्ना लगाएं)

महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा. लि. कंपनी के पदाधिकारियों एवं ई० सी० एल० के माईनिंग एवं खनन प्रबंधक एवं अज्ञात पदाधिकारियों

संदिग्ध व्यक्ति को शारीरिक विशेषताएँ, विरूपता तथा अन्य विवरण :-

*लिंग (Sex)	*जन्म-तिथि (तिथि/मास/वर्ष) Date of Birth (Date/Month/Year)	*शारीरिक गठन (Build)	*ऊँचाई से मी० में Height (in cms)	*वर्ण (Complexion)	*पहचान चिह्न (Identification mark)
1	2	3	4	5	6
	—	—	—	—	<p>(1867/16)</p> <p>1867/16</p> <p>30/12/16</p>

*विरूपता/विलक्षणता (Deformities/ peculiarities)	*दाँत (Teeth)	*बाल (Hair)	*आँख (Eye)	*आदतें (Habits)	पहनावा (Dress Habits)
7	8	9	10	11	12
	—	—	—	—	—

*भाषा/बोली (Language/ Dialect)	स्थान				
	*जले का निशान (Burn Mark)	*श्वेत कुष्ठ (Leucoderma)	*तिल (Mole)	*जखम चिह्न (Scar)	*गोदना (Tattoo)
13	14	15	16	17	18
	—	—	—	—	—

यदि परिवादी/इत्तिला देने वाले/पीड़ित व्यक्ति द्वारा संदिग्ध व्यक्ति के संबंध में कोई एक या अधिक विशिष्टताएँ दी जाएँ तभी इन में प्रविष्टियाँ की जाएंगी। इसका उपयोग अनुसन्धानक के सहायतार्थ केवल प्रारंभिक सुधार के प्रयोजन से ही किया जाएगा। इस प्रकार बनाए गए आंकड़े बाद में किसी संदिग्ध व्यक्ति को विभिन्न मामलों, यदि कोई हो, से जोड़ेगा। जब कोई अभियुक्त गिरफ्तार किया जाए तब पूर्व-संदेह पर विचार के किए बिना सभी बातों से संबंधित व्यापक और पूर्ण आंकड़े तैयार किए जाएंगे।





(138)

GR 14/67/116  
30/12/16

सेवा में

था0 प्र0 ललमतिया थाना ।

मैं राजीव कुमार बोआरीजोर प्रखण्ड, गोडा में प्रखण्ड विकास पदाधिकारी के पद पर सम्प्रति पदस्थापित हूँ। कल दिनांक 29.12.2016 को समय करीब संध्या 19:30 बजे सूचना मिली कि राजमहल परियोजना में ललमतिया स्थित ECL की Open Cast खान जो भोड़ा चरण टोला में CHP (Coal Handling Plant) के पास है, में महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा0लि0 गुजरात की कम्पनी द्वारा खनन किया जा रहा है। इस स्थान पर भू-धसान के कारण बहुत से पोकलेन, हाईवा तथा खनन कार्य में लगे मजदूर एवं कर्मचारी अंदर दब गये हैं। तत्पश्चात मैं अन्य वरीय पदाधिकारियों को सूचित करते हुए तथा राहत टीम को सूचना देते हुए घटनास्थल के लिए करीब 20:00 बजे प्रस्थान किया। जब घटनास्थल डीप माईनिंग जोन ललमतिया के पास पहुँचा तो देखा कि करीब आधा कि0मी में हाई सैंक के डम्पिंग के मिट्टी के खिसकने के कारण जबरदस्त भू-धसान हुआ है तथा जिसमें वहाँ पर कार्यरत पोकलेन, डम्पर इत्यादि वाहन के चालक तथा अन्य कर्मचारी जो कि महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा0लि0 कम्पनी में उस वक्त कार्यरत थे, वे सभी भू-धसान के कारण लगभग पचास से लेकर सौ फीट के अन्दर मिट्टी एवं पत्थर में दब गये हैं जिसका रात्रि में प्रयाप्त प्रकाश के अभाव के कारण कुछ पता नहीं चल पा रहा था। तथापि स्थानीय प्रशासन द्वारा राहत कार्य हेतु अपने स्तर से प्रयत्न किया गया। लेकिन रात्रि अधिक हो जाने एवं प्रकाश के नहीं रहने के कारण राहत दल द्वारा अधिक परिश्रम के पश्चात भी ज्यादा सफलता नहीं मिली। सुबह उजाला होने के पश्चात राहत कार्य जोर शोर से प्रारम्भ हुआ। राहत दल द्वारा मलवा हटाने के पश्चात ग्यारह अज्ञात शवों को मलवा से निकाला गया है जिसकी पहचान (1) मो0 शकील अहमद, पिता-मो0 मुनीस, उम्र-25 वर्ष, ग्राम-हनहट, थाना- कैरो (लोहरदग्गा) झारखण्ड। (2) हरिकिशोर यादव, पेसर-ददन यादव, उम्र करीब 26 वर्ष, सा0-बाबनागंज, थाना- धरौंधा, जिला- सीवान (बिहार)। (3) विकास पटेल, पे0-केवला प्रसाद पटेल, उम्र 25 वर्ष सा0-सोनवर्षा, थाना-अमलिया, जिला-सिद्धी (मध्य प्रदेश)। (4) जयप्रकाश राम, पे0-टोलाराम, उम्र करीब 33 वर्ष सा0-लालूछपरा, थाना- पारू, जिला- मुजफ्फरपुर, (बिहार)। (5) संजय कुमार शाही उर्फ भगत, पे0-सुजीत शाही, सा0-देवदरिया, उम्र 30 वर्ष जिला- लोहरदग्गा। (6) राजेन्द्र यादव उर्फ बोलता यादव पे0 रामनरेश यादव उम्र 28 वर्ष, ग्राम-पट्टी, थाना- महाराजगंज (सीवान) बिहार। (7) जावेद अख्तर, पे0-सजीमुद्दीन अंसारी, उम्र करीब 24 वर्ष सा0-परिहार जिला गढ़वा (झा)। (8) नागेश्वर पासवान, पे0-सखीचन पासवान उम्र 40 वर्ष सा0-मोहम्मदपुर, जिला- मुजफ्फरपुर (बिहार)। (9) ब्रजेश कुमार यादव, पे0-कमलदेव यादव उम्र 26 वर्ष ग्राम- जितौरा, थाना- राहतवार, जिला- बलिया (म0प्र)। (10) अजीत पटेल पे0 दिनेश प्रसाद पटेल उम्र 25 वर्ष सा0-लीलवास, थाना- अमलिया जिला- सिद्धी (म0प्र)। (11) मो0 नुरुल पे0-रफी मोहम्मद थाना- सहादुर उम्र 24 वर्ष जिला- रीवा (म0प्र) की गई है। स्थानीय लोगों ने बताया कि यहाँ पर अभी और पोकलेन, डम्पर आदि मलवा में दबे हुए हैं तथा कुछ शव भी अन्दर दबे होने की संभावना है।

जख्मी हेम नारायण यादव, माईनिंग सरदार एवं स्थानीय कार्यरत मजदूरों द्वारा बताया गया कि ई0सी0एल0 के पदाधिकारियों द्वारा खनन कार्य के मानकों की अवहेलना कर महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा0लि0 कम्पनी द्वारा बिना किसी सावधानी के लापरवही पूर्वक खनन का कार्य कराया जा रहा था जिससे यह घटना घटित हुई है। इस हादसा में अन्य और लोगों के मिट्टी में दबे होने की संभावना है। जख्मी हेम नारायण यादव, माईनिंग सरदार एवं स्थानीय लोगों का आरोप है कि महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा0लि0 कम्पनी द्वारा खनन नियमों एवं सुरक्षा मानकों का पालन नहीं किया गया है तथा ई0सी0एल0 के पदाधिकारियों द्वारा भी उचित रूप से देख रेख एवं कार्य पर नियंत्रण नहीं रखा गया है तथा लापरवाही बरती गई है जिस के कारण इतना बड़ा हादसा हुआ जिसमें जान एवं माल की क्षति हुई है।

अतः महालक्ष्मी इन्फ्रास्ट्रक्चर प्रा0लि0 कम्पनी के पदाधिकारियों एवं ई0सी0एल0 के माईनिंग एवं खनन प्रबंधक एवं अज्ञात पदाधिकारियों के विरुद्ध सुसंगत धाराओं में प्राथमिक दर्ज करने की कृपा की जाय।

Registered Lalmatia Ps Case no. 104/116  
30/12/2016 U/S 287/337/338/304 A/34 IPC

2 86/92(5) mine Health and Safety Act  
1996. I shall investigate this case.

Manohar Karmali  
30/12/16  
Lalmatia Ps

विश्वासभाजन

राजीव कुमार  
30/12/16

(राजीव कुमार)  
प्र0वि0 पदाधिकारी  
बोआरीजोर (गोडा)



(3)



139

अनुसूची 47, प्रपत्र सं० 118

8. परिवादी/सूचना दाता द्वारा सूचना देने में हुए विलंब का कारण : .....
9. चुरायी गई/अन्तर्ग्रस्त/बरामद सम्पत्तियों के व्योरे (यदि आवश्यक हो तो अलग से पन्ना लगायें) .....
10. \*चुराई गयी/अन्तर्ग्रस्त/बरामद सम्पत्तियों का कुल मूल्य (Total value of properties stolen/involved/recovered) .....
11. \*अस्वाभाविक मृत्यु कांड सं०, यदि हो तो (U.D. Case No., if any) .....
12. प्राथमिकी की अन्तर्वस्तु (अलग से पन्ना लगायें, यदि आवश्यक हो) .....





अनुसूची-47, प्रपत्र सं० 118




140

वादी का दंडित आवेदन जो इस तरह  
का मूल आवेदन है कि मूल प्रति  
मूल के साथ अन्य के साथ क्षमा  
प्रति साथ संलग्न है।

(1393)

मनोहर करमाली  
30-12-16  
62 भागा प्रभाटी  
22 लालमहिमाभागा  
13 = 60

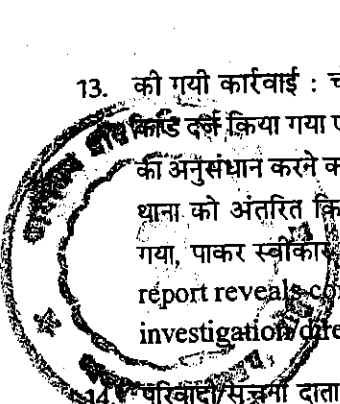

13. की गयी कार्रवाई : चूंकि उपर्युक्त सूचना से मद सं० 2 में उल्लिखित धाराओं के अन्तर्गत अपराध किया जाना प्रकट हुआ कि डि दर्ज किया गया एवं अनुसंधान प्रारम्भ किया\* संतोहर करमाली पदनाम पु० ५१० नि०  
की अनुसंधान करने का निर्देश दिया/अनुसंधान करने से इन्कार किया/आधिकारिता के प्रश्न पर  
थाना को अंतरित किया गया। प्राथमिकी परिवारी/सूचनादाता को पढ़कर सुनायी गयी। उसने उसे सही रूप में अभिलि  
गया, पाकर स्वीकार किया और उसकी एक प्रति परिवारी/सूचनादाता को निशुल्क दी गयी। (Action taken: Since  
report reveals commission of offence(s) u/s as mentioned at Item No. 2, registered the case and to  
investigation directed\* Rank to take up the investiga

14. परिवारी/सूचना दाता का हस्ताक्षर/अंगूठा का निशान।

15. थाना से न्यायालय में प्रेषण की तिथि एवं समय-

मनोहर करमाली  
30-12-16  
थाना प्रभारी का हस्ताक्षर

नाम (Name) मनोहर करमाली  
पदनाम (Designation) पु० ५१० नि०

17-03-17  
SP  
13





# ANNEXURE - 12

141

IN THE HIGH COURT OF JHARKHAND AT RANCHI

Cr. M.P. No. 738 of 2017

Pramod Kumar

Petitioner

Versus

The State of Jharkhand through the  
Superintendent of Police, Godda

Opposite Parties

CORAM: HON'BLE MR. JUSTICE RONGON MUKHOPADHYAY

For the Petitioner

: Mr. Anil Kumar Sinha, Sr. Advocate

Mr. Rajesh Lala, Advocate

Mr. Arpit Kumar, Advocate

For the State

: Mr. Shekhar Sinha, Advocate

Order No. 04

Dated 24<sup>th</sup> April, 2017

It has been stated by Mr. Anil Kumar Sinha, learned senior counsel for the petitioner that the petitioner is being prosecuted twice for same offence one being Lalmatia P.S. Case No. 104 of 2016 and Criminal Case No. CR/22 of 2017. Learned senior counsel further submits that the authority under the Mines Act can lodge a complaint against the petitioner, who is the Manager of Rajmahal Open Cast Project of M/s. Eastern Coalfields Limited. Learned senior counsel further submits that initially a case was instituted for non-bailable offence u/s 287, 337, 338, 304A and 34 I.P.C. and Section 86/92(5) of the Mines health and Safety Act, 1986, but subsequently on account of the mala fide action of the Investigating Officer Sections 467, 468, 471 and 304 I.P.C. were added to make the offence more serious and non-bailable. It has been further submitted that that learned Chief Judicial Magistrate, Godda without application of mind has straight away allowed the application filed by the Investigating Officer which led to adding of Sections 467, 468, 471 and 304 I.P.C. It has thus been submitted that the petitioner cannot be prosecuted twice for the same offence which would invite double jeopardy against the petitioner. It has further been submitted that no F.I.R. could have been instituted for the alleged offence against the petitioner by the Block Development Officer as a complaint case has duly been filed by the competent authority.

Mr. Shekhar Sinha, learned APP is directed to seek instruction and file counter affidavit within a period of four weeks.

List this case after four weeks.

Until further orders, there shall be no coercive action in connection with Lalmatia P.S. Case No. 104 of 2016 (G.R. No. 1667 of 2016), pending in the Court of learned Chief Judicial Magistrate, Godda.

Sd/- (Rongon Mukhopadhyay, J)

MK

Certified to be True Copy

6.5.17

Deputy Officer

Designated under Rule 293(N) of J.H.C. Rules  
Authorised U/S 76 Act of 1872

(The

16<sup>th</sup> Baishakh

6.5.17

1939  
6.05.17





Annexure-13

142

भारत सरकार GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

No.S3/Law/Prosecution/ROCP/ 718

Dated, Sitarampur the 05-04-2017.

From  
Director of Mines Safety,  
Sitarampur Region No.3, Eastern Zone, DGMS,  
Post: Sitarampur, District: Burdwan (WB).

To  
✓ The Chief Judicial Magistrate,  
At & Post: Godda, District: Godda (Jharkhand).

**Sub: Criminal Case against Sri Bholu Nath Shukla, Nominated Owner & Director Technical (Operation) and fifteen (15) others of M/s Eastern Coalfields Limited for contraventions of provisions which are punishable under section(s) 72A, 73, 70(1) & 72 C(1)(a) of the Mines Act, 1952.; and the accused are severally and vicariously liable for punishment.**

Sr,

In forwarding herewith a copy of the statement of case on the above subject, I request you to kindly take the cognizance of the offence.

The case will be conducted by Sri Mahesh Kumar Datta, Assistant Public Prosecutor (APP), Godda (Jharkhand).

Yours faithfully,

(Niranjan Sharma)  
Inspector of Mines

Also Designated as Director of Mines Safety  
Sitarampur Region No.3, EZ, DGMS  
Sitarampur, Dist. Burdwan (WB)

Encl: As above.

Director of Mines Safety  
Ministry of Labour & Employment  
Govt. of India  
Region No.3 (EZ), Sitarampur



IN THE HONOURABLE COURT OF CHIEF JUDICIAL MAGISTRATE AT GODDA,  
DISTRICT - GODDA (JHARKHAND)

Criminal Case No. CR/ \_\_\_\_\_ /2017/ \_\_\_\_\_

Between  
The State (Govt. of India) represented  
by the Inspector of Mines, now  
designated as Director of Mines Safety

COMPLAINANT

Vs

1. Sri Bhole Nath Shukla, Nominated Owner and Director Technical (Operation), M/s Eastern Coalfields Limited.
2. Sri Sanjay Kumar Singh, Agent and General Manager (In-charge), Rajmahal Area, M/s Eastern Coalfields Limited.
3. Sri Devendra Kumar Nayak, Agent and General Manager (Operation), Rajmahal OCP, M/s Eastern Coalfields Limited.
4. Sri Pramod Kumar, Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
5. Sri Devendra Kumar Sinha, Engineer and Chief Manager (Excavation), Rajmahal OCP, M/s Eastern Coalfields Limited.
6. Sri Vinay Prakash Singh, Engineer also Senior Manager (E&M), Rajmahal OCP, M/s Eastern Coalfields Limited.
7. Sri Dilip Roy, Assistant Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
8. Sri Vijay Kumar Singh, Assistant Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
9. Sri Rajat Kumar Singh, Assistant Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
10. Sri Padma Charan Dhar, Assistant Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
11. Sri Neeta Sinha, Assistant Manager, Rajmahal OCP, M/s Eastern Coalfields Limited.
12. Sri Sudh Prasad Barwal, Safety Officer, Rajmahal OCP, M/s Eastern Coalfields Limited.
13. Sri Dandodhar Ram, Surveyor, Rajmahal OCP, M/s Eastern Coalfields Limited.
14. Sri Nandan Kumar, Surveyor, Rajmahal OCP, M/s Eastern Coalfields Limited.
15. Sri Sany Kumar, Overman, Rajmahal OCP, M/s Eastern Coalfields Limited.
16. Md. Buz Hussain Ansari, Mining Sirdar, Rajmahal OCP, M/s Eastern Coalfields Limited.

Complaint petition filed by and on behalf of the above complainant, a public servant under the provisions of the Section 200(a) of the Code of Criminal Procedure, for trial of offence under Section 22A, 73, 70(1) & 72 C(1)(a) of the Mines Act, 1952, shows as follows:



(144)

**NAME(S), OTHER PARTICULARS AND ADDRESSES OF THE ACCUSED:**

1. Sri Bholu Nath Shukla S/o Late Kamta Prasad Shukla, age about 57 years, Nominated Owner/Director Technical (Operation), M/s Eastern Coalfields Limited; Sanctoria, PO: Dishergarh-713333, District: Burdwan (WB). Permanent address: Village-Nagwasi, Post: Dugauli-231313, District-Mirzapur (UP).
2. Sri Sanjay Kumar Singh S/o Sri Indradeo Prasad Singh, age about 53 years, Agent & General Manager (In-charge), Rajmahal Area, M/s Eastern Coalfields Limited; PO: Lalmatia-814165, District: Godda (Jharkhand), Permanent address: Village: L-28, Jagat Vihar, Post: Ashiana Nagar-800025, District: Patna (Bihar).
3. Sri Debendra Kumar Nayak S/o Late Maheswar Nayak, age about 53 yrs., Agent/General Manager (Operation), Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At & Village-Mathakaragola, PO: Mathakaragola-759024, PS: Kamakhyanaga, District: Dhenkanal (Odisha).
4. Sri Pramod Kumar S/o Sri Shivanandan Singh, age about 52 years, Manager, Rajmahal OCP, C/o Agent/General Manager (Operation), Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, Dist.: Godda (Jharkhand). Permanent address: Village-Dinachakla, PO: Dinachakla - 851212, PS: Pasraha, District: Khagaria (Bihar).
5. Sri Devendra Kumar Sinha S/o Late Dr. D.K. Sinha, age about 59 years, Chief Manager (Excavation)/Engineer, Rajmahal OCP Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village-Panari, PO: Panari-824233, PS: Bela, District: Gaya (Bihar).
6. Sri Vinay Prakash Singh S/o Sri Bhuwaneswar Prasad, age about 59 years, Senior Manager (E&M)/Engineer, Rajmahal OCP Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Flat No.303, Preeto Enclave, Village-Chandani Chowk, PO: Shastri Nagar-834008, PS: Gonda, District: Ranchi (Jharkhand).
7. Sri Dilip Roy S/o Sri Chandra Shekhar Roy, age about 46 years, Assistant Manager, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At & Village-Deokhuli Dham, PO: Deokhuli Dham-848209, PS: Beroul, District: Darbhanga (Bihar).
8. Sri Vijay Kumar Singh S/o Sri Lallu Singh, age about 43 years, Assistant Manager, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At & Village-Manikadhi, PO: Chandesar-276128, PS: Sidhari, District: Azamgarh (UP).
9. Sri Ranjit Kumar Singh S/o Late Andolan Prasad Singh, age about 50 years, Assistant Manager, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At & Village-Shuda, PO: Shuda-813207, PS: Fullidumar, District: Banka (Bihar).
10. Sri Padma Charan Dhar S/o Late Maheshwar Dhar, age about 52 years, Assistant Manager, Rajmahal OCP Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At & Village-Paniola, PO: Balramprasad-759128, PS: Banarpal, District: Angul (Odisha).





45

11. Sri Neeraj Kumar Sinha S/o Sri Chandra Shekhar Prasad, age about 49 years, Assistant Manager, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: At-Nala Road, Patna, PO: Nala Road-800004, PS: Nala Road, Patna, District: Patna (Bihar).
12. Sri Sudhir Prasad Barnwal S/o Late Datt Modi, age about 55 years, Safety Officer, Rajmahal OCP, C/o Agent/General Manager (Operation), Rajmahal OCP Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village-Markacho, Post: Markacho-825318, PS: Markacho, District: Kodarma (Jharkhand).
13. Sri Damodar Ram S/o Late Neel Kant Ram, age about 52 years, Surveyor, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village-Tilokari, PO: Sharmatand-825324, PS: Jaynagar, District-Kodarma (Jharkhand).
14. Sri Nandan Kumar S/o Shri Oncamath, age about 41 years, Surveyor, Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village-Sahebpur Kamal, PO: Sahebpur Kamal-851217, PS: Sahebpur Kamal, District: Begusarai (Bihar).
15. Sri Suraj Kumar S/o Late Yadunandan Prasad, age about 42 years, Overman Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village-Akbar Bigha, PO: Ramjanpur-811101, PS: Barbigha, District: Sheikhpura (Bihar).
16. Md. Ejaz Hussain Ansari, S/o Late Md. Fida Hussain Ansari, age about 27 years, Mining Slidar Rajmahal OCP, Rajmahal Area, M/s ECL, PO: Lalmatia-814165, District: Godda (Jharkhand). Permanent address: Village: Ena Islampur, C/o A.S. Medical, PO: Bhagatdih-828111, PS: Jharia, District: Dhanbad (Jharkhand).

## II. NAME & SITUATION OF THE MINE:

A	Name of the Mine	Rajmahal OCP
B	Village/Mouza	Lalmatia
C	Post Office	Lalmatia
D	Police Station	Lalmatia
E	Sub-Division	Mahagama
F	District	Godda
G	State	Jharkhand

## III.

### (1) DATE, PLACE AND TIME OF OCCURRENCE:

On 29.12.2016 at 07:00pm, Overburden dump of Rajmahal Opencast Project, M/s Eastern Coalfields Limited, District: Godda (Jharkhand).

### (2) DATE WHEN THE OFFENCE CAME TO THE KNOWLEDGE OF THE INSPECTOR:

On 29.12.2016 at 9:35pm



(46)

**PARTICULARS OF THE ACCUSED:** At the relevant period during which the offence was committed, accused No.1, Sri Bhola Nath Shukla, Nominated Owner and Director Technical (Operation); accused No.2, Sri Sanjay Kumar Singh, Agent & General Manager (In-charge), Rajmahal Area, M/s ECL; accused No.3, Sri Debendra Kumar Nayak, Agent & General Manager (Operation), Rajmahal OCP; accused No.4, Sri Pramod Kumar, Manager, Rajmahal OCP; accused No.5, Sri Devendra Kumar Sinha, Engineer also Chief Manager (Excavation), Rajmahal OCP; accused No.6, Sri Vinay Prakash Singh, Engineer also Senior Manager (E&M), Rajmahal OCP; accused No.7, Sri Dilip Roy, Assistant Manager, Rajmahal OCP; accused No.8, Sri Vijay Kumar Singh, Assistant Manager, Rajmahal OCP; accused No.9, Sri Ranjit Kumar Singh, Assistant manager, Rajmahal OCP; accused No.10, Sri Padma Charan Dhar, Assistant Manager, Rajmahal OCP; accused No.11, Sri Neeraj Sinha, Assistant Manager, Rajmahal OCP; accused No.12, Sri Sudhir Prasad Barnwal, Safety Officer, Rajmahal OCP; accused No.13, Sri Damodar Ram, Surveyor, Rajmahal OCP; accused No.14, Sri Nandan Kumar, Surveyor, Rajmahal OCP; accused No. 15, Sri Sujay Kumar, Overman, Rajmahal OCP; accused No.16, Md. Ejaz Hussain Ansari, Mining Sirdar, Rajmahal OCP; and they were bound to conduct all mining operations and also to see that these are conducted strictly in accordance with the provisions of the Mines Act, 1952 and the Rules, Regulations & Orders made hereunder.

**V. PARTICULARS AND NATURE OF THE OFFENCE:** A major accident had occurred in Rajmahal OCP of M/s Eastern Coalfields Limited on 29.12.2016 at about 07:00pm. Sri Sanjay Kumar Singh, the General manager (In-charge), Rajmahal Area, M/s ECL had informed Sh. Niranjana Sharma, Director of Mines Safety, Region No.3, Sitarampur about the accident over telephone on 29.12.2016 at about 09:35pm. On receiving information of fatal accident Sri Niranjana Sharma, Director of Mines Safety, Region No.3, Eastern Zone, Directorate General of Mines Safety (DGMS), Sitarampur (also appointed as an Inspector of Mines under Section 5(1) of the Mines Act, 1952) made an inspection of above mine on 30.12.2016 accompanied by Md. Niyazi, Dy. Director of Mines Safety, Sitarampur Region No.3, DGMS, EZ, Sitarampur, to enquire into the cause and circumstances, leading to the accident.

Sh. Niranjana Sharma, Director of Mines Safety, Region No.3, Sitarampur has also been appointed as Inspector of Mines under Section 5(1) of the Mines Act, 1952. His Gazette Notification has been published in the Gazette of India, part-II, Section 3, Sub-Section (II) dated 23<sup>rd</sup> November, 1991 bearing S.O.No.2937 dated 4<sup>th</sup> November, 1991 which is reproduced below:-

"In exercise of the powers conferred by sub-section (1) of section 5 of the Mines Act, 1952 (35 of 1952), the Central Government hereby appoints Sri Niranjana Sharma as Inspector of Mines subordinate to the Chief Inspector of Mines, until further orders"

On 30.12.2016, a committee consisted of five DGMS officials was constituted by the Director General of Mines Safety, Dhanbad under the chairmanship of Sri Utpal Saha, Dy. Director General of Mines Safety, Eastern Zone, Sitarampur vide office order No.2-20025/4/2016/MAMID/1186 dated 30.12.2016, the copy of which is annexed with the complaint petition. The said committee made inspection and enquiry on 30.12.2016, 31.12.2016, 01.01.2017 to 14.01.2017.

During the course of inspection and enquiry it was revealed that-



147

"While contractual workers and machineries were deployed to form benches in dumped overburden, in-situ overburden and coal in an Opencast Mine containing known geological disturbances; cracks developed due to dead weight of dumped overburden, deep-hole blasting and repeated plying of HEMMs, resulting into violent failure of in-situ overburden and coal benches, followed by instant sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs."

During the aforesaid inspections and enquiries the following violations were found which caused the said accident;

1. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1 and 5.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987 issued under the Regulation, the accused No.1 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in overburden and coal should have been kept sloped to prevent danger from fall of sides. He also failed to ensure the slope of spoil bank face by natural angle of repose i.e. 37.5° and undertake a scientific study, prior to commencement of work in this patch, he also failed to intimate DGMS, in Form-I when the premature collapse of benches occurred on 09.8.2016 & 23.12.2016, thereby not carrying out mining operations in accordance with the provisions of the statute as required under Section 18(4) of the Mines Act, 1952, Regulation 9(1)(a)(viii) of the Coal Mines Regulations, 1957 read with Sec.23(1)(c) of the Mines Act, 1952.
2. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1 and 5.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987 issued under the Regulation, the accused No.2 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides. He also failed to ensure the slope of spoil bank face by natural angle of repose i.e. 37.5° and undertake a scientific study, prior to commencement of work in this patch, he also failed to intimate DGMS in Form-I when the premature collapse of benches occurred on 09.8.2016 & 23.12.2016, thereby not carrying out mining operations in accordance with the provisions of the statute as required under Section 18(4) and 2(c) of the Mines Act, 1952 as well as regulation 8A(3) and 9(1)(a)(viii) of the Coal Mines Regulations, 1957 read with Sec.23(1)(c) of the Mines Act, 1952.
3. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1 and 5.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987, the accused No.3 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides. He also failed to ensure the slope of spoil bank face by natural angle of repose i.e. 37.5° and undertake a scientific study, prior to commencement of work in this patch, he also failed to intimate DGMS in Form-I when the premature collapse of benches occurred on 09.8.2016 & 23.12.2016, thereby not carrying out mining operations in accordance with the provisions of the statute as required under Section 18(4) and 2(c) of the Mines Act, 1952, Regulation 9(1)(a)(viii) of the Coal Mines Regulations, 1957 read with Sec.23(1)(c) of the Mines Act, 1952 and 8A(3) of the Coal Mines Regulations, 1957.



- 148
4. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1 and 5.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987, the accused No.4 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides. He also failed to ensure the slope of spoil bank face by natural angle of repose i.e.  $37.5^\circ$  and undertake a scientific study, prior to commencement of work in this patch, he also failed to intimate DGMS in Form-I when the premature collapse of benches occurred on 09.8.2016 & 23.12.2016, thereby not carrying out mining operations in accordance with the provisions of the statute as required under Section 17(2) & 18(4) of the Mines Act, 1952 and Regulation 9(1)(a)(viii) of the Coal Mines Regulations, 1957 read with Sec. 23(1)(c) of the Mines Act, 1952 and Regulation 41 of the Coal Mines Regulations, 1957.
  5. In contraventions of Regulations 50(a) & (d) of the Coal Mines Regulations, 1957 and Regulation 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.14.1 of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987, the accused Nos. 5 & 6 failed to ensure safe workings of the HEMM deployed at Dahemangi Patch of Rajmahal OCP as required under the statute.
  6. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1, 5.1.2 and 9.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987, the accused Nos.7, 8, 9, 10 and 11 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides. They also failed to ensure the slope of spoil bank face by natural angle of repose i.e.  $37.5^\circ$  and undertake a scientific study, prior to commencement of work in this patch, thereby not carrying out mining operations in accordance with the provisions of the statute i.e. Regulation 42 of the Coal Mines Regulations, 1957.
  7. In contraventions of Regulations 98(1) & (3) of the Coal Mines Regulations, 1957 read with clause Nos.3.4, 3.6, 5.1.1 and 5.1.2 of the annexure of the permission letter No.S4/03/26/006/II-B/87/1182 dated 08.04.1987, this accused No.12 failed to take special care while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides. He also failed to apprise the manager of all possible sources of danger in the mine as required under the statute i.e. 41A(1)(b)(iii), (f) & (h) of the Coal Mines Regulations, 1957.
  8. In contraventions of Regulations 49(1)(a) & (2)(a) of the Coal Mines Regulations, 1957, the accused Nos.13 & 14 failed to record the facts of workings of the mine approaching within 75m of disused workings (waste dump) and maintain accurate plans & section indicating side fall that had occurred time to time.
  9. In contraventions of Regulations 43(1)(a) & (6) of the Coal Mines Regulations, 1957, the accused No.15 failed to report continued unsafe condition of the mine workings, remove danger observed and enforce the provisions of the Act, Regulations and Orders made thereunder and to secure safety of the persons employed therein.





10. In contraventions of Regulations 44(1)(b) & (6)(a) of the Coal Mines Regulations, 1957, the accused No.16 failed to observe dangerous place in the patch and also failed to withdraw persons from there by putting a fence to prevent persons from inadvertently entering dangerous place.

The above contraventions constitute offences which are punishable under section(s) 72A, 73 and 70(1) of the Mines Act, 1952; and the accused are severally and vicariously liable for punishment.

As above contraventions resulted in loss of lives of 23 persons, namely (1) Hari Kishore Yadav, Excavator Operator, (2) Javed Akhtar, Excavator Operator, (3) Rajendra Yadav, Excavator Operator, (4) Brijesh Yadav, Excavator Operator, (5) Sanjay Kumar Sahi, Tipper Driver, (6) Mohd. Noorul, Tipper Driver, (7) Jay Prakash Rai, Tipper Driver, (8) Nageshwar Paswan, Tipper Driver, (9) Ajeet Patel, Excavator Operator, (10) Shakil Khan, Tipper Driver, (11) Vikash Patel, Tipper Driver, (12) Sunil Bhengra, Tipper Driver, (13) Kuleshwar Kumar Alias Ajay Kushwaha, Dozer Operator, (14) Julfkar Mohammad, Tipper Driver, (15) Jameer Mohammad, Tipper Driver, (16) Raj Kamal Goswami, Tipper Driver, (17) Sanjeet Vishwakarma, Tipper Driver, (18) Laddu Prasad (Yadav), Excavator Operator, (19) Lallu Khan, Supervisor, (20) S. Madhur Shyam Patel, Supervisor, (21) Gagan (Kumar) Singh, Supervisor, (22) Parwey Alam, Tipper Driver, (23) Bhim Ram, Tipper Driver and loss of 18 Heavy Earth Moving Machinery (HEMMs); hence, all the accused persons are also severally and vicariously liable for punishment under Section 72C(1)(a) of the Mines Act, 1952.

- VI. It is, therefore, prayed that the Hon'ble Court may be pleased to put the above accused on trial for the aforesaid offences or for any other offence or offences which may be disclosed during the trial and punish them suitably according to Law.
- VII. The complainant is a public servant and as such it would be difficult for him to attend your Hon'ble Court for every adjournment of this case without detriment to his other official duties. It is, therefore, prayed that his absence may be condoned and he be exempted from personally attending the court unless so directed by the court.
- VIII. The complainant is authorized by the Chief Inspector of Mines also designated as Director-General of Mines Safety under Section 75 of the Mines Act, 1952 to institute prosecution on his behalf by Gazette Notification, PART III-SEC-1, dated 09<sup>th</sup> November 2013. The extract of Gazette notification is reproduced as following:



**MINISTRY OF LABOUR & EMPLOYMENT  
(DIRECTORATE-GENERAL OF MINES SAFETY)**

**Dhanbad, the 11<sup>th</sup> October 2013**

"No. Law/G-22/13— I, Rahul Guha, Chief Inspector of Mines and also designated as Director-General of Mines Safety, by virtue of powers conferred on me under Section 75 of the Mines Act, 1952 (35 of 1952) and in suppression of all the notifications published earlier in the Gazette of India on the subject, do hereby, generally authorize all officers of this Directorate who are sub-ordinate to the Chief Inspector of Mines and who are appointed as Inspector of Mines under Sub-section (1) of the Section 5 of the said Act, to institute prosecutions for any offence under the said Act, against the owner, agent or manager of any mine situated within their respective Inspection jurisdiction as declared under sub-section (3) of Section 6 of the Said Act."

**RAHUL GUHA**

Chief Inspector of Mines and  
Director-General of Mines Safety

IX. I, the complainant of the instant petition, am satisfied that the aforesaid cited accused had failed to exercise all due diligence to prevent the commission of offences mentioned above, hence they are liable for punishment in accordance with law.

X. That all the accused persons have conjointly committed the offences so alleged to have been committed by them in connivance with each others.

XI. **NAMES AND OTHER PARTICULARS OF THE WITNESS PROPOSED TO BE EXAMINED FOR THE PROSECUTION ARE GIVEN BELOW:**

1. Sh. Niranjan Sharma, Director of Mines Safety, Sitarampur Region No.3, PO: Sitarampur-713359, District: Burdwan (West Bengal).
2. Sri Utpal Saha, Dy. Director General of Mines Safety, DGMS, Eastern Zone, PO: Sitarampur-713359, District: Burdwan (West Bengal).
3. Sri V. Lakshmi Narayana, Director of Mines Safety/SO, DGMS, Eastern Zone, PO: Sitarampur-713359, District: Burdwan (West Bengal).
4. Md. Niyaz, Dy. Director of Mines Safety, Sitarampur Region No.3, DGMS, Eastern Zone, PO: Sitarampur-713359, District: Burdwan (West Bengal).
5. Sri Sudhir G. Bhalsare, Dy. Director of Mines Safety (Mechanical), DGMS, Eastern Zone, PO: Sitarampur-713359, District: Burdwan (West Bengal).
6. Sri I. Satyanarayana, Dy. Director of Mines Safety, DGMS HQ, PO: Dhanbad-826001, District: Dhanbad (Jharkhand).
7. Sri K. Gyaneshwar, Dy. Director of Mines Safety, DGMS HQ, PO: Dhanbad-826001, District: Dhanbad (Jharkhand).
8. Sri Kamleswar Prasad S/o Sri Thal Mahato, Tipper Driver, M/s MIPL, Village: Khutra, PO: Ichak, District: Hazaribagh (Jharkhand).
9. Sri Chandrika Prasad Tiwari, S/o B.P. Tiwari, Supervisor, M/s MIPL, Village: North-Jhagrahand, Dafal No.3, PO: North Jhagrahand-497446, District: Koriya (Chhattisgarh).
10. Sri Munna Pandit S/o Late R.K. Pandit, Mining Sirdar, M/s ECL, Village: Bagfort, PO: Lalmaia, District: Godda (Jharkhand).




- (56)
11. Sri K.K. Upadaya S/o Late R.S. Upadaya, Supervisor, M/s MIPL, Village: Korsar, PO: Korsar, District: Singrauli (MP).
  12. Sri B.P. Rai S/o Dharmo Rai, Magazine Clerk, M/s ECL, Village: Malmendro, PO: Malmendro, District: Godda (Jharkhand).
  13. Sri Bimal Kumar Soren S/o Eswar Soren, Magazine Clerk, M/s ECL, Village: Chhota Simra, PO: Bada Simra, District: Godda (Jharkhand).
  14. Sri Ramachandra Pandit S/o Relu Pandit, Supervisor, M/s MIPL-NKAS, Village: Chhota Simra, PO: Bada Simra, District: Godda (Jharkhand).
  15. Sri Panchanad Mishra S/o Late Madhavanad Mishra, Mining Sirdar, M/s ECL, Village: Pakartalla, PO: Kahalgolan, District: Bhagalpur (Bihar).
  16. Sri Prason Kujur S/o J. Kujur, Sr. Overman, M/s ECL, Village: Prem Nagar, PO: Kanke, Ranchi-6 (Jharkhand).
  17. Sri Naresh Prasad S/o Late Jagadev Mahto, Blasting Officer, M/s ECL, Village: Dharampur, PO: Uttarhu, District: Nalanda (Bihar).
  18. Sri Santosh Pandit S/o Muni Pandit, Excavator Operator, M/s MIPL-NKAS, Village: Chandwaragolda, PO: Gomo Barwadi, District: Kodarma (Jharkhand).
  19. Sri Rajesh Patel S/o Jayanti Lal Patel, Supervisor, M/s MIPL-NKAS, Village: Bhayadar, PO: Upleta, District: Rajkot (Gujarat).
  20. Sri Sudheer Prasad Singh S/o R.P. Singh, Asst. Manager Blasting, M/s ECL, Village: Narayanpur, PO: Sultanganj, District: Bhagalpur (Bihar).
  21. Sri Dinesh Yadav S/o Santosh Yadav, Excavator Operator, M/s MIPL-NKAS, Village: Sonepura, PO: Selhara, District: Hazaribagh (Jharkhand).
  22. Sri Goutam Kumar S/o Biswapati Das, Mining Sardar, M/s ECL, Village: Khuttabandh, PO: Jammunhya, District: Deoghar (Jharkhand).
  23. Sri Nilam Toppo S/o Late Vincent Toppo, Overman, M/s ECL, Village: Samlong, PO: Namkum, Ranchi (Jharkhand).
  24. Sri Aravind Kumar S/o Badri Sundi, Overman, M/s ECL, Village: Dhangadhi, PO: Ghorangl, District: Giridih (Jharkhand).
  25. Sri Bibhas Chandra Maji S/o Late Tara Shankar Maji, Chief Manager Mining, M/s MIPL-NKAS, Village: Triveni Block-D, Asansol, District: Burdwan (WB).
  26. Sri B. S. Chakraborty S/o Late B.N. Chakraborty, Overman & Workmens Inspector, M/s ECL, Village: Finture, PO: Dhrubabati, District: Birbhum (WB).
  27. Sri Krishna Goswami S/o Govind Prasad Goswami, Jeep Driver, M/s MIPL-NKAS, Village & PO: Hinuti-486670, District: Sidhi (MP).
  28. Sri Kumar Valbhav Singh S/o Samanadhi Singh, Liaison Officer, M/s MIPL-NKAS, Village: Banmankhi - 8542021, District: Purnia (Bihar).
  29. Sri Suraj Kumar Mahato S/o Santosh Kumar Mahato, Overman, M/s ECL, Village: Madhukarpur, PO: Chandipur, District: Bokaro (Jharkhand).
  30. Sri A. K. Sinha S/o Kameswar Prasad Lala, Overman/WI, M/s ECL, Village: Jodry, PO: Khiriyawan, District: Aurangabad (Bihar).
  31. Sri Aravind Kumar Ramji Patel S/o Ramji Premji Patel, Camp Coordinator, M/s MIPL-NKAS, Village: Madhapar, PO: Mangwana, District: Kutch-Bhuj (Gujarat).
  32. Sri K. K. Upadaya S/o R.P. Upadaya, Sr. Overman, M/s ECL, Village: Golra, PO: Ranchua, District: Banka (Bihar).
  33. Sri B. K. P. Sharma S/o Late M. Sharma, Overman, M/s ECL, Village: Chota Kairawli, PO: Hathwa, District: Gopalganj (Bihar).



- (52) (10)
34. Sri S.P. Verma S/o F.P. Verma, Area Safety Officer, M/s ECL, Village: Madhuwan-dariyapur, PO: Haweli Karaghpur, District: Munger (Bihar).
  35. Sri Hem Narayan Yadav S/o Late. H.N. Yadav, Mining Sirdar, M/s ECL, Village: Navadi, PO: Suiyla, District: Baka (Bihar).
  36. Sri Mahendra Mal S/o Jhaprumal, Asst. Foreman (E&M), M/s ECL, Village: Badasimra, PO: Badasimra, District: Godda (Jharkhand).
  37. Sri Jay Narayan Ravidas S/o Jagan Nath Ravidas, Pump Khalasi, M/s ECL, Village: Mahagama, PO: Mahagama, District: Godda (Jharkhand).
  38. Sri Patel Mayank Kumar S/o Amrut Bhal, Attendance Clerk, M/s MIPL-NKAS, Village: Kanbha, PO: Kanbha, District: Ahmedabad (Gujarat).
  39. Sri Sadan Dhibar S/o Late S.C. Dhibar, Area Survey Officer, M/s ECL, Village: Ballavpur, PO: Ballavpur, District: Burdwan (WB).
  40. Dr. Md. Naveed Akthar S/o Md. Shiddiqe Ahmed, Medical Officer, Sadar Hospital, PO: Godda, District: Godda (Jharkhand).
  41. Sri Sushanta Banerjee S/o Late Sudhakar Banerjee, G.M. (Safety & Rescue), M/s ECL, Apcar Garden, Asansol, District: Burdwan (WB).
  42. Sri Aswani Kumar Rao S/o Shiv Kumar Rao, Office Clerk, M/s MIPL-NKAS, Village: Tarkulwa, PO: Kushinagar, District: Kushinagar (UP).
  43. Any other witness or witnesses who may be required at the time of evidence.

Complainant

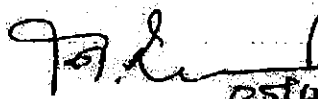  
 05/4/2017  
 (NIRANJANA SHARMA)  
 INSPECTOR OF MINES

ALSO DESIGNATED AS DIRECTOR OF MINES SAFETY  
SITARAMPUR, REGION NO.3

Director of Mines Safety  
 Ministry of Coal / Govt. of India  
 1st Floor, 2 (E-3) Sitarampur  
 Region No.3 (E-3) Sitarampur

I solemnly state that the above facts are true to the best of my knowledge and information.

Complainant

  
 05/4/2017  
 (NIRANJANA SHARMA)  
 INSPECTOR OF MINES

ALSO DESIGNATED AS DIRECTOR OF MINES SAFETY  
SITARAMPUR, REGION NO.3


Director of Mines Safety  
 Ministry of Coal / Govt. of India  
 1st Floor, 2 (E-3) Sitarampur  
 Region No.3 (E-3) Sitarampur

Date: 05/4/2017





158

THE GOVERNMENT OF INDIA  
MINISTRY OF DEFENSE  
NOTIFICATION  
REGISTERED NO. D. (N) 15/30  
SH. N. Sharma  
SH. Sahu ch. P. 4527  
  
**भारत गजेट**  
**The Gazette of India**  
PUBLISHED BY AUTHORITY  
No. 271  
SATURDAY, NOVEMBER 27, 1921  
AGRAHAYASA





154

[The main body of the document is a large, dark, and heavily degraded area containing illegible text. It appears to be a scan of a document page that has been almost entirely obscured by noise or damage.]



[भारत का राजपत्र, भाग III—खण्ड 1, दिनांक 9 नवम्बर 2013 से उद्घरण]

श्रम एवं रोजगार मंत्रालय

(खान सुरक्षा महानिदेशालय)

धनबाद, दिनांक 11 अक्टूबर 2013

सं. विमि/जो-22/13--में राहुल गुहा, जो मुख्य खान निरीक्षक और खान सुरक्षा महानिदेशक के रूप में भी पदाभिहित हैं, खान अधिनियम, 1952 (1952 का 35) की धारा 75 के अधीन मुझे प्रदत्त शक्तियों के आधार पर और इस विषय पर पूर्ववर्ती अधिसूचनाओं की अधिकांत करते हुए, इस निदेशालय के सभी अधिकारियों को, जो मुख्य खान निरीक्षक के अधीनस्थ हैं और खान अधिनियम की धारा 3 की उपधारा (1) के अधीन खान निरीक्षक के रूप में नियुक्त किए जाते हैं, उनको सम्बन्धित निरीक्षक अधिकारियों के भीतर जो उक्त अधिनियम की धारा 6 की उपधारा (3) के अधीन घोषित की गई है किसी भी खान के स्वामी, अधिकारी या प्रबंधक के विरुद्ध उक्त अधिनियम के अधीन किसी अपराध के लिए अभियोजन संस्थित करने के लिए साधारण प्राधिकृत करता हूँ।

राहुल गुहा  
मुख्य खान निरीक्षक और  
खान सुरक्षा महानिदेशक

[EXTRACT FROM THE GAZETTE OF INDIA, PART III—SEC. 1, dated 9th November 2013]

MINISTRY OF LABOUR & EMPLOYMENT

(DIRECTORATE GENERAL OF MINES SAFETY)


Dhanbad, the 11th October 2013

No. Law/G-22/13—I, Rahul Guha, Chief Inspector of Mines and also designated as Director General of Mines Safety, by virtue of powers conferred on me under Section 75 of the Mines Act, 1952 (35 of 1952) and in supersession of all the notifications published earlier in the Gazette of India on the subject, do hereby, generally authorize all officers of this Directorate who are sub-ordinate to the Chief Inspector of Mines and who are appointed as Inspectors of Mines under Sub-Section (1) of the Section 3 of the said Act, to institute prosecutions for any offence under the said Act, against the owner, agent or manager of any mine situated within their respective inspection jurisdiction as declared under Sub-Section (3) of Section 6 of the said Act.

RAHUL GUHA  
Chief Inspector of Mines and  
Director General of Mines Safety


मुद्रण निदेशालय द्वारा, भारत सरकार, मुद्रणालय, लखनऊ में मुद्रित  
एवं प्रकाशन विभाग, दिल्ली द्वारा प्रकाशित, 2013  
PRINTED BY DIRECTORATE OF PRINTING AT GOVERNMENT OF INDIA PRESS,  
NEW DELHI AND PUBLISHED BY THE CONTROLLER OF PUBLICATIONS, DELHI, 2013  
www.dgms.gov.in



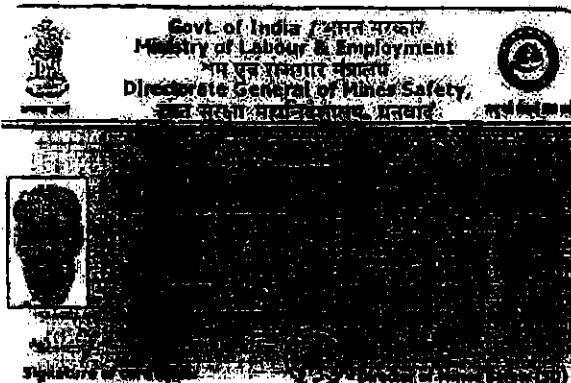

(2)

156

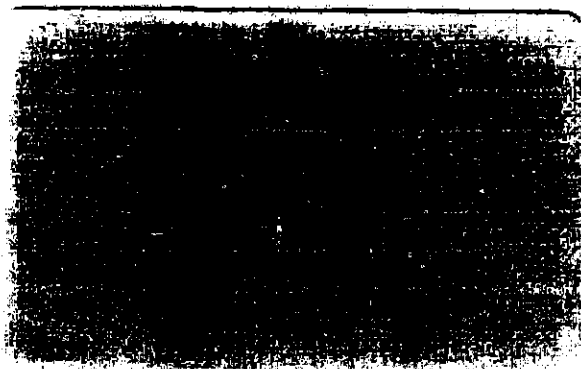








22  
18/1/17  
भारत सरकार  
Government of India  
श्रम एवं रोजगार मंत्रालय  
Ministry of Labour & Employment  
खान सुरक्षा महानिदेशालय  
Directorate General of Mines Safety

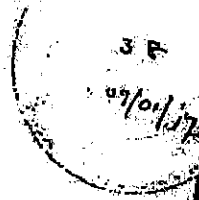

No. Z-20025/4/2016/MAMID/11 & c.

Dhanbad, dated : / /2016

**OFFICE ORDER**

An Inquiry Committee consisting of the following officers of the Directorate is hereby formed to enquire into the causes and circumstances leading to the accident occurred at Rajmahal Opencast Project of M/s Eastern Coalfields Ltd. on 29.12.2016,

1. Shri Utpal Saha, Dy. Director General, Eastern Zone, Sitarampur - Chairman
2. Shri Niranjan Sharma, Director, Region No. 3, Eastern Zone, Sitarampur - Member
3. Md. Niyazi, Dy. Director, Region No. 3, Eastern Zone, Sitarampur - Member
4. Shri Sudhir Bhaisare, Dy. Director (Mech), Eastern Zone, Sitarampur - Member
5. Shri Inumula Satyanarayana, Dy. Director (SOMA), HQ, Dhanbad - Member

In addition to above, another Sub-committee consisting of the following officials shall conduct survey works related to the accident, mentioned above, and shall assist the Inquiry Committee, constituted above,

1. Shri Kondabattini Gyaneswar, Dy. Director (HQ), Dhanbad - Leader
2. Shri Rajib Mandal, Head Surveyor (HQ), Dhanbad - Member
3. Shri Gorakh Singh, Surveyor (CZ), Dhanbad - Member
4. Shri Tapas Rajwar, Surveyor (HQ), Dhanbad - Member
5. Shri Rajib Ranjan Sinha, Surveyor (HQ), Dhanbad - Member

24  
(Rahul Saha)  
Director General of Mines Safety

18.12.16  
9.1.17



(158) (8)

Memo No. Z-20025/4/2016/MAMID/ 1187-97

Dhanbad, dated : 30 / 12 / 2016

Copy forwarded for information and necessary action to

1. Shri Utpal Saha, Dy. Director General, Eastern Zone, Sitarampur  
2. Shri Niranjana Sharma, Director, Region No. 3, Eastern Zone, Sitarampur  
3. Md. Niyazi, Dy. Director, Region No. 3, Eastern Zone, Sitarampur  
4. Shri Sudhir Bhaisare, Dy. Director (Mech), Eastern Zone, Sitarampur  
5. Shri Inumula Satyanarayana, Dy. Director (SOMA), HQ, Dhanbad  
6. Shri Kondabattiri Gyaneswar, Dy. Director (HQ), Dhanbad  
7. Shri Rajib Mandal, Head Surveyor (HQ), Dhanbad  
8. Shri Gorakh Singh, Surveyor (CZ), Dhanbad  
9. Shri Tapas Rajwar, Surveyor (HQ), Dhanbad  
10. Shri Rajib Ranjan Sinha, Surveyor (HQ), Dhanbad  
11. Concern File in SOMA Section

*Chandra*  
Director General of Mines Safety





भारत सरकार  
Government of India  
श्रम एवं रोजगार मंत्रालय  
Ministry of Labour & Employment  
खान सुरक्षा महानिदेशालय  
Directorate General of Mines Safety

38  
7/01/12



159

सं० जेड.-20025/4/2016/मामिड/

धनबाद, दिनांक

2016

कार्यालय आदेश

मेसर्स इस्टर्न कोलफिल्ड्स लिमिटेड के राजमहल ओपनकास्ट प्रोजेक्ट में दिनांक 29.12.2016 को हुई दुर्घटना के कारणों एवं परिस्थितियों की जाँच के लिए इस निदेशालय के निम्नलिखित अधिकारियों की एक जाँच समिति का गठन किया गया है:-

- |  |           |
|--|-----------|
| 1. श्री उत्पल साहा, खान सुरक्षा उपमहानिदेशक, पू. अंचल, सीतारामपुर, | - अध्यक्ष |
| 2. श्री निरंजन शर्मा, खान सुरक्षा निदेशक, सीतारामपुर क्षेत्र-3,    | - सदस्य   |
| 3. मो० नियाजी, खान सुरक्षा उपनिदेशक, सीतारामपुर क्षेत्र-3,         | - सदस्य   |
| 4. श्री सुधीर भैंसारे, उपनिदेशक (यांत्रिक), पू. अंचल, सीतारामपुर,  | - सदस्य   |
| 5. श्री अनुमूला सत्यनारायणा, उपनिदेशक (सोमा), मुख्यालय धनबाद       | - सदस्य   |

इसके अतिरिक्त इस दुर्घटना से संबंधित सर्वे कार्य के लिए दूसरी उप-समिति का गठन किया गया है जिसमें निम्नलिखित अधिकारियों का चयन किया गया है। ये उप-समिति उपरोक्त जाँच समिति को सहाय्य करेंगी:-

- |  |         |
|--|---------|
| 1. श्री कौण्डवलिनी जानेश्वर, उपनिदेशक (मु०), धनबाद | - लीडर  |
| 2. श्री राजीव मंडल, मु० सर्वेयर (मु०), धनबाद       | - सदस्य |
| 3. श्री गोरख सिंह, सर्वेयर (मध्य अंचल), धनबाद      | - सदस्य |
| 4. श्री तापस राजवार, सर्वेयर (मु०), धनबाद          | - सदस्य |
| 5. श्री राजीव रंजन सिन्हा, सर्वेयर (मु०), धनबाद    | - सदस्य |

ह/०

(सहस्र मुखी)

खान सुरक्षा महानिदेशक



सं० जेड-20025/4/2016/मामिड/ 11 8 7 97

धनबाद, दिनांक 30/12/2016

प्रतिलिपि सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित:-

1. श्री उत्पल साहा, खान सुरक्षा उपमहानिदेशक, पू. अंचल, सीतारामपुर,
2. श्री निरंजन शर्मा, खान सुरक्षा निदेशक, सीतारामपुर क्षेत्र-3,
3. मो० नियाजी, खान सुरक्षा उपनिदेशक, सीतारामपुर क्षेत्र-3,
4. श्री सुधीर भैंसारे, उपनिदेशक (यांत्रिक), पू. अंचल, सीतारामपुर,
5. श्री इनुमूला सत्यनारायणा, उपनिदेशक, सोमा, मुख्यालय धनबाद
6. श्री कोण्डाबलिनी जानेश्वर, उपनिदेशक (मु०), धनबाद
7. श्री राजीव मंडल, मु० सर्वेयर (मु०), धनबाद
8. श्री गोरख सिंह, सर्वेयर (मध्य अंचल), धनबाद
9. श्री तापस राजवार, सर्वेयर (मु०), धनबाद
10. श्री राजीव रंजन सिन्हा, सर्वेयर (मु०), धनबाद
11. संबंधित संचिका, खा० सु० म० नि०, सोमा अनुभाग, धनबाद

51-36  
30/12  
(राहुल गुहा)

खान सुरक्षा महानिदेशक







पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 201 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री भोला नाथ शुक्ला / Sri Bhola Nath Shukla,  
मनोनीत मालिक / निदेशक तकनीकी (ओ पी) / Nominated Owner/Director Technical (OP),  
मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड / M/s Eastern Coalfields Ltd.,  
सांकतोड़िया, पोस्ट: डिशेरगढ़-713333, बर्दमान (पश्चिम बंगाल).  
Sanctoria, Post: Dishergarh - 713333, Burdwan (WB).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety (EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden and coal in your above mine containing known geological disturbances; cracks developed due to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs, resulting into violent failure of in-situ overburden and coal benches, followed by instant sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the conditions of permission letter issued vide No. S4/03/26/006/II-B/87/1182 dated 08.04.1987 which says that special care should have been taken while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides, ensured the slope of spoil bank face by natural angle of repose i.e. 37.5° and undertaken a scientific study, prior to commencement of work in the patch, thereby not carrying out mining operations in accordance with the statute as required under the provisions of Section 18(4) of the Mines Act, 1952 read with clause no. 3.4, 3.6, 5.1.1, and 5.1.2 of the annexure of permission letter no. S4/03/26/006/II-B/87/1182 dated 08.04.1987 issued under Regulation 98(1) & (3) of the Coal Mines Regulations, 1957, this accident could have been averted.



(162)

Therefore, you being the Nominated Owner have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.


You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

सकदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 202 सीतारामपुर दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
16/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
B/C

  
25/2/2017  
खान सुरक्षा उप-महानिदेशक,  
पूर्वी अंचल, सीतारामपुर ।



163

पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
 श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
 खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
 पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
 \*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 203

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
 सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
 खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
 पोस्ट: सीतारामपुर, जिला: बर्धमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री संजय कुमार सिंह / Sri Sanjay Kumar Singh,  
 मानित अधिकारी / महाप्रबन्धक / Deemed Agent & General Manager (I/C), Rajmahal Area,  
 राजमहल क्षेत्र, मेक्स ईस्टर्न कोल्फील्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
 पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
 जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
 OB dump in Daharangi Patch of Rajmahal Opencast Project, M/s Eastern  
 Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
 Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
 (EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
 MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
 and coal in your above mine containing known geological disturbances, cracks developed due  
 to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
 resulting into violent failure of in-situ overburden and coal benches, followed by instant  
 sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the conditions of permission letter issued vide  
 No.84/03/26/006/II-B/87/1182 dated 08.04.1987 which says that special care should have  
 been taken while operating in the vicinity of geologically disturbed area and the slides in OB  
 and coal should have been kept sloped to prevent danger from fall of sides, ensured the slope  
 of spoil bank face by natural angle of repose i.e. 37.50 and undertaken a scientific study, prior  
 to commencement of work in the patch and heeded to the observations of the unqualified site  
 supervisors, thereby not carrying out mining operations in accordance with the statute as  
 required under the provisions of Section 18(4) of the Mines Act, 1952 and Regulation 5A(3)  
 of the CMR, 1957 read with Clause No. 3.4, 3.6, 5.1.1, and 5.1.2 of the annexure of  
 permission letter No.84/03/26/006/II-B/87/1182 dated 08.04.1987 issued under Regulation  
 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

DC



(164)

Therefore, you being the Deemed Agent of have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या - 3

ज्ञापन संख्या एस 3/011047/FA/2016/ 204 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए मनोनीत मालिक/निदेशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोदिया, पोस्ट: डिस्तेरगढ़-713333, जिला:बर्दमान को प्रेषित है ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 205 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, घनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

Wal  
16/02/2017  
खान सुरक्षा उप-महानिदेशक  
पूर्वीअंचल, सीतारामपुर ।

16/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
o/c







पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 206 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3/Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्धमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री देबेन्द्र कुमार नायक / Sri Debendra Kumar Nayak,  
अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओओ सीओ पीओ,  
Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मैसर्स ईस्टर्न कोलफील्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया-814185, जिला: गोड्डा, झारखण्ड / Post: Lalmatia, Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Debernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NRAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the conditions of permission letter issued vide  
No. S403/26/006/II-B/37/1182 dated 08.04.1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides, ensured the slope  
of spoil bank face by natural angle of repose i.e. 37.50 and undertaken a scientific study prior  
to commencement of work in the patch and heeded to the observations of the unqualified site  
supervisors, thereby not carrying out mining operations in accordance with the statute as  
required under the provisions of Sections 18(4) and 2(e) of the Mines Act, 1952 and  
Regulation 8A of the CMR, 1957 read with Clause No. 3.4, 3.6, 5.1.1, and 5.1.2 of the



(166)

annexure of permission letter No.S4/326/ 006/11-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Agent of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 207-08 सीतारामपुर, दिनांक 16 फरवरी, 2017


प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-


- 1 मनोनीत मालिक/निदेशक तकनीक (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सीकतोदिवा, पोस्ट: डिसेम्बर-713333, जिला: बर्हमान
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोंड, झारखण्ड

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 209 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
खान सुरक्षा उप-निदेशक  
पूर्वीअंचल, सीतारामपुर

  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3





पंजीकृत/Registered letter

भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 210 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3/Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री प्रमोद कुमार / Sri Pramod Kumar,  
प्रबन्धक, राजमहल ओओ सीओ पीओ / Manager, Rajmahal OCP,  
द्वारा: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओओ सीओ पीओ/  
Through: The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, जेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatla - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the conditions of permission letter issued vide  
No.S4/03/26/006/II-B/87/182 dated 08.04.1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides; ensured the slope  
of spoil bank face by natural angle of repose i.e. 37.5°, intimated DGMS, in Form-I when the  
premature collapse of benches occurred on 08.08.2016 & 23.12.2016 and occurrences of  
significant cracks noticed in the OB dumps, in-situ OB benches above coal benches during  
the last one month period prior to the occurrence of the accident; withdrawn men &  
machineries deployed at OB dump when the situation was alarming with the imminent possibility



168

cracks on haul roads of OB dump & along edges of the OB benches and heeded to observations of the unqualified site supervisors; thereby not carrying out mining operations in accordance with the provisions of the statute as required under the provisions of Sections 17(2) & 18(4) of the Mines Act, 1952 and Regulation 9(1) (a)(viii) & 41 of the CMR, 1957 read with Clause No. 3.4, 3.6, 5.1.1, and 5.1.2 of the annexure of permission letter No.S4/3/26/006/II-B/87/1182 dated 08.04.1987 issued under Regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Manager of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,

ह0/-

(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/211-13 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांक्रोदिया, पोस्ट डिसेम्बर-713333, जिला: बर्हमपूर
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट लालमाटिया, जिला: गोबिन्दा, झारखण्ड
- 3 अधिकर्ता, राजमहल कोसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोबिन्दा, झारखण्ड with a request to handover the letter to the delinquent after receipt of signature on the office copy.

ह0/-

(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/214 सीतारामपुर दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा निदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-निदेशक, पूर्वी बंगाल सीतारामपुर के द्वारा सूचना एवं आवश्यक कार्रवाई हेतु प्रेषित ।

खान सुरक्षा उप-निदेशक,  
पूर्वी बंगाल, सीतारामपुर ।

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या - 3







पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/215

सीतारामपुर, दिनांक फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री देवेन्द्र कुमार सिन्हा / Sri Devendra Kumar Sinha  
मुख्य प्रबन्धक (Excavation), अभियंता, राजमहल ओओ सीओ पीओ,  
Chief Manager (Excavation)/Engineer, Rajmahal OCP,  
राजमहल क्षेत्र, वेस्टर्न ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, no men or machineries been deployed at OB dump  
when the situation was alarming with the imminent visible cracks on haul roads of OB dump  
and along the edges of OB benches, thereby not carrying out mining operations in accordance  
with the statute as required under the provisions of Regulation 50 (a) & (b) and read with  
clause No. 14.1 of the annexure of permission letter No.S4/03/26/006/ H-B/87/1182 dated  
08.04.1987 issued under Regulation 98(1) & (2) of the Coal Mines Regulations, 1957; this  
accident could have been averted.



(170)

Therefore, you being the Engineer Excavation of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

महदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/216-18 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-


- 1 मनोनीत मालिक/निदेशक तकनीकि (बो पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: डिसेरगढ-713333, जिला: बर्हमान
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: जालमाटिया, जिला: गोदडा, झारखण्ड।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: जालमाटिया, जिला: गोदडा, झारखण्ड।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/219 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित।

  
16/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

  
खान सुरक्षा उप-महानिदेशक,  
पूर्वी अंचल, सीतारामपुर।





पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/811047/FA/2016/ 220 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री विनय प्रकाश सिंह / Sri Vinay Prakash Singh  
वरिष्ठ प्रबन्धक (E&M)/अभियंता, राजमहल ओ सी पी,  
Senior Manager (E&M)/Engineer, Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Jitpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances, cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, no men or machineries been deployed at OB dump  
when the situation was alarming with the imminent visible cracks on haul roads of OB dump  
and along the edges of OB benches, thereby not carrying out mining operations in accordance  
with the statute as required under the provisions of Regulation 50 (a) & (d) and read with  
clause No.14.1 of the annexure of permission letter No SA/D3/26/0067 H-B/37/1182 dated  
08.04.1987 issued under Regulation 98(1) & (3) of the Coal Mines Regulations, 1957, this  
accident could have been averted.



(172)

Therefore, you being the Engineer (E&M) of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/221-23 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीक (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: डिसेरगढ़-713333, जिला: बर्दमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोदडा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोदडा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/224 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, घनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल, सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

खान सुरक्षा उप-महानिदेशक,  
पूर्वीअंचल, सीतारामपुर ।

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3





(173)

पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR

\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 225 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री दिलीप राय / Sri Dilip Roy,  
सहायक प्रबन्धक, राजमहल ओ सी पी / Assistant Manager, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Daharangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.


महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-ANKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances, cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the conditions of permission letter issued vide  
No.S403/26/2006/II-B/37/1182 dated 08/04/1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides, withdrawn men &  
machineries deployed at OB dump when the situation was alarming with the imminent visible  
cracks on haul roads of OB dump and along edges of the OB benches, heeded to the  
observations of the unqualified site supervisors, thereby not carrying out mining operations in  
accordance with the provisions of the statute, as required under the provisions of Regulation  
42 of the CMR, 1957 read with clause No.3.4, 3.6, 5.1.1, 5.1.2 and 9.1.2 of the signature of

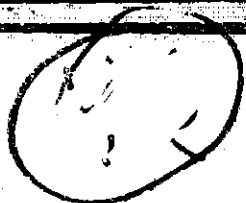

(179)   
permission letter No.S4/ 03/26/006/ II-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Assistant Manager In-charge of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,

ह0/-

(निरंजन शर्मा)

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2018/ 226-28 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: डिसेरगढ़-713333, जिला: बर्हीमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोड्डा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोड्डा, झारखण्ड ।

ह0/-


(निरंजन शर्मा)

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2018/ 228 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचना एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर ।

  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
G/C





पंजीकृत/Registered Letter

भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 230

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक/From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में/To

श्री विजय कुमार सिंह / Sri Vijay Kumar Singh  
सहायक प्रबन्धक, राजमहल ओ सी पी / Assistant Manager, Rajmahal OCP,  
वास्ते: अमिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist. Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MFL-NKAS (IV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances, cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had the conditions of permission letter issued vide  
No. 34/03/26/006/11-B/87/1182 dated 05.04.1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides withdrawn men &  
machineries deployed at OB dump when the situation was alarming with the imminent visible  
cracks on haul roads of OB dump and along edges of the OB benches heeded to the  
observations of the unqualified site supervisors, thereby not carrying out mining operations in  
accordance with the provisions of the statute, as required under the provisions of Regulation



(176)

42 of the CMR, 1957 read with clause No.3.4, 3.6, 5.1.1, 5.1.2 and 9.1.2 of the annexure of permission letter No.S4/ 03/26/006/ II-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Assistant Manager of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

मवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2018/231-33 सीतारामपुर, दिनांक 16 फरवरी, 2017


प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-


- 1 मनोनीत मालिक/निदेशक तकनीकी (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: बिसेरगढ़-713333, जिला: बर्हमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोदडा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोदडा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2018/234 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा निदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
16/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

  
खान सुरक्षा उप-महानिदेशक,  
पूर्वी अंचल, सीतारामपुर ।







(177)  
पंजीकृत/Registered Letter

भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 235

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री रंजीत कुमार सिंह / Sri Ranjit Kumar Singh  
सहायक प्रबन्धक, राजमहल ओ सी पी / Assistant Manager, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लाजगाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahraangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had the conditions of permission letter issued vide  
No.S4/03/26/006/II-B/87/1182 dated 08.04.1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides; withdrawn men &  
machineries deployed at OB dump when the situation was alarming with the imminent visible  
cracks on haul roads of OB dump and along edges of the OB benches, led to the  
observations of the unqualified site supervisors, thereby not carrying out mining operations in  
accordance with the provisions of the statute, as required under the provisions of Regulation  
42 of the CMR, 1957 read with clause No.3.4, 3.6, 5.1.1, 5.1.2 and 9.1.2 of the annexure of



(178)



permission letter No.S4/ 03/26/006/ II-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Assistant Manager of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.


भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/236-38 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत सालिक/निदेशक तकनीक (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, संकतोदिया, पोस्ट: डिसेरगढ़-713333, जिला: बर्हीमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालगाटिया, जिला: गोददा, झारखण्ड ।
- 3 अभिलेखी, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालगाटिया, जिला: गोददा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/239 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, बनारस को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचना एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
16/02/2017  
e/c

  
खान सुरक्षा उप-महानिदेशक,  
पूनीविचल, सीतारामपुर ।



(179)

पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2018/ 240

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री पद्मा चरण धर / Sri Padma Charan Dhar,  
सहायक प्रबन्धक, राजमहल ओ सी पी / Assistant Manager, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया-814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety (EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden and coal in your above mine containing known geological disturbances, cracks developed due to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs, resulting into violent failure of in-situ overburden and coal benches, followed by instant sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had the conditions of permission letter issued vide No.S4/03/26/006/II-B/87/192 dated 08.04.1987 which says that special care should have been taken while operating in the vicinity of geologically disturbed area and the sides in OB and coal should have been kept sloped to prevent danger from fall of sides; withdrawn men & machineries deployed at OB dump when the situation was alarming with the imminent visible cracks on haul roads of OB dump and along edges of the OB benches; heeded to the observations of the unqualified site supervisors, thereby not carrying out mining operations in accordance with the provisions of the statute as required under the provisions of



(180)

Regulation 42 of the CMR, 1957 read with clause No.3.4, 3.6, 5.1.1, 5.1.2 and 9.1.2 of the annexure of permission letter No.S4/ 03/26/006/ II-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Assistant Manager of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 241-43 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निर्देशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांखुवाटिया, पोस्ट: बिसेरगढ-713333, जिला: बर्हमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालगाटिया, जिला: गोदडा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालगाटिया, जिला: गोदडा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 244 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

  
खान सुरक्षा उप-महानिदेशक  
पूर्वीअंचल, सीतारामपुर ।

  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3





181

पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 245

सीतारामपुर, दिनांक १६ फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री नीरज सिन्हा / Sri Neeraj Sinha,  
सहायक प्रबन्धक, राजमहल ओ सी पी / Assistant Manager, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया-814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Upal Saha, Dy. Director General of Mines Safety  
(BZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had the conditions of permission letter issued vide  
No.S4/03/26006/II-B/87/1182 dated 08.04.1987 which says that special care should have  
been taken while operating in the vicinity of geologically disturbed area and the sides in OB  
and coal should have been kept sloped to prevent danger from fall of sides, withdrawn men &  
machineries deployed at OB dump when the situation was alarming with the imminent visible  
cracks on haul roads of OB dump and along edges of the OB benches, headed to the  
observations of the unqualified site supervisors, thereby not carrying out mining operations in  
accordance with the provisions of the statute, as required under the provisions of Regulation  
42 of the CMR, 1957 read with clause No.2.4, 3.6, 3.1.1, 3.1.2 and 9.1.2 of the stipulation of



1182

permission letter No.S4/ 03/26/006/ II-B/87/1182 dated 08.04.1987 issued under regulation 98(1) & (3) of the Coal Mines Regulations, 1957; this accident could have been averted.

Therefore, you being the Assistant Manager of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 24648 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीकी (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: डिसेरमद-713333, जिला: बर्धमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोड्डा, झारखण्ड ।
- 3 अधिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: तालमाटिया, जिला: गोड्डा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 2469 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचना एवं आवश्यक कार्रवाई हेतु प्रेषित ।

*Usha*  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर ।

*7.2.2017*  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
o/c



183

8



पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 250 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्धमान / Post: Sitarampur, Dist: Burdwan (WB).

सेवा में / To

श्री सुधीर प्रसाद बरगवाल / Sri Sudhir Prasad Barnwal,  
सुरक्षा अधिकारी, राजमहल ओ० सी० पी० / Safety Officer, Rajmahal OCP,  
द्वारा: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ० सी० पी० /  
Through: The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिका- 814165 / Post: Lalmatta - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances, cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the compliance of conditions of permission letter issued  
vide No.S4/03/26006/IL-B/87/1182 dated 08.04.1987 which says that special care should  
have been taken while operating in the vicinity of geologically disturbed area and the sides in  
OB and coal should have been kept sloped to prevent danger from fall of sides been ensured,  
apprised the manager of all possible sources of dangers in the mine as required under the  
provisions of Regulation 41A(1)(b)(iii), (i) & (ii) of the CMR, 1957 read with clause No. 3.4,  
3.6, 5.1.1, and 5.1.2 of the annexure of permission letter No.S4/03/26006/IL-B/87/1182 dated  
08.04.1987 issued under Regulation 98(i) & (j) of the Coal Mines Regulations, 1957; this  
accident could have been averted.



(189)

Therefore, you being the Safety Officer of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/251-S3 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांक्रांतोदिया, पोस्ट: डिसेरगढ़-713333, जिला: बर्दमान।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोददा, झारखण्ड।
- 3 अधिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोददा, झारखण्ड with a request to handover the letter to the delinquent after receipt of signature on the office copy.

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/254 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, पटना को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित।

Uthalo  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर।

नि. शर्मा  
16/2/2017  
खान सुरक्षा निदेशक  
सीतारामपुर क्षेत्र संख्या-3  
e/c







पंजीकृत/Registered Letter



भारत सरकार / GOVERNMENT OF INDIA  
श्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एम.3/011047/FA/2016/ 255

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री दामोदर राम / Sri Damodar Ram,  
कोलियरी सर्वेयर, राजमहल ओ सी पी / Colliery Surveyor, Rajmahal OCP,  
वास्ते: अधिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया-814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OR dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NEAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances; cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the facts of workings of the mine approaching within  
75m of exposed workings (waste dump) been recorded; maintained accurate plans and section  
indicating side falls occurred time to time and kept manager of the mine informed as required  
under the provisions of Regulation 49(1)(a) & (2)(a) of the Coal Mines Regulations, 1957;  
this accident could have been averted.



(186) (18)

Therefore, you being the Colliery Surveyor of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enshrined upon you by the above provision of the statute.

You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 256-58 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीकि (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोड़िया, पोस्ट: खिसेरगढ-713333, जिला: बर्हमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोड्डा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोड्डा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 259 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

11/02/2017  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर ।

11/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

9/c.





187 (10)  
पंजीकृत/Registered Letter

भारत सरकार / GOVERNMENT OF INDIA  
मन एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2018/ 260

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेन में / To

श्री नंदन कुमार / Sri Nandan Kumar,  
सर्वेयर, राजमहल ओ सी पी / Surveyor, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at  
OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern  
Coalfields Limited.

महोदय,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS  
Officers under the Chairmanship of Sri Utpal Saha, Dy. Director General of Mines Safety  
(EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s  
MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden  
and coal in your above mine containing known geological disturbances, cracks developed due  
to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs,  
resulting into violent failure of in-situ overburden and coal benches, followed by instant  
sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had the facts of workings of the mine approaching within  
75m of disused workings (waste dump) been recorded, maintained accurate plans and section  
indicating side falls occurred time to time and kept manager of the mine informed as required  
under the provisions of Regulation 49(1)(a) & (2)(a) of the Coal Mines Regulations, 1957,  
this accident could have been averted.

Therefore, you being the Surveyor of the mine have failed in your statutory duties as stated  
above which caused the above accident. You are hereby asked to explain as to why suitable  
action as per Law shall not be taken against you for the dereliction of above statutory duties  
as enjoined upon you by the above provision of the statute.



188



You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,

ह0/-

(निरंजन शर्मा)

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 261-63 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

1. मनोनीत मालिक/निदेशक तकनीके (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, साकतोड़िया, पोस्ट: डिसेरगढ़-713333, जिला: बर्दमान ।
2. महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोड्डा, झारखण्ड ।
3. अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोड्डा, झारखण्ड ।


ह0/-

(निरंजन शर्मा)

खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3


ज्ञापन संख्या एस 3/011047/FA/2016/ 264 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनुबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।



खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

प/क

  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर ।







पंजीकृत/Registered Letter

भारत सरकार / GOVERNMENT OF INDIA  
अस एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR  
\*\*\*\*\*

संख्या एस 3/011047/FA/2016/ 265

सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रेषक / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री सुजय कुमार / Sri Sujay Kumar,  
ओवरमैन, राजमहल ओ सी पी / Overman, Rajmahal OCP,  
वास्ते: अभिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ सी पी /  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफिल्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया-814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern Coalfields Limited.

संदर्भ,

Please refer to the enquiry into the above accident by a Committee consisting of DGMS Officers under the Chairmanship of Sri Utpal Saha, Dy. Director-General of Mines Safety (EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden and coal in your above mine containing known geological disturbances; cracks developed due to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs, resulting into violent failure of in-situ overburden and coal benches, followed by instant sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, the continued unsafe condition of the mine workings been reported, removed danger observed and enforced the provisions of Act, regulations and orders made thereunder and secured safety of the persons employed therein as required under the provisions of Regulation 43(1)(e) & (6) of the Coal Mines Regulations, 1957, this accident could have been averted.





भारत सरकार / GOVERNMENT OF INDIA  
 प्रम एवं रोजगार मंत्रालय / MINISTRY OF LABOUR & EMPLOYMENT  
 खान सुरक्षा महानिदेशालय / DIRECTORATE GENERAL OF MINES SAFETY  
 पूर्वी अंचल, सीतारामपुर / EASTERN ZONE, SITARAMPUR

संख्या एस 3/011047/FA/2016/ 270

सीतारामपुर, दिनांक 16 फरवरी, 2017

પ્રેષક / From

खान सुरक्षा निदेशक / Director of Mines Safety,  
सीतारामपुर क्षेत्र संख्या-3 / Sitarampur Region No.3,  
खान सुरक्षा महानिदेशालय, पूर्वी अंचल / Directorate General of Mines Safety, Eastern Zone,  
पोस्ट: सीतारामपुर, जिला: बर्दमान / Post: Sitarampur, Dist.: Burdwan (WB).

सेवा में / To

श्री मो० एजाज हुसैन अजसारी / Sri Md. Ejaz Hussain Ansari,  
माइनिंग सरदार, राजमहल ओ सी पी / Mining Sirdar, Rajmahal OCP,  
वास्ते: अमिकर्ता / महाप्रबन्धक (ओ पी), राजमहल ओ० सी० पी०/  
C/o The Agent/General Manager (Operation), Rajmahal OCP,  
राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड / Rajmahal Area, M/s ECL,  
पोस्ट: लालमाटिया- 814165 / Post: Lalmatia - 814165,  
जिला: गोड्डा, झारखण्ड / Dist: Godda (Jharkhand).

**विषय: Major fatal accident occurred on 29.12.2016 involving 23 contractual workers at OB dump in Dahernangi Patch of Rajmahal Opencast Project, M/s Eastern Coalfields Limited.**

## महोदय

Please refer to the enquiry into the above accident by a Committee consisting of DGMS Officers under the Chairmanship of Sri Umap Saha, Dy. Director-General of Mines Safety (EZ) during the period from 30<sup>th</sup> December, 2016 to 07<sup>th</sup> February, 2017.

During the enquiry it was revealed that "While contractual workers and machineries of M/s MIPL-NKAS (JV) were deployed to form benches in dumped overburden, in-situ overburden and coal in your above mine containing known geological disturbances; cracks developed due to dead weight of dumped overburden, deep hole blasting and repeated plying of HEMMs, resulting into violent failure of in-situ overburden and coal benches, followed by instant sliding of dump in an area of 720m x 366m burying 23 workers along with 18 HEMMs".

The enquiry further revealed that had, dangerous places in the workings been observed and withdrawn persons from thereat by putting a fence to prevent persons from inadvertently entering dangerous places as required under the provisions of Regulation 44(1)(b) & (c) of the Coal Mines Regulations, 1957, this accident could have been averted.

Therefore, you being the Mining Sirdar of the mine have failed in your statutory duties as stated above which caused the above accident. You are hereby asked to explain as to why suitable action as per Law shall not be taken against you for the dereliction of above statutory duties as enjoined upon you by the above provision of the statute.



191



You are hereby directed to reply within 15 days from the date of issue of this letter failing which it shall be construed that you have nothing to explain in your defense and suitable action as provided as per law shall be initiated. Please submit your reply, in duplicate, to this Directorate.

Please acknowledge the receipt of this letter.

भवदीय,  
ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 271-23 सीतारामपुर, दिनांक 16 फरवरी, 2017  
प्रतिलिपि सूचना एवं आवश्यक कार्रवाई के लिए निम्नलिखित को प्रेषित है:-

- 1 मनोनीत मालिक/निदेशक तकनीक (ओ पी), मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, सांकतोडिया, पोस्ट: डिसेरगढ़-713333, जिला: बटमान ।
- 2 महाप्रबंधक, राजमहल क्षेत्र, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोदडा, झारखण्ड ।
- 3 अभिकर्ता, राजमहल ओसीपी, मेसर्स ईस्टर्न कोलफील्ड्स लिमिटेड, पोस्ट: लालमाटिया, जिला: गोदडा, झारखण्ड ।

ह0/-  
(निरंजन शर्मा)  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3

ज्ञापन संख्या एस 3/011047/FA/2016/ 274 सीतारामपुर, दिनांक 16 फरवरी, 2017

प्रतिलिपि खान सुरक्षा महानिदेशक, मुख्यालय, धनबाद को खान सुरक्षा उप-महानिदेशक, पूर्वी अंचल सीतारामपुर के द्वारा सूचनार्थ एवं आवश्यक कार्रवाई हेतु प्रेषित ।

11/02/2017  
खान सुरक्षा उप-महानिदेशक  
पूर्वी अंचल, सीतारामपुर ।

16/02/2017  
खान सुरक्षा निदेशक,  
सीतारामपुर क्षेत्र संख्या-3  
8/2



ईस्टर्न कोलफील्ड्स लिमिटेड  
(कोल इंडिया की एक सहायक कंपनी)  
कोलकाता-700001, पश्चिम बंगाल का कार्यालय  
संयोजक, राजमहल - बिहार  
दूर - बर्दमान, पश्चिम बंगाल - 713333  
राजमहल-का एच और सी का कार्यालय।  
सीआईएस - U10101WB1975G0030285.  
फोन/फैक्स - [scheernanoident@gmail.com](mailto:scheernanoident@gmail.com)  
टेलीफोन - 0341-2523598.



192

Eastern Coalfield  
(A Subsidiary of Coal India)  
Office of the Chairman-Cum-Managing Director  
Sanctoria, PO: Disha,  
Dist. Burdwan, West Bengal - 713333.  
Secretariat of the General Manager(P&IR).  
CIN-U10101WB1975G0030285.  
E-mail - [scheernanoident@gmail.com](mailto:scheernanoident@gmail.com)  
Telefax- 0341-2523598.

Ref. No. ECL/CMD/C-6B/GM(P&IR)/17/ 932

Date : 11.01.2017.

### OFFICE ORDER

The Functional Directors of ECL considering the proposal of Rajmahal Area & exigency expressed, have approved the payment of Rs. 5(Five) Lakhs each as Ex-gratia to the legal heirs of the following deceased workers of the Contractor M/s. MIPL-NKAS(JV) who died while on duty at Rajmahal OCP on 29.12.2016 due to Dump Slide(an accident arising out of & in course of employment) :-

Sl.No.	Name of deceased contractor worker	Sl.No.	Name of deceased contractor worker
1	Lt. Hari Kishore Yadav	10	Lt. Sakil Khan
2	Lt. Javed Akhtar	11	Lt. Vikash Patel
3	Lt. Rajendra Yadav alias Bonal	12	Lt. Sunil Bhengra
4	Lt. Brijesh Yadav	13	Lt. Ajay Kumar Kushwaha
5	Lt. Sanjay Kr. Sahi	14	Lt. Md. Julfkar (Md. Julfikar)
6	Lt. Md. Nurul	15	Lt. Md. Jamir
7	Lt. Jai Prakash Rai	16	Lt. Raj Kamal Goswami
8	Lt. Nageshwar Paswan	17	Lt. Sanjit Viswakarma
9	Lt. Ajit Patel	18	Lt. Laddu Yadav

This ex-gratia will be in addition to the Employees Compensation under Employees Compensation Act which is to be deposited to the appropriate authority separately.

General Manager, Rajmahal OCP is requested to expedite the payment to the legal heirs of the deceased contractor's workers by ascertaining their genuinity & through Bank Account only. A Board Note for intimation to the ECL Board will be moved shortly.

*P. Rami*  
11/1/17  
General Manager(P&IR)

#### Distribution:

1. CMD, ECL.
2. D(T)OP, ECL / D(F), ECL / D(T)P&P, ECL / D(P), ECL
3. GM, Rajmahal Area / GM(Finance), ECL / GM(Safety & Rescue), ECL.
4. Company Secretary, ECL - This refer to the approved Note Sheet No. GM(P&IR)/Compensation/ dated 07.01.2017 initiated by APM, Rajmahal Project forwarded to this Office.
5. Sr. Manager(P/L&IR), ECL, HQ. - For record.
6. Area Personnel Manager, Rajmahal Area.





An unfortunate accident has occurred at Rajmahal G.P. on 29-12-2016 evening in the outsourced patch of M/s. MIPL-NKAS(JV) contractor, and in the accident 14 persons were killed and 13 died in the accident. The details are as follows:

Sl. No.	Name of deceased	Designation	Family name	Date of death
1	Hari Kishore Yadav	Excavator Optr.	Dashrath Yadav	29-12-2016
2	Javed Akhtar	Excavator Optr.	Jasmeel Anwar	29-12-2016
3	Rajendra Yadav alias Bonal	Excavator Optr.	Ram Narayn Yadav	29-12-2016
4	Brijesh Yadav	Excavator Optr.	Kamaldeo Yadav	29-12-2016
5	Sanjay Kr. Sahi	Tipper Driver	Sajit Sahi	29-12-2016
6	Md. Nurul	Tipper Driver	Md. Rafique	29-12-2016
7	Jai Prakash Rai	Tipper Driver	Tota Rai	29-12-2016
8	Nageshwar Paswan	Tipper Driver	Sakhishan Paswan	29-12-2016
9	Ajit Patel	Excavator Optr.	Dinesh Prasad Patel	29-12-2016
10	Sakil Khan	Tipper Driver	Yunush Khan	29-12-2016
11	Vikash Patel	Tipper Driver	K. P. Patel	29-12-2016
12	Sunil Bhengra	Tipper Driver	Laxman Bhengra	29-12-2016
13	Ajay Kumar Kushwaha	Dozer Optr.	Baleswar Mahto	29-12-2016
14	Md. Julfar	Tipper Driver	Saffi Mahomnad	29-12-2016

194

Tipper Driver

... National Safety Committee & Local Re- ...  
... who died in the ... accident ...  
... contractor workers who died in the mine ...


... Ministry of Coal announced an Ex-Gratia compensation of Rs. 9  
Lacs to each family of the deceased employee, in addition to the amount to be paid under the  
Employees Compensation Act 1973.

As such the above deceased employees i.e. contractor workers cases may be considered  
in the same line as narrated above for compensation.

Put up to the General Manager (I/c), RGOM with request to forward the same to  
competent authority for their kind perusal and approval.

  
Area Personnel Manager

Area Finance Manager Amount of compensation will be paid to next kin  
of deceased employees to be decided by committee  
specially constituted for this purpose by D(P) ECL HQ  
General Manager(I/c), RGOM may be forwarded to GM (P&IR) HQ for approval  
of Rs 90-00 lacs as compensation of 18 contractor  
workers  
General Manager(P&IR), ECL HQ

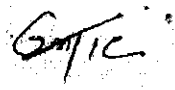 7-1-17  
Forwarded for ...  
above

GM (P & IR) ECL  
21/1/17

190  
Update on ECL Rajmahal Coal Mine Accident

**Press Information Bureau  
Government of India  
Ministry of Coal**

30-December-2016 12:31 IST

**Update on ECL Rajmahal Coal Mine Accident**

**Rescue Operations going on**

**Ex-Gratia compensation of Rs. 5 Lakh to each family of the deceased announced**

**Control Room Set Up at Project Office of Rajmahal Open Cast Expansion Project**

CMD, Eastern Coalfields Limited (ECL) has reported that an incidence of overburden dump slide/subsidence has occurred in the second shift of 29.12.2016 at about 7.30 P.M. in the Rajmahal Open Cast Expansion Project in district Goda, Jharkhand, causing the unfortunate demise of 7 workers. The company has announced an ex-gratia compensation of Rs. 5 lakhs each to the family of the deceased, in addition to the amount to be paid under the Workmen's Compensation Act. All the necessary help to the families of the deceased is being extended by ECL. Two persons have met with injuries and treated in the Area Hospital. One of them has been sent to Durgapur for further treatment.

Prima facie, it is observed that the incidence is unprecedented, since an area of 300 m length by 110 m wide solid floor of the Over Burden dump area has slid down by about 35 m involving around 9.5 million cubic meters of earth material. This could be due to failure of the bench edge along the hidden fault line/slip.

Senior management of ECL and State Government officials have been supervising the rescue operations since yesterday evening. Till 11 A.M. today, 3 excavators and 7 dump trucks have been located. NDRF Team has also been engaged for rescue and relief operations.

An Inquiry has been ordered in the incident by the Director General of Mines Safety and a High Level Committee of Experts has been constituted by Coal India Limited to investigate into the causes of the accident.

A control room has been set up at the project office of Rajmahal Open Cast Expansion Project of ECL and Shri R.R. Amitabh, GM, Mining is in charge of control room and his contact no. is 9771447171.

RM/VM



ईस्टर्न कोलफील्ड्स लिमिटेड  
(कोल इण्डिया लिमिटेड का एक अंग)



Eastern Coalfields Ltd.  
(A Subsidiary of Coal India Ltd.)

टिप्पणी पत्र  
NOTING SHEET

ANNEXURE - 1E  
Series  
196

विभाग DEPARTMENT

संचिका संख्या -  
File No. :

Personnel, Rajmahal Area

पृष्ठ संख्या -  
Sheet No. :

सम्बन्धित लिपिक -  
Dealing Clerk :  
P&IR/51/

Dated: 04-01-2017

अधिकारी का नाम -  
Name of Officer :

विषय -  
Subject :

S Venkateshawerlu

Sub: Payment of Compensation to be paid under section 4-A as per the employees compensation Act 1923 in respect of deceased employee's of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

A committee has been constituted vide office order no. ECL/CMD/RJML/20 dated 31-12-2016 issued by Director(Pers), ECL HQ, Rajmahal Camp to ensure payment to the next of the kin of the deceased employee who expired in the unfortunate incident which occurred at Rajmahal Area on 29-12-2016 at around 07.30PM in the outsourcing patch of M/s. MIPL-NKAS(JV) Contractor.

The committee examined the calculations made by Rajmahal Area officials and authenticated the same by putting their signature.

Details of deceased employees of M/s. MIPL-NKAS(JV) Contractor

Sl. No.	Name of deceased	Designation	Fathers name	Compensation Amount	
1	Hari Kishore Yadav	Excavator Optr.	Dadan Yadav	Rs. 8,61,120/-	26 year
2	Javed Akhtar	Excavator Optr.	Jasmuddin Ansari	Rs. 8,96,000/-	20 do.
3	Rajendra Yadav alias Bonal	Excavator Optr.	Ram Naresh Yadav	Rs. 8,47,160/-	28 do.
4	Sanjay Kr.Sahi	Tipper Driver	Sujit Sahi	Rs. 7,78,560/-	36 do.
5	Md. Nurul	Tipper Driver	Md. Raffique	Rs. 8,61,120/-	26 do.
6	Jai Prakash Rai	Tipper Driver	Tola Rai	Rs. 7,58,240/-	38 do.
7	Ajit Patel	Excavator Optr.	Dinesh Prasad Patel	Rs. 8,54,280/-	27 do.


197


8	Sakil Khan	Tipper Driver	Yunush Khan	Rs. 8,61,120/-	26 ye
9	Vikash Patel	Tipper Driver	K P Patel	Rs. 8,39,680/-	29 -c
10	Sunil Bhengra	Tipper Driver	Laxman Bhengra	Rs. 8,39,680/-	29 -c
11	Ajay Kumar Kushwaha	Dozer Optr.	Baleswar Mahto	Rs. 8,96,000/-	20 -d
12	Md. Julfikar	Tipper Driver	Saffi Mahommad	Rs. 8,67,640/-	25 -d
13	Md. Jamir	Tipper Driver	Lal Mohammad	Rs. 8,47,160/-	28 -d
14	Raj Kamal Goswami	Tipper Driver	Sudama Goswami	Rs. 8,67,640/-	25 -c
15	Sanjit Viswakarma	Tipper Driver	Ram Patik Viswakarma	Rs. 8,67,640/-	25 -c
16	Laddu Yadav	Excavator Optr	Yogeshwar Yadav	Rs. 8,31,920/-	30 -d
17	Brijesh Yadav	Excavator Optr.	Kamaldeo Yadav	Rs. 8,79,800/-	23 -d
18	Nageshwar Paswan	Tipper Driver	Sakhichand Paswan	Rs. 8,39,680/-	29 -d


Compensation amount to be deposited to employee's compensation commissioner, Bhagalpur Deoghar within one month from the date of it fell due.


Therefore compensation cheques are to be issued in favour of appropriate authority.

Put up to the General Manager(I/c). RGOM for his kind perusal and approval.

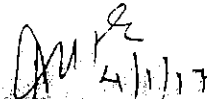  
(Amarendra Deo Gupta)  
Committee Member  
Rajmahal Area

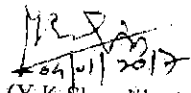  
(Y K Shandilya)  
Committee Member  
ECL HQ

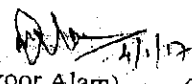  
(Manzoor Alam)  
Committee Member  
Pandweshwar Area

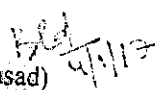  
(B. Prasad)  
Committee Member  
ECL HQ

Area Finance Manager  
Rajmahal Area

  
(S Venkateshwar)  
Committee Member-cum-APM  
Rajmahal Area

General Manager(I/c). RGOM



ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/ 85

दिनांक - 10.01.2017

To

The Employee's Compensation Commissioner-cum-Presiding Officer  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Hari Kishore Yadav , employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,61,120/- in respect of Late Hari Kishore Yadav, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.


The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

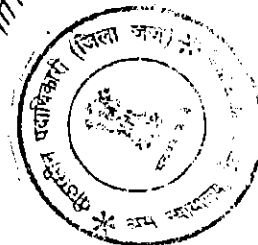

199

भारतीय स्टेट बैंक  
State Bank Of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, RAJMAHAL  
DIST-GODDA, JHARKHAND 814134  
Tel: 8437-228715 IFS Code : SBIN007265

शेष 3 महीने के लिए ही वैध (FOR 3 MONTHS ONLY)  
1 1 0 1 4 0 4 7  
D D M M Y Y Y Y

PAYEE EMPLOYEE'S COMPENSATION COMMISSIONER - CUM - PRESIDENT, LABOUR COURT, DEOGHAR, JHARKHAND  
₹ 8,51,120.00

16-09-2016

आ. नं.  
A/C No: 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT A/C

PREFIX:  
1516200002

  
EASTERN COAL FIELDS LTD - A/C - RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

"212804" 8140027091: 000001" 29





## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोइडा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/ 86

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**

Labour Court Deoghar(Under Employee's Compensation Act 1923)

Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Javed Akhtar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,96,000/- in respect of Late Javed Akhtar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.



16-09-2016

भारतीय स्टेट बैंक  
State Bank of India

(07280) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST RAJMAHAL  
DIST: GODDA, JHARKHAND 814134  
Tel: 6407-228715 IFS Code: SBIN0007285

अन्य 3 वर्षों के लिए भी वैध (FOR 3 MONTHS ONLY)  
1 1 0 1 2 0 1 7  
D D M M Y Y Y Y

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING OFFICER, LABOUR COURT, DEOGHAR. ---  
रुपये RUPEES EIGHT LAC NINETY SIX THOUSAND ONLY. ---

अवकाश ₹ 8,95,000.00


आ. सं.  
अ. सं.

11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT AC

PREFIX:  
1516200002

  
EASTERN COAL FIELDS LTD. - AC- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212813⑈ 814002709⑈ 000001⑈ 29

201



ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/87

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Rajendra Yadav Alias Bonal , employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,47,160/- in respect of Late Rajendra Yadav Alias Bonal, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

11/01/17  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

Record with enclosure  
A/c no.  
11/1/17



16-09-2016

PAYMENT TECHNOLOGIES LIMITED, RAJMAHAL, JHARKHAND

**भारतीय स्टेट बैंक**  
**State Bank of India**

(07285) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANGAR POSTAL AGAMA  
DIST: GODDA, JHARKHAND 814114  
Tel: 6437-228713 IRS Code : SBIN0007285

मार्ग 3 नमूने के लिए वैध है  
VALID FOR 3 MONTHS ONLY  
D D M M Y Y Y Y

**PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDENT**  
**OFFICER, LABOUR COURT, DEOGHAR. —**  
**को या उनके आदेश पर OR-ORDER**  
**₹ 8,47,150.00**  
**₹ 8,47,150.00**  
**अवकाश ₹ 8,47,150.00**

आ. नं.  
A/C No

11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT A/C

PREFIX:

1516200002

**EASTERN COAL FIELDS LTD - AC-RAJMAHAL PROJECT**

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212805⑈ 814002709⑈ 000001⑈ 29

203



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/88

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Brijesh Yadav, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,79,800/- in respect of Late Late Brijesh Yadav, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.


The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

Received with acknowledgment  
A/c m/c  
11/1/17

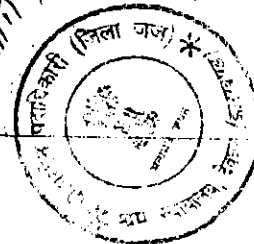

भारतीय स्टेट बैंक  
State Bank Of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST RAJMAHAL  
DIST: GODDA, JHARKHAND 814156  
Tel: 8437-228715 IRS Code: SBIN0007265

किसी 2 वर्षों के लिए भी (VALID FOR 2 MONTHS ONLY)  
D D M M Y Y Y Y Y Y

16-09-2016

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRINCIPLE INCHARGE जॉय जॉके ऑफिस पर OR ORDER  
ऑफिसर, LABOUR COURT, LEGOHAR. ---  
रुपये RUPEES EIGHT LAC SEVENTY NINE THOUSAND EIGHT HUNDRED ONLY. ---

अथवा करें ₹ 8,79,800.00

अ. नं.  
Ac No. 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT AC

PREFIX:  
1516200002

EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212822⑈ 814002709⑈ 000001⑈ 29

203



ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/89

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Sanjay Kumar Sahi, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 7,78,560/- in respect of Late Sanjay Kumar Sahi, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP),ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

Received with signature  
A. C. ...  
11/1/17



भारतीय स्टेट बैंक  
State Bank of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST RAJMAHAL  
DIST. GODDA, JHARKHAND 814119  
Tel: 6437-228715 IFS Code : SBIN007265

शेड 2 में बैंक के लिए 30 दिनों के भीतर केवल 30 दिनों के लिए  
D D M M Y Y Y Y Y Y

PAY EMPLOYEE'S COMPENSATION COMMISSIONER OUR PRESIDENCY का या उनके अधिकार पर ORDER  
OFFICER, LABOUR COURT, DEOGHAR,  
₹ 7,78,550.00

अथवा करें ₹ 7,78,550.00

16-09-2015

आ. सं.  
A/c No

11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212808⑈ 814002709⑈ 000001⑈ 29

(2071)





## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/५०

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Md. Nurul, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,61,120/- in respect of Late Md. Nurul, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

*[Signature]*  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP), ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A.C. no 07  
11/1/17*



$$Z(\lambda) = \frac{1}{\Gamma(\lambda)} \int_0^\infty t^{\lambda-1} e^{-t} dt = \frac{1}{\Gamma(\lambda)} \int_0^\infty t^{\lambda-1} e^{-t} dt = \frac{1}{\Gamma(\lambda)} \int_0^\infty t^{\lambda-1} e^{-t} dt = \frac{1}{\Gamma(\lambda)} \int_0^\infty t^{\lambda-1} e^{-t} dt.$$

107265 - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, MAHAGAMA  
DIST. GODDA, JHARKHAND 814115A  
Tel: 6437-228715. F/S Code : SBIND007265

DATE 3 MONTHS FROM DATE VALID FOR 1 MONTHS ONLY

7	1	0	7	2	0	1	7
D	D	M	M	Y	Y	Y	Y

ENTRY ONLY: ₹ 8,61,120.00  
अदा करें

**11524367010**

**VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH**

**PREFIX:**  
**1516200002**

**Please sign above**

"222809" 814002709: 000001" 29

**EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT**

209



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/91

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Jai Prakash Rai, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 7,58,240/- in respect of Late Jai Prakash Rai, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP),ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A.C. Nandy  
11/1/17*



भारतीय स्टेट बैंक  
State Bank Of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST MAHAGAMA  
DIST. GODDA, JHARKHAND 814114  
Tel: 6437-228715 IFSC Code : SBIN007265

शेष 3 महीने के लिए ही वैध (VALID FOR 3 MONTHS ONLY)  
111012047  
D D M M Y Y Y Y

16-09-2016

PAYEMPLOYEE'S COMPENSATION COMMISSIONER ONM PRECISE LING को या उनके आदेश पर OR-ORDER.  
OFFICER, LABOUR COURT, DEOGHAR.  
₹ 7,58,240.00

अ. अ.  
अ. अ.

11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

१२१२८११ ८१५००२१०९: ०००००१ २९

(211)



ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/92

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Nageshwar Paswan, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,39,680/- in respect of Late Late Nageshwar Paswan, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
Area Personnel  
11/1/17*



(213)

भारतीय स्टेट बैंक  
State Bank of India

(07269) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJAMAGAR POST, RAJMAHAL  
DIST. GONDIA, JHARKHAND 814154  
Tel: 6437-22875/5 Code: SBIN007269

Serial 3 नहीं है और भी जारी नहीं किया गया है  
1 1 0 1 2 0 1 7  
D D M M Y Y Y Y

PAYEMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING OFFICER, LABOUR COURT, DEOGHAR. ---  
एक रुपयों अठ्ठाईस लाख तीस हजार नौ सौ हजार छह सौ अठ्ठाईस हजार केवल रूपयों में  
अवकाश ₹ 9,39,680.00

16-09-2016

चालान नं०  
A/C No 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT A/C  
PREFIX:  
1516200002

EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212815⑈ 814002709⑈ 000001⑈ 29



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/ ~~94~~ 93

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Ajit Patel, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,54,280/- in respect of Late Ajit Patel, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP), ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A. C. M. M. M.  
11/1/17*



16-09-2016

भारतीय स्टेट बैंक  
State Bank of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URLANAGAR POST, RAJMAHAL  
DIST. GODDA, JHARKHAND 831114  
Tel: 6437-228715 IRS Code: SBIN0007265

VALID FOR 3 MONTHS ONLY  
D D M M Y Y Y Y  
1 1 0 0 1 1 1 1

PAYEE EMPLOYEE'S COMPENSATION COMMISSIONER OLM PRESIDENCY या उनके आदेश पर ~~OR ORDER~~  
OFFICER, LABOUR COURT, DEOGHAR.  
रुपये RUPEES FIFTY LAC FIFTY FOUR THOUSAND TWO HUNDRED EIGHTY ONLY.

अर्थात् ₹ 8,54,280.00

अ/c नं.  
11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

*[Signature]*  
EASTERN COAL FIELDS LTD. - A/C: RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212810⑈ 814002709⑈ 000001⑈ 29

215





ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/94

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Sakil Khan, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,61,120/- in respect of Late Sakil Khan, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.


Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP), ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

Received with return  
A. K. Mishra  
11/1/17

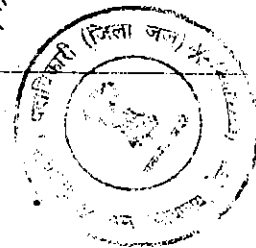

16-09-2016

भारतीय स्टेट बैंक  
State Bank of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, RAJMAHAL  
DIST. GODDA, JHARKHAND 814124  
Tel: 6437-228715 IFS Code: SBIN0007265

अनुप  
D D M M Y Y Y Y  
1 1 0 1 2 6 1 7

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING OFFICER, LABOUR COURT, LEISHAR. ---  
रुपये RUPEES EIGHT LAC SIXTY ONE THOUSAND ONE HUNDRED TWENTY ONLY ---  
आवा करे ₹ 8,51,120.00

सं. नं.  
A/C NO 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT A/C

PREFIX:  
1516200002

EASTERN COAL FIELDS LTD - A/C RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212817⑈ 814002709⑈ 000001⑈ 29

217



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/95

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Vikash Patel, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,39,680/- in respect of Late Vikash Patel, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

  
11/01/17  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP),ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Record with meelom  
A.V. nayan  
11/1/17*



16-09-2016

**भारतीय स्टेट बैंक**  
**State Bank Of India**

(07280) - RAJMAHAL COAL MINING PROJECT (NCMP)  
URJANAGAR POST RAJMAHAL  
DIST: GODDA, JHARKHAND 814115  
Tel: 6437-228715 IRS Code: SBIN007280

शेड 3 एच 3 ए (एन. डी. वैलिड फॉर 3 मॉन्थ्स ऑनली)  
1 1 0 1 4 0 1 7  
D D M M Y Y Y Y

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING OFFICER, LABOUR COURT, DEOGHAR. —  
₹ 8,39,580.00


अक्षरों में ₹ 8,39,580.00

अ. नं.  
11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOUSE BRANCH

  
EASTERN COAL FIELDS LTD. - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 2 1 2 8 1 1 ⑈ 8 1 1 0 0 2 7 0 9 ⑈ 0 0 0 0 0 1 ⑈ 2 9

219



ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/96

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Sunil Bhengra, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,39,680/- in respect of Late Sunil Bhengra, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

  
11/01/17  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.


The TS to Director(P), ECL HQ.

The General Manager(OP),ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A.L. 11/01/17*

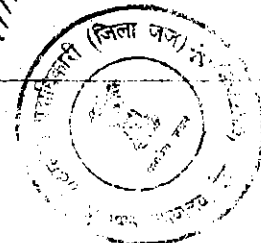

16-09-2016

**भारतीय स्टेट बैंक**  
**State Bank of India**

(07269) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, RAJMAHAL  
DIST. GODDA, JHARKHAND 814134  
Tel: 8437-228/15 IFB Code: SBIN0007255

वैधता 3 महीने के लिए है, वैधता 3 महीने के लिए है  
D D M M Y Y Y Y

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING  
OFFICER, LABOUR COURT, DEOGHAR, ---  
रुपये RUPEES EIGHT LAC THIRTY NINE THOUSAND SIX HUNDRED EIGHTY ONLY ---  
को या उसके आदेश पर OR ORDER---

अदा करें ₹ 8,33,560.00

आ. नं.  
A/c No. 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT AC

PREFIX:  
1516200002

EASTERN COAL FIELDS LTD - AC-RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212823⑈ 814002709⑈ 000001⑈ 29

221



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुड़ा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/९३

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Ajay Kumar Kushwaha Alias Kuleshwar Kumar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount (Cheque) of Rs. 8,96,000/- in respect of Late Ajay Kumar Kushwaha Alias Kuleshwar Kumar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

*11/01/17*  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP), ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A-10-1000  
11/1/17*



भारतीय स्टेट बैंक  
State Bank Of India

(07269) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJAMAGAR POST RAJMAHAL  
DIST: GODDA, JHARKHAND 814114  
Toll: 6437-228715 IFS Code: SBIN007265

वैधता की अवधि 3 माह की है, वैधता के 3 माह के लिए ही  
D D M M Y Y Y Y

PAYEE EMPLOYEE'S COMPENSATION COMMISSIONER & JUDGE PRESIDENTIAL को या उनके आदेश पर OR ORDER  
OFFICER, LABOUR COURT, DEOGHAR. ---  
रुपये RUPEES FIFTY LAC NINETY SIX THOUSAND ONLY. ---

अदा करें ₹ 8,96,000.00

16-09-2016

चैक नं.  
A/C No.

11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

EASTERN COAL FIELDS LTD. - AC - RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212815⑈ 814002709⑈ 000001⑈ 29

223





## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/98

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar(Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Md. Julfikar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,67,640/- in respect of Late Md. Julfikar, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

14/01/17  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.


The TS to Director(P), ECL HQ.

The General Manager(OP), ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.

Received with enclosure  
A-10-10000  
11/1/17

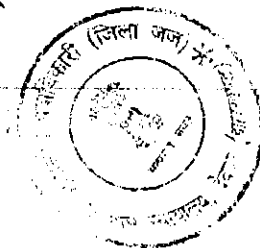

16-09-2016

भारतीय स्टेट बैंक  
State Bank of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST RAJMAHAL  
DIST GODDA, JHARKHAND 814154  
Tel: 0437-228715 IRS Code : SBIN0007265

आवृत्ति 2 वर्षों में एक बार की जा सकती है।  
1 1 0 1 2 0 1 7  
D D M M Y Y Y Y

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDENTING को या उनके अधिकार पर OR ORDER  
OFFICER, LABOUR COURT, DEOGHAR. —  
रुपये RUPEES FIFTY LAQ SIXTY SEVEN THOUSAND SIX HUNDRED FORTY ONLY. —

अथवा करे ₹ 8,57,640.00

आ. नं.  
A/C No 11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT A/C

PREFIX:  
1516200002

*[Signature]*  
EASTERN COAL FIELDS LTD - AC-RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212812⑈ 814002709⑈ 000001⑈ 29

225



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/११

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAI. Accident of Late Md. Jamir, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,47,160/- in respect of Late Md. Jamir, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

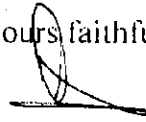  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP), ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A.C. array  
11/1/17*



भारतीय स्टेट बैंक  
NCP State Bank of India

(07263) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, MAHAGAMA  
DIST: GODDA, JHARKHAND 814134  
TEL: 8437-228715 IFS Code: SBIN007265

वैधता अवधि के लिए वैध / VALID FOR 3 MONTHS ONLY  
1 1 0 1 2 0 1 7  
D D M M Y Y Y Y

15-09-2016

PAY EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING OFFICER  
OFFICER, LABOUR COURT, LEGHAR. ---  
₹ 8,47,150.00  
अदा करें ₹ 8,47,150.00

आ. नं.  
A/C NO 11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

  
EASTERN COAL FIELDS LTD - MC- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

॥ २१२८१८॥ ८१५००२७०१॥ ०००००१॥ २९

227



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोइडा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/100

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Raj Kamal Goswami, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,67,640/- in respect of Late Raj Kamal Goswami, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly **acknowledge** the same and compensation amount may kindly be disbursed to the **dependents** of the deceased.

Yours faithfully

11/01/17  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP),ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Received with me  
A.C. Singh  
11/1/17*



State Bank of India

(07285) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, RAJMAHAL  
DIST: GODDA, JHARKHAND 814154  
Tel: 6437-228715 IFS Code: SBIN0007285

वर्ष 1 महीने के लिए वैध / VALID FOR 1 MONTH ONLY  
D D M M Y Y Y Y Y Y Y Y

16-09-2016

PAYEE EMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDENTIAL OFFICER, LABOUR COURT, DEOGHAR.  
₹ 8,57,540.00

आ. सं.  
A/C No.

11524367010

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

CURRENT AC

PREFIX:  
1516200002

EASTERN COAL FIELDS LTD - A/C- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

११२४३६७०१० ८१५००२७०१६ ०००००११ २९

229

230



## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/101

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.


Sub: Deposit of compensation amount for FATAL Accident of Late Sanjit Viswakarma, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,67,640/- in respect of Late Sanjit Viswakarma, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

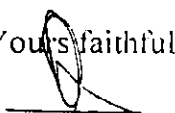  
Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.  
The General Manager(I/c), RGOM.  
The TS to Director(P), ECL HQ.  
The General Manager(OP),ROCP  
The Manager, ROCP  
The Area Finance Manager, Rajmahal Area.

*Received with enclosure  
A.C. 1004  
11/1/17*



16-09-2016

भारतीय स्टेट बैंक  
State Bank Of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCMP)  
URJANAGAR POST, MAHAGAM  
DIST. GODDA, JHARKHAND 814154  
Tel: 6437-228715 JFS Code : SBIN007265

शेष 3 वर्गों के लिए ही वैधता प्राप्त होगी  
1 1 0 1 2 0 1 7  
D D M M Y Y Y Y

PAYEMPLOYEE'S COMPENSATION COMMISSIONER CUM PRESIDING  
OFFICER, LABOUR COURT, DEOGHAR. — को या उनके अधिकार पर OR-ORDER

रुपये RUPEES EIGHT LAKS SIXTY SEVEN THOUSAND SIX HUNDRED FORTY ONLY. —

अदा करें ₹ 8,57,540.00

अ. सं.  
A/c No 11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

  
EASTERN COAL FIELDS LTD. - MC- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

⑈ 212820⑈ 811002709⑈ 000001⑈ 29

231





## ईस्टर्न कोलफील्ड्स लिमिटेड

राजमहल खनि समूह

महाप्रबंधक (प्रभारी) का कार्यालय

धनकुंडा, पोस्ट- बड़ा सिमरा, जिला- गोड्डा, झारखण्ड - 814165

पत्रांक- ECL/RJML/GMI/Control Room/102

दिनांक - 10.01.2017

To

**The Employee's Compensation Commissioner-cum-Presiding Officer**  
Labour Court Deoghar (Under Employee's Compensation Act 1923)  
Deoghar.

Sub: Deposit of compensation amount for FATAL Accident of Late Laddu Yadav Alias Laddu Prasad, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 at Rajmahal OCP.

Dear Sir,

Enclose please find herewith compensation amount(Cheque) of Rs. 8,31,920/- in respect of Late Late Laddu Yadav Alias Laddu Prasad, employee of M/s. MIPL-NKAS(JV) Contractor, who died in the incident occurred on 29-12-2016 in the prescribed form i.e. Form 'A' along with calculation sheet.

Kindly acknowledge the same and compensation amount may kindly be disbursed to the dependents of the deceased.

Yours faithfully

Area Personnel Manager  
Rajmahal Area.

Copy to:

The General Manager(P&IR), ECL HQ.

The General Manager(I/c), RGOM.

The TS to Director(P), ECL HQ.

The General Manager(OP), ROCP

The Manager, ROCP

The Area Finance Manager, Rajmahal Area.



233

भारतीय स्टेट बैंक  
State Bank of India

(07265) - RAJMAHAL COAL MINING PROJECT (RCP)  
URJANAGAR POST MAHAGAMA  
DIST: GODDA, JHARKHAND 814114  
Tel: 6437-228715 IFS Code: SBIN0007265

11 01 2016  
11 01 2016  
11 01 2016

16-09-2016

PAYEE EMPLOYEE'S COMPENSATION COMMISSIONER'S OFFICE  
OFFICER, LABOUR COURT, LEGOHAR.  
₹ 8,31,920.00  
अवकाश  
₹ 8,31,920.00

11524367010

CURRENT A/C

PREFIX:  
1516200002

VALID UPTO ₹ 50 LACS AT NON-HOME BRANCH

EASTERN COAL FIELDS LTD. - AC- RAJMAHAL PROJECT

MULTI-CITY CHEQUE Payable at Par at All Branches of SBI

Please sign above

212821 8140027091 000001 29