





SAFETY ALERT: 28

Parasia, dated 27-11-2025

SUBJECT: Fatal accident occurred due to <u>Fall of person (0999) during pumping operation</u> at <u>Pump</u> Station at 1650Level of 01st Vertical Shaft of (UG) mine.

1. Name of Mine : Ukwa Manganese Mine

2. Name of Owner : M/s MOIL District : Balaghat

State : Madhya Pradesh 3. Mineral : Manganese

4. Date and time of

accident

19.06.2025 (09:30 Hours)

5. Place of accident : Pump Station at 1650Level of 01st Vertical Shaft

6. Killed : Name: Vinay Khandeshwar

Designation: Contractor worker

Age: 30 Years

Experience: 01 year and 2 months


7. Seriously Injured : Ni

8. Brief Cause : "While a contractual workman was standing on pump foundation to

operate the butte valve, at a height of 1.8m above the running pump in an underground metalliferous mine, suddenly his legs slipped and he fell on the running motor-pump connecting shaft coupler, his body was dragged around it causing grave injuries to which he succumbed while

being transported from underground to surface".

9. Sketch showing the accident:

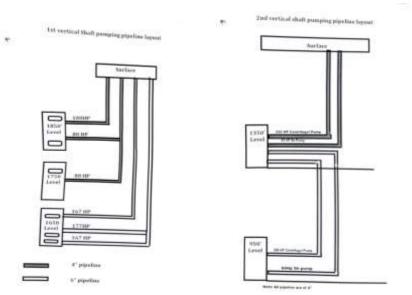

- 10. Best Practices
- : a) The motor-pump connecting shaft coupler been properly fenced by suitable guard of substantial construction and securely kept in position.
- b) The butterfly valve used to open the delivery pipeline of the 167HP pump at 1.8m height been kept properly greased and maintained.